



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 69070
Promised Date: 29 OCT 22



Customer #: 52094
MILLAY, BENJAMIN A.



CUSTOMER WORK ORDER

WO #: 69070 (Appointment Date: 25 OCT 2022 - Time: 11:00am)

Customer: 52094 - MILLAY, BENJAMIN
A. - 270-316-9929

Tag:

Author: BJW

Location: 1027 CHECK STATUS WITH
DKM

Stock #: 10602

Stock Desc: (10602) 2022 COACHMEN

CATALINA 323BHDSCCKLE

Chassis #: 5ZT2CAXB5NX023347

Serial #: 5ZT2CAXB5NX023347

Mileage:

Licence:

Invoice #:

Date In: 25 OCT 22

Promised: 29 OCT 22

Date Sched:

Completed: 25 OCT 22

Warr. Date: 20 NOV 21

Job #22V243 - Warranty

COMPLAINT: RECALL 22V243 LP QUICK CONNECT

CAUSE: 22V243 - RECALL 22V243 LP QUICK CONNECT.

CORRECTION: Checked LP quick connect for recall. Connector has "ENERCO GROUP" on side of slider. Removed Lp quick connector. Cleaned threads on brass barb fitting. Applied gas thread sealant to threads. Installed new LP quick connector. Performed LP drop test for (3) Mins. No leaks.

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	45.00
Subtotal for Job #22V243:			45.00

Job #BRAKE - Warranty

COMPLAINT: JOB #22V477 BRAKE AWAY SWITCH WIRING RECALL

CAUSE: BRAKE - JOB #22V477 BRAKE AWAY SWITCH WIRING RECALL.

CORRECTION: Cut hole in underbelly for access to terminal block. Had to dig out all of spray foam that covered wires and terminal block. Removed brake away power wire from terminal block. Removed battery disconnect switch from frame mount. Added ring terminal to wire and connected to cable from battery. Remounted disconnect switch on frame. Checked operation of brake-away switch after recall. OK. Added underbelly tape to seal up hole that was cut in underbelly.

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	45.00
Subtotal for Job #BRAKE:			45.00

Job #3 - Internal

COMPLAINT: THE REAR SLIDE HAS A WRINKLE IN THE MEMBRANE ON THE ROOF

CAUSE: THE REAR SLIDE HAS A WRINKLE IN THE MEMBRANE ON THE ROOF.

CORRECTION: Checked rubber roof on rear slidout. Did not find any wrinkles on roof. The outer edge next to flange is raised up a little. This is the roof sealing tape. No areas where water could get in.

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C



Subtotal for Job #3: 0.00

Job #4 - Internal

COMPLAINT: THERE DOESN'T SEEM TO BE ANY DIFFERENCE BETWEEN HIGH AND LOW ON THE A/C

CAUSE: THERE DOESN'T SEEM TO BE ANY DIFFERENCE BETWEEN HIGH AND LOW ON THE A/C.

CORRECTION: Plugged unit in and turned A/C on. Can hear the difference between "High" fan and "Low" fan. Used an Air Flow meter to verify. "High" fan showed (6.8). "Low" fan showed (5.3).

Labor Code	Description	Mechanic DKM	Total N/C
Z990	MISC LABOUR CODE (EXTERNAL)		
Subtotal for Job #4:			0.00

Job #5 - Internal

CUSTOMER WOULD LIKE A PRICE FOR ADDING A 2ND A/C

Subtotal for Job #5: 0.00

Job #6 - External

REFER DOOR IS DRAGGING

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
Subtotal for Job #6:				0.00

Parts Total: 0.00
Labour Total: 90.00
Sublet Total: 0.00
Extras Total: 0.00
WORK ORDER TOTAL: 90.00

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Date: 25 Oct 2022

Customer Signature : _____

Customer #: 52094
MILLAY, BENJAMIN A.