



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 69224
Promised Date:
20 NOV 22



Customer #:
37126



CUSTOMER WORK ORDER

WO #: 69224 (Appointment Date: 08 NOV 2022 - Time: 09:30am)

Customer: 37126 - TULEY, KERRY L. -
812-779-9272

Tag:

Author: BJW

Location: 1213 CHECK STATUS WITH
BB

Stock #: 10956

Stock Desc: 2022 TT COACHMEN

SPIRIT 2557RB

Chassis #: 5ZT2SBRBXNS042799

Serial #: 5ZT2SBRBXNS042799

Mileage: 0

Licence:

Invoice #:

Date In: 08 NOV 22

Promised: 30 NOV 22

Date Sched:

Completed: 10 DEC 22

Warr. Date: 21 FEB 22

Job #1 - Internal

COMPLAINT: AWNING HAS A SMALL TEAR FRONT RIGHT SIDE NEAR THE CAMPER

CORRECTION: there is a small tear at top of awning. i think this is on a recall list. i took pics on one drive

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C

Parts

Part #	Description	Qty	Price	Total
4940	18' SOLERA REPLACEMENT FABRIC-SOLID BLACK	1.00	N/C	N/C

Subtotal for Job #1: 0.00

Job #2 - Internal

COMPLAINT: AWNING DOES NOT COME ALL THE WAY IN

CAUSE: INSTALLED NEW AWNING CANVAS

CORRECTION: INSTALLED NEW AWNING CANVAS

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	RAB	N/C

Subtotal for Job #2: 0.00

Job #3 - Internal

COMPLAINT: THE FLOOR HAS A TEAR IN IT FROM THE SLIDE ABOUT IN THE MIDDLE OF THE SLIDE

CAUSE: NEED TO HAVE BRETT FIX

CORRECTION: THERE WAS A NAIL STICKING OUT OF THE BOTTOM OF SLIDE ROOM. I FILED THE NAIL DOWN FLUSH WITH BOTTOM OF SLIDE ROOM.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	BB	N/C





Z990 MISC LABOUR CODE (EXTERNAL) BB N/C

Parts

Part #	Description	Qty	Price	Total
F100191226	LINOLEUM, CC360 DIAMONDFLOR 8' WESTPORT HARBOR LIGHT (SPIRIT 2021)	9.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-LINOLEUM	1.00	N/C	N/C

Subtotal for Job #3: 0.00

Job #4 - Internal

COMPLAINT: WATER HEATER IS LEAKS AT THE PLUG CHECK AND ADVISE

CORRECTION: I PUT TEFLON TAPE ON THE THREADS AND PUT CAP ON WAITED FOR WATER HEATER TO FILL UP. AND IT DOESNT LEAK.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	N/C

Subtotal for Job #4: 0.00

Job #5 - Warranty

COMPLAINT: ELE WATER HEATER NOT WORKING

CORRECTION: THE HOT WIRE TO THE ELEMENT WAS A LITTLE LOOSE. I THIGHTNED IT UP AND TURNED WATER HEATER ON. 30-40 MIN LATER THE WATER WAS HOT

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	15.00

Subtotal for Job #5: 15.00

Job #6 - Warranty

COMPLAINT: THE MOTION SENSOR LIGHTS THEY STAY ON ALL THE TIME THERE IS ONE IN THE BATHROOM AND 2 ARE IN THE BEDROOM

CORRECTION: need to order 2 motion sensors. i gave info to matt

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	RAB	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	60.00
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	0.00

Parts

Part #	Description	Qty	Price	Total
C01305732	LIGHT, MOTION ACTIVATED FLOOR MOUNT LED 4W 12V BLACK	2.00	8.36	16.72

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-LIGHTS	1.00	15.96	15.96

Subtotal for Job #6: 92.68

Job #7 - Internal

COMPLAINT: CEHCK THE TV HAVING ISSUES WITH THE TV AND CABLE NOT CONNECTION CUSTOMER STATES THE CABLES ARE LOOSE

CORRECTION: CHECKED WITH OUR PDI TV TO MAKE SURE IT WAS RECIEVING SIGNAL.TIGHTENED UP THE COAX CABLE IN BED ROOM AND RAN CHANEL SEARCH ON BOTH



TVS AND RECIEVED CHANEL CONNECTION ON BOTH TVS.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	N/C
Subtotal for Job #7:			0.00

Job #8 - Internal

COMPLAINT: LOOK AT THE UNDER BELLY AND MAKE SURE IT IS NOT COMING APART AND FILL HOLES AS NEEDED

CORRECTION: I REPAIRED 6 AREAS ON THE UNDER BELLY

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	N/C
Subtotal for Job #8:			0.00

Job #9 - Warranty

COMPLAINT: LR REAR TAIL LIGHT IS NOT FLUSH STICKS OUT

CAUSE: THERE WERE NO SCREWS IN THE TAIL LIGHT AND WAS ONLY HOLDING ON BY SILICONE

CORRECTION: I SCREWED THE TAIL LIGHT BACK IN AND RESILICONED AROUND LIGHT

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	30.00
Subtotal for Job #9:			30.00

Job #10 - Internal

COMPLAINT: TABLE DOES NOT SET RIGHT CUSTOMER KEEPS SPILLING DRINKS

CORRECTION: adjusted the table legs the best i could. they were not sitting in the floor flange very well.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	N/C
Subtotal for Job #10:			0.00

Job #11 - Internal

COMPLAINT: RADIO WILL COME ON AT RANDOM TIMES

CORRECTION: the unit was in my bay for 1 1/2 day and the radio never came on

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	N/C
Subtotal for Job #11:			0.00

Job #12 - Warranty

COMPLAINT: THE STAY JACKS RODS ARE BENT THE RR IS THE WORST

CORRECTION: THE WORM GEAR IS BENT ON RIGHT REAR JACK. NEED AUTHORIZATION

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	30.00

W/O: 69224
Promised Date:
30 NOV 22



Customer #:
37126



Subtotal for Job #12: 30.00

Job #22V243 - Warranty

COMPLAINT: RECALL 22V243 LP QUICK CONNECT

CORRECTION: INSTALLED NEW LP VALVE. AS PER RECALL

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DWW	45.00

Subtotal for Job #22V243: 45.00

Parts Total: 16.72
Labour Total: 180.00
Sublet Total: 0.00
Extras Total: 15.96

WORK ORDER TOTAL: 212.68

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 10 Dec 2022

W/O: 69224
Promised Date:
30 NOV 22



Customer #:
37126

