



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 69435
Promised Date: 28 NOV 22

CUSTOMER WORK ORDER

WO #: 69435

Customer: 1000 - BASDEN'S
AMERICAN RV -

Tag:
Author: BJW
Location: 1220 CHECK WORK

Stock #: 11009
Stock Desc: 2023 TT FOREST RIVER
CHEROKEE 264DBH
Chassis #: 4X4TCKB28PX160993
Serial #: 4X4TCKB28PX160993
Mileage:
Licence:

Invoice #:
Date In: 28 NOV 22
Promised: 30 NOV 22
Date Sched:
Completed: 20 DEC 22
Warr. Date:

Job #PDINTT - Internal

Transferred to BAS*69497 on 06 DEC 22
Estimate amount was 0.00
PDI - NEW TRAVEL TRAILER

Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C
Z991	MISC LABOUR CODE (INTERNAL)	ZMS	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
LPGI	LP - UNIT SALES	0.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #WINTER - Internal

Transferred to BAS*69497 on 06 DEC 22
Estimate amount was 0.00
WINTERIZE UNIT AND DRAIN HOLDING TANKS.
INCLUDES 2 GALLONS OF ANTI-FREEZE
UNITS WITH WASHING MACHINE OR ICEMAKER
WILL BE EXTRA
DE-WINTERIZATION IS NOT INCLUDED
NUMBER OF GALLONS USED _____

Labor

Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	ZMS	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #WINTER: 0.00

Job #1 - Warranty

COMPLAINT: FURANCE MAKING A NOISE WHEN RUNNING



Customer #: 1000





CAUSE: FURANCE MAKING A SOUND. PULLED THE INTAKE OFF UNHOOKED THE GAS LINE AND BENCH TESTED IT AND FURANCE IS NOT MAKING A NOISE. PUT THE FURANCE BACK IN AND FOUND THE FAN MAKING NOISE AND HITTING THE GASKET ON THE FLOOR WAS TORE UP AND NEEDS REPLACED ALSO

CORRECTION: recieve new blower fan then installed on furnace and bench tested. placed furnace inside camper and tested furnace again.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	135.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Parts

Part #	Description	Qty	Price	Total
69-7047	350206 SUBURBAN BLOWER WHEEL	1.00	14.74	14.74
7586	SUBURBAN A/C FURNACE GASKET	1.00	3.23	3.23

Subtotal for Job #1: 152.97

Job #2 - Warranty

COMPLAINT: WATER HEATER DOOR HAS SILICONE ALL OVER IT

CAUSE: door was sealed on the hinge side from factory with geocell.

CORRECTION: removed door from flange. pulled off larger chunks from door. got a small pan and filled with mineral spirits to soften up sealer. removed from mineral spirits and cleaned the rest off with a towel. cleaned up excess from water heater flange. installed door.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	15.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00

Subtotal for Job #2: 15.00

Job #3 - Warranty

COMPLAINT: BEDROOM DOOR IS HITTING DOOR FRAME

CAUSE: DOOR IS RUBBING ON DOOR LATCH.

CORRECTION: REMOVED DOOR LATCH AND PLASTIC DOOR FRAME. TOOK A CHISEL AND CUT AWAY WOOD TO MAKE LATCH PULL INTO THE FRAME. INSTALLED FRAME AND LATCH. CLEANED UP MESS.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	30.00

Subtotal for Job #3: 30.00

Job #4 - Warranty

COMPLAINT: BLACK MARKS ON SLIDE OUT CEILING

CAUSE: MARK ON CIELING NEXT TO LIGHT.

CORRECTION: REMOVED WITH MINERAL SPIRITS AND A TOWEL

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	30.00

Subtotal for Job #4: 30.00





Job #5 - Warranty

COMPLAINT: BLACK SILICONE ON DOOR THRESHOLD

CAUSE: SILICONE NEEDS REMOVED

CORRECTION: REMOVED WITH MINERAL SPIRITS AND A TOWEL

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	45.00
Subtotal for Job #5:			45.00

Job #6 - Internal

COMPLAINT: TOILET SEAT HAS SCRATCHES ALL OVER IT

CAUSE: BEN SAID THEY WERE NOT THAT BAD.

CORRECTION: NO CORRECTIONS.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Subtotal for Job #6:			0.00

Job #7 - Internal

COMPLAINT: MISSING REMOTE FOR FIREPLACE

CAUSE: pulled furnace to get model and serial numbers for remote. 12/5/22

CORRECTION: DOES NOT HAVE A REMOTE

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Subtotal for Job #7:			0.00

Job #8 - Warranty

COMPLAINT: ACCENT LIGHT FOR OUTSIDE IS BROKEN (WOLF HOLOGRAM LIGHT)

CAUSE: ACCENT LIGHT WAS BROKEN REPLACED AND TESTED

CORRECTION: ACCENT LIGHT WAS BROKEN REPLACED AND TESTED

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	RAB	118.50
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	30.00

Parts

Part #	Description	Qty	Price	Total
F100327988	LIGHT, DRGLO WOLF HEAD EXTERIOR LOGO LIGHT	1.00	26.21	26.21

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-LIGHT	1.00	15.89	15.89
Subtotal for Job #8:				190.60

Job #9 - Internal

ROOF NEEDS DICOR TOUCHED UP IN SEVERAL SPOTS





Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Parts				
Part #	Description	Qty	Price	Total
13-1320	PW HAPS FREE SELF-LEVELING DICOR	1.00	N/C	N/C

Subtotal for Job #9: 0.00

Job #10 - Internal

COMPLAINT: EXHAUST FAN FOR STOVE IS RATTLING

CAUSE: fan blade is warped and is hitting the cover when running.

CORRECTION: removed old fan blade. got new fan blade from parts. new blade "insert" is smaller than the post coming off the motor. had to remove motor from vent assembly and force fan blade on. installed motoer and cover. ran fan. fan is no longer rubbing.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Parts				
Part #	Description	Qty	Price	Total
65484	95-PRESENT JENSEN 1/8" BORE CW	1.00	N/C	N/C

Subtotal for Job #10: 0.00

Job #11 - Warranty

COMPLAINT: SUBWOOFER FOR RADIO ISNT WORKING

CAUSE: puuled radio to check connections. all connections are good. removed subwoofer from ceiling. wire terminal came loose.

CORRECTION: crimped terminal with pliers and secured to speaker. installed subwoofer to ceiling.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	30.00

Subtotal for Job #11: 30.00

Job #12 - Warranty

COMPLAINT: FRONT SCREEN DOOR LATCH NEEDS TO BE ADJUSTED.

CAUSE: latch isnt holding door.

CORRECTION: loosened screws and pulled down latch so it will hold onto screen door.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	15.00

Subtotal for Job #12: 15.00



W/O: 69435
Promised Date:
30 NOV 22



Parts Total:	44.18
Labour Total:	448.50
Sublet Total:	0.00
Extras Total:	15.89
WORK ORDER TOTAL:	508.57

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 20 Dec 2022

Customer Work Order

Customer #:
1000

