



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 69443
Promised Date:
24 DEC 22



CUSTOMER WORK ORDER

WO #: 69443

Customer: 1000 - BASDEN'S
AMERICAN RV -

Tag:

Author: PH

Location: 1215 BH TO CLOSE. THIS IS
APPROVED

Stock #: 10894

Stock Desc: 2023 TT FOREST RIVER
CHEROKEE WOLF PUP 25JB

Chassis #: 5ZT2CKPB8PY028366

Serial #: 5ZT2CKPB8PY028366

Mileage: 0

Licence:

Invoice #:

Date In: 29 NOV 22

Promised: 31 DEC 22

Date Sched:

Completed: 15 DEC 22

Warr. Date:

Job #PDINTT - Internal

COMPLAINT: Transferred to BAS*69498 on 06 DEC 22

Estimate amount was 0.00

PDI - NEW TRAVEL TRAILER

CAUSE: PDINTT - PDI NEW TRAVEL TRAILER.

CORRECTION: Moved unit into shop from sales lot. Removed battery from battery box. Drilled drain holes in bottom of box. Put strap under box and secured box to frame. Replaced battery in box and connected battery cables. Filled LP tank. Checked all exterior lights and brakes. Checked lug nuts and set tire pressure at 65 psi. Leveled unit and operated stab jacks. Checked awning and roof. Checked exterior door and all compartment doors. Checked all interior lights. Checked all windows and blinds. Checked all cabinets and drawers. Checked all electrical outlets and GFCI outlets. Checked all USB outlets. Recorded all model and serial numbers and took pictures. Applied company decals. Added water to freshwater tank and flushed antifreeze from water lines and faucets. Checked all water lines and faucets for leaks. Performed LP drop test and set LP pressure at 10 in.wc. Filled all holding tanks and checked monitor panel. Operated all appliances. Checked TV Antenna with Shop test TV. Both cable outlets pick up channels. Secured wires hanging down under road side of unit. Moved unit back to sales lot.

Customer #:
1000



Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
LPGI	LP - UNIT SALES	0.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #WINTER - Internal

COMPLAINT: Transferred to BAS*69498 on 06 DEC 22

Estimate amount was 0.00

WINTERIZE UNIT AND DRAIN HOLDING TANKS.

INCLUDES 2 GALLONS OF ANTI-FREEZE





UNITS WITH WASHING MACHINE OR ICEMAKER
 WILL BE EXTRA
 DE-WINTERIZATION IS NOT INCLUDED
 NUMBER OF GALLONS USED _____

CAUSE: WINTER - WINTERIZE UNIT AND DRAIN HOLDING TANKS. *** INCLUDES 2 GALLONS OF
 ANTI-FREEZE *** UNITS WITH WASHING MACHINE OR ICEMAKER WILL BE EXTRA.
 DE-WINTERIZATION IS NOTV INCLUDED NUMBER OF GALLONS USED 2

CORRECTION: Connected air to city water inlet and blew out all water lines and faucets. No by-pass on
 water heater. Added antifreeze to all water lines and faucets, including outside shower. Poured antifreeze
 in all drain traps. Drained all holding tanks. Water heater is tank-less.

Labor			
Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	DKM	N/C

Other Services				
Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
Subtotal for Job #WINTER:				0.00

Job #1 - Warranty

COMPLAINT: FRONT CAP IS DENTED DRIVERS SIDE

CAUSE: FRONT CAP IS DENTED ON DRIVERS SIDE.

CORRECTION: Front sheet metal is wavy next to corner trim at top of roadside edge. Taped off area and
 filled void at trim with clear silicone.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	75.00
Subtotal for Job #1:			75.00

Job #3 - Warranty

COMPLAINT: SLIDE OUT FACIA "TOP" HAS STAPLES POKING OUT

CAUSE: SLIDE OUT FACIA "TOP" HAS STAPLES POKING OUT.

CORRECTION: Removed brad nail that was sticking out of facia trim. Filled hole with matching putty.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	15.00
Subtotal for Job #3:			15.00

Job #4 - Internal

COMPLAINT: WALL PANEL IN BEDROOM HAS A HOLE IN IT

CAUSE: WALL PANEL





WALL PANEL IN BEDROOM HAS A HOLE IN IT.

CORRECTION: Checked wall panel. Found small hole in it next to window. Filled small hole in wall panel next to window with color matching putty.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Subtotal for Job #4:			0.00

Job #5 - Warranty

COMPLAINT: LP TANK STRAP LATCH IS BROKEN

CAUSE: LP TANK STRAP LATCH IS BROKEN.

CORRECTION: Checked loose strap on lp tank. Latch is broken on strap. Turned in parts request for a new strap.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	22.50
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	22.50

Parts

Part #	Description	Qty	Price	Total
F100060395	STRAP, LP TANK/SPARE TIRE HOLD DOWN, 52" W/STEEL CAM	1.00	4.93	4.93
Subtotal for Job #5:				49.93

Job #6 - Warranty

COMPLAINT: CEILING LIGHT OVER DINETTE WON'T WORK

CAUSE: LIGHT OVER DINETTE TABLE DOES NOT WORK.

CORRECTION: Checked operation of ceiling light over dinette table. Does not come on with switch. Removed from ceiling. Wiring to light have power and are connected correctly. Disconnected light from power wires. Connected directly to battery still does not work no matter which position switch is in. Turned-in parts request for a new ceiling light. 12/8/2022: Received new ceiling light. Installed new ceiling light over dinette. Checked operation of new light. OK. Moved unit back to sales lot.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	18.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	12.00

Parts

Part #	Description	Qty	Price	Total
5221	LIGHT, 4 1/2" LED PUCK LIGHT WITH SWITCH *SEND TOP AND BOTTOM* DD RACK	1.00	2.43	2.43

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-LIGHT	1.00	15.95	15.95
Subtotal for Job #6:				48.38



W/O: 69443
 Promised Date:
 31 DEC 22



Customer #:
 1000



Job #7 - Warranty

COMPLAINT: RADIO NOT WORKING...ONLY STATIC

CAUSE: RADIO NOT WORKING--ONLY STATIC.

CORRECTION: Removed radio from cabinet. Checked all speaker connections. All good. Checked antenna connection. Connector on cable was loose. Cut off connector and installed new coax connector. Radio now playing without static. Remounted radio back in cabinet.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	15.00

Subtotal for Job #7: 15.00

Job #8 - Warranty

COMPLAINT: PANTRY DOOR WONT LATCH CLOSED...NOTED AT TIME OF DELIVERY.

CAUSE: PANTRY DOOR WONT LATCH CLOSEDNOTED AT TIME OF DELIVERY.

CORRECTION: Latch plate mounted too low and too far back. Removed latch plate. Trimmed plastic door frame and enlarged plunger hole. Remounted latch plate to align with door knob plunger. Door now latches closed.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	30.00

Subtotal for Job #8: 30.00

Job #9 - Warranty

COMPLAINT: THE BLACK TANK FLUSHER HOSE IS PINCHED FLAT

CAUSE: THE BLACK TANK FLUSHER HOSE IS PINCHED FLAT.

CORRECTION: The FACTORY ran the black tank flusher hose between the frame and floor smashing it flat tight. Can not pull hose out. Cut hose off on both sides of frame. Cut piece of new hose to fit and spliced together around frame.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	45.00

Parts

Part #	Description	Qty	Price	Total
51132	1/2" BRASS PEX COUPLING	2.00	1.53	3.06
C01292790	1/2" BLUE PVC HIGH PRESSURE HOSE	2.00	0.24	0.48

Subtotal for Job #9: 48.54

Parts Total: 10.90
 Labour Total: 255.00
 Sublet Total: 0.00
 Extras Total: 15.95
WORK ORDER TOTAL: 281.85

