

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	1439596
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CAZB4PX028622
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$160.00	SITE/WAREHOUSE	205 / 205
OWNER INFORMATION		ITEM #	ACAT343BHTSLE
		DEALER RO #	69895
		CLAIM START DATE	02/27/2023
		CLAIM END DATE	01/01/1900

Retail Date of Purchase

WARRANTY EXPIRATION DATE

Claim Line Details

Labor

Line# 1

Operation Code	Operational Description			
24-70-147-001769	TV Coax Cable - Repair/Appliances/Television			
Complaint, Cause, Correction				
Original Note : bhoffman@americanrvcenter.com, 2023-02-27 12:57:59 :: TEST TV WONT PICK UP CHANNELS Checked all cables for correct location on back of booster. Checked to see if all cables are good. Cable on roof TV antenna had insulator over center coax preventing it from making contact with antenna terminal. Ran channel scan again and TV picked up channels. Outside coax locations were labeled wrong. Added label to cable location on roadside. Changed label on curbside to read only Sattelite instead of Cable/Sattelite. Remounted booster beck in wall.				
Model #	Dlr Sub Hrs	1.10	Sub Labor Amt	\$176.00
Serial #	Appr Hrs	1.10	Appr Labor Amt	\$176.00

Notes

AUTHORIZED AS REQUESTED

Labor

Line# 2

Operation Code	Operational Description			
02-20-66-000664	Entry Door - RV - Adjust/Exterior/Entry Doors			
Complaint, Cause, Correction				
Original Note : bhoffman@americanrvcenter.com, 2023-02-27 12:59:29 :: ENTRY AND SCREEN DOOR NEED ADJUSTED. NOTED ON DELIVERY Screen door is hard to close and latch. Entry door has to be slammed to latch closed, then it is hard to open. Adjusted hinges on screen door to allow it to close and stay closed. Adjusted entry door latch. Ground door frame behind latch plate to allow more adjustment. Entry door now easier to close and latch.				
Model #	Dlr Sub Hrs	0.30	Sub Labor Amt	\$48.00
Serial #	Appr Hrs	0.30	Appr Labor Amt	\$48.00

Notes

AUTHORIZED AS REQUESTED

Labor

Line# 3

Operation Code	Operational Description			
01-30-102-001117	Trim Molding, each - Replace/Interior/Panels, Ceilings, & Interior Moldings			
Complaint, Cause, Correction				
Original Note : bhoffman@americanrvcenter.com, 2023-02-27 13:00:14 :: TRIM LOOSE ON INSIDE OF ENTRY DOOR. NOTED ON DELIVERY Trim next to entry door on the inside is loose and not secured to wall. Reattached trim with brad nails. Filled all holes with matching putty.				
Model #	Dlr Sub Hrs	0.20	Sub Labor Amt	\$32.00
Serial #	Appr Hrs	0.20	Appr Labor Amt	\$32.00

Notes

AUTHORIZED AS REQUESTED

Submitted

Labor Amt	\$256.00
Parts & Freight	\$0.00
Total	\$256.00

Approved

Labor Amt	\$256.00
Parts & Freight	\$0.00
Total	\$256.00

**DEALER
SIGNATURE**

DATE

I certify that I have performed these repairs consistent with Forest River Policies.

**CUSTOMER
SIGNATURE**

DATE

All repairs described have been inspected and are satisfactory.