

e-Authorization

3/1/20
10:40:25 :

3-Authorization number PA03378839 Reference no: 69917 Status: Approved Approved by steic Approved date 3/1/2023
Billing Name Address VIN Retail sold on

34	Basden's American RV	Basden's American RV 600 E Baseline Rd Evansville, IN 47725	4YDTSGG18PW10223			
du Root e operation of	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty
						Base hours
1	6100915B Drain Valves - We	0.00	0.50	0.50		1
						1.00
	Complaint:BLACK TANK DUMP VALVE WILL NOT CLOSE Cause:BLACK TANK DUMP VALVE WILL NOT CLOSE. Correction:Knife blade groove full of glue. Removed damaged black tank dump valve. Installed new dump valve. Tightened all bolts securely. Checked for leaks. OK.					
2	6103318A Pump - Repair - E	0.00	1.00	1.00		1
						0.20
	Complaint:NO ACCESS TO WATER PUMP Cause:NO ACCESS TO WATER PUMP. Correction:No access to water pump that is mounted under sleeper couch. Removed sleeper couch for access to water pump and water tank. Cut access hole in panel below couch. Used black plastic panel to cover access hole. Cut water line from fresh water tank to water pump. Inserted a winterizing kit in line to winterize unit. Remounted sleeper couch.					
	KRV – Unit built in accordance with current manufacturing specifications. KRV - Goodwill this per CTS					
3	3200114B Door - Interior Hin	0.00	4.00	2.00		1
						0.50
	Complaint:BATHROOM DOOR WILL NOT CLOSE Cause:BATHROOM DOOR WILL NOT CLOSE. Correction:Removed lock side door jamb that was bowed out, too long. Trimmed bottom end of door jamb. Trimmed bathroom side wall panel that was uneven. Door still hits door jamb on lock side. Removed door from door jamb. Removed hinges from door. Cleared out material on door where hinges mount to door. Recessed hinges on door. Reindtalled door on door frame. Door now closes and latches closed. Corner trim next to bathroom door not flush eith wall. Removed corner trim. Wall panel not flush with corner of wall allowing corner trim to not be flush with wall when installed. Trimmed wall panel from ceiling to floor. Remounted corner trim flush with wall. Trimmed ceiling and floor flat trim pieces to fit corner trim. Reattached all trim to wall. Filled all staple holes with matching putty.					

r paper claims only use one pre-authorization number per warranty claim for
iple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim
m. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the

Pre-Authorization

3/1/20
10:40:25

Job Root	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty	Base hours	Complaint / Cause / Correction
3-Authorization number PA03378839				3.50				KRV - The issue submitted is not considered a warranty defect in materials or workmanship KRV- no manufacture defect presented - defect not seen in photos

For paper claims only use one pre-authorization number per warranty claim for multiple copies of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the