



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 69917
Promised Date:
28 FEB 23



Customer #:
1000



CUSTOMER WORK ORDER

WO #: 69917

Customer: 1000 - BASDEN'S

AMERICAN RV -

Tag:

Author: BH

Location: 0302 CHECK PREAUTH

Stock #: 11139

Stock Desc: 2023 TT KEYSTONE

SPRINGDALE 1740RK

Chassis #: 4YDTSGG18PW102231

Serial #: 4YDTSGG18PW102231

Mileage:

Licence:

Invoice #:

Date In: 23 FEB 23

Promised: 28 FEB 23

Date Sched:

Completed: 28 FEB 23

Warr. Date:

Job #1 - Internal

COMPLAINT: PDI NEW TRL. PW102231 SPRINGDALE

CAUSE: PDI NTT - PDI NEW TRAVEL TRAILER.

CORRECTION: Moved unit into shop from front lot. Filled LP tank. Checked all exterior lights and brakes. Checked lug nuts and set tire pressure st 80 psi. Checked roof and awning. Operated stab jacks. Checked power cord. Checked converter output. Checked all interior lights. Checked all electrical outlets and GFCI outlets. Checked all USB outlets. Checked all windows and blinds. Checked all cabinets and drawers. Checked foldout front bed. Adjusted screen door latch. Applied all company decals. Removed all packing and shipping tape from all appliances. Addes water to fresh water tank. Flushed all water lines and faucets. Checked all water lines and faucets for leaks. Filled all holding tanks and checked monitor panel. Performed LP drop test and set LP pressure at 11 in.wc. Checked operation of all appliances. Connected air pressure to unit and blew out all water lines and faucets. Added antifreeze to water lines and faucets. Poured anbtifreeze in all drain traps. Checked TV antenna with test TV. Remounted Ceiling booster that was falling out of ceiling. Took pictures and recorded all serial numbers. Drained all holding tanks. Moved unit to sales lot.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	N/C

Other Services

Code	Description	Qty	Price	Total
LP20	20 LB. LP CYLINDER	1.00	N/C	N/C

Subtotal for Job #1: 0.00

Job #2 - Warranty

COMPLAINT: BLACK TANK DUMP VALVE WILL NOT CLOSE

CAUSE: BLACK TANK DUMP VALVE WILL NOT CLOSE.

CORRECTION: Knife blade groove full of glue. Removed damaged black tank dump valve. Installed new dump valve. Tightened all bolts securely. Checked for leaks. OK.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	80.00





Parts

Part #	Description	Qty	Price	Total
24449	3" WASTE VALVE	1.00	14.50	14.50

Subtotal for Job #2: 94.50

Job #3 - Warranty

COMPLAINT: NO ACCESS TO WATER PUMP

CAUSE: NO ACCESS TO WATER PUMP.

CORRECTION: No access to water pump that is mounted under sleeper couch. Removed sleeper couch for access to water pump and water tank. Cut access hole in panel below couch. Used black plastic panel to cover access hole. Cut water line from fresh water tank to water pump. Inserted a winterizing kit in line to winterize unit. Remounted sleeper couch.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	DKM	0.00
Z990	MISCELLANEOUS REPAIR	DKM	160.00

Parts

Part #	Description	Qty	Price	Total
3780	ACCESS PANEL	1.00	2.29	2.29
27910	36543 PUMP WINTERIZATION KIT	1.00	16.77	16.77
10-0926	1/2" BARB STRAIGHT ADAPT	2.00	2.59	5.18

Subtotal for Job #3: 184.24

Job #4 - Warranty

COMPLAINT: BATHROOM DOOR WILL NOT CLOSE

CAUSE: BATHROOM DOOR WILL NOT CLOSE.

CORRECTION: Removed lock side door jamb that was bowed out, too long. Trimmed bottom end of door jamb. Trimmed bathroom side wall panel that was uneven. Door still hits door jamb on lock side. Removed door from door jamb. Removed hinges from door. Cleared out material on door where hinges mount to door. Recessed hinges on door. Reinstalled door on door frame. Door now closes and latches closed. Corner trim next to bathroom door not flush with wall. Removed corner trim. Wall panel not flush with corner of wall allowing corner trim to not be flush with wall when installed. Trimmed wall panel from ceiling to floor. Remounted corner trim flush with wall. Trimmed ceiling and floor flat trim pieces to fit corner trim. Reattached all trim to wall. Filled all staple holes with matching putty.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	DKM	320.00
Z990	MISCELLANEOUS REPAIR	DKM	0.00

Subtotal for Job #4: 320.00

Parts Total: 38.74
 Labour Total: 560.00
 Sublet Total: 0.00
 Extras Total: 0.00
WORK ORDER TOTAL: 598.74

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

