

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 69986
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 1000 - BASDEN'S AMERICAN RV
Address: 600 E. BASELINE RD. EVANSVILLE, IN
USA
47725

Phone:

Stock Number: 11010 - 2023 CHEROKEE 274WK 4X4TCKC25PX161419

VIN: 4X4TCKC25PX161419 HIN: SER#: 4X4TCKC25PX161419

Mileage: 0 Work Order Comp: 13 MAR 23

Auth. No: Dealer #:

Warr. Date: Work Order Date: 02 MAR 23 Inv #: 388445

WO # Job # Description JOB INFORMATION

69986 5 PUMP COVER RIDE COVER BROKEN
TOOK PICTURES OF THE ACCESS DOOR THE OVER RIDE OF THE HYDRULICS
PUMP TO SLIDEROOMS. GOT A NEW DOOR THEN REMOVED THE SCREWS AND
CUT THE GEOSEAL FROM BODY. THEN INSTALLED NEW ACCESS DOOR TO
OVERRIDE PUMP WITH SCREWS AND SILICONE.PUT DAMAGE PART IN WARRANTY
SHELF

69986 1 THERMOSTATE FOR A/C AND FURANCE IS FLASHING E3 CODE
AFTER PLUGGING CAMPER INTO SHORE POWER NOTICED THE THERMOSTAT WAS
FLASHING AN E3 CODE. PUULED THE COVER OFF AT FURNACE TO CHECK
CONNECTIONS. ALL CONNECTIONS AT FURNACE WAS GOOD. NEXT WENT TO
THE AC AND PULLED THE COVER OFF. WHILE MOVING WIRES AROUND FOUND
A BAD CONNECTION ON THE GREEN GROUND WIRE TO THERMOSTAT. CHECKED
THE BUTT CONNECTER FOUND THE WIRE NOT SUCURED IN PROPER AS IT WAS
LOOSE. ADJUSTED THE WIRE IN BUTT CONNECTION. THE E3 CODE WENT
AWAY AFTER FIXING THIS WIRE. TOOK PICTURES.

69986 2 BED ROOM DOOR FROM HALL WAY DOES NOT SHUT
TOOK PICTURES OF DOOR NOT SHUTING AT THE BOTTOM RIGHT CORNER.
REMOVED THE LATCH PLATE,DOOR,DOOR MOLDINGS. CHECKED DOOR FOR
SQUARE, THE RIGHT BOTTOM CORNER WAS HITTING AND WAS NOT SQUARE.
NOTICED THE STUD WAS TWISTED. DROVE THE SCREW IN FUTHER WERE IT
SET AGAINST THE WALL. CHECKED FOR CLEARANCE. THEN PUT THE DOOR
MOLDING BACK ON. SCREWED THE LATCH PLATE BACK ON. LAST THE DOOR
WENT BACK ON. NOW DOOR DOES NOT HIT AT THE BOTTOM.

Claim : 69986

```

*****
WO #      Job #   Description      JOB INFORMATION
*****
69986      3      IN THE SLIDE OUT THE PULL PEICE FELL OFF THE BLIND PULLER
                WHEN OPENNING THE SLIDE OUT NOTICE THE REAR BLIND HAD FELL APART.
                PULLED BLIND DOWN AND ASSEMBLE BLIND BACK TOGETHER. TOOK PICTURES
                OF BLIND.

69986      4      SHOWER DOOR IS NOT OPENING PROPERLY
                WHEN DOING THE PDI AND CHECKING THE SHOWER NOTICED THE DOOR ON
                THE RIGHT WOULD DRAG WHEN OPENNING. THE DRAG OF THE DOOR WOULD
                TWIST ON ITS HANGERS. AFTER INSPECTING THE RIGHT SIDE DOOR
                HANGERS AT THE TOP WAS OUT OF ADJUSTMENT CAUSING THE DOOR TO
                DRAG. USED A SCREWDRIVER TO ADJUST THE SCREW TILL DOOR DID NOT
                DRAG.TOOK PICYURES.

```

```

*****
Part No      Job#   Description      PARTS      Qty      Price      Total
*****
THE94330      5      94330 BLK DLX ROUND ELEC/CABLE HA  1.00      6.85      6.85

```

```

*****
Lab Code  Job#   Description      LABOUR      Hrs      Rate      Total
*****
Z990      5      MISC LABOUR CODE (EXTERNAL)      0.20      160.00      32.00
Z990      1      MISC LABOUR CODE (EXTERNAL)      0.70      160.00      112.00
Z990      2      MISC LABOUR CODE (EXTERNAL)      0.20      160.00      32.00
Z990      3      MISC LABOUR CODE (EXTERNAL)      0.05      160.00      8.00
Z990      4      MISC LABOUR CODE (EXTERNAL)      0.25      160.00      40.00

```

```

Parts Total:      6.85
Labour Total:      224.00
Sublet Total:      0.00
Extras Total:      0.00

```

>>>> Claim Total: 230.85

Customer Signature: _____

Date: _____