

BASDEN RV CENTER, INC D.B.A. AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 70149
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 1000 - BASDEN'S AMERICAN RV
Address: 600 E. BASELINE RD. EVANSVILLE, IN
USA
47725
Phone:
Stock Number: 11258 - 2023 CHEROKEE GREY WOLF 26DJSE 5ZT2CKRB0PF004460
VIN: 5ZT2CKRB0PF004460 HIN: SER#: 5ZT2CKRB0PF004460
Mileage: 0 Work Order Comp: 30 MAR 23
Auth. No: Dealer #:
Warr. Date: Work Order Date: 22 MAR 23 Inv #: 389079

WO # Job # Description JOB INFORMATION

70149 3 LATCH BROKEN ON WATER HEATER DOOR
LATCH IS BROKEN ON DOOR
DOOR AND FRAME IS INSTALLED CROOKED AND LATCH IS BROKRN, USE HEAT
GUN TO SOFTEN GEOCEL, USE HEAT GUN AND PLASTIC PUTTY KNIFE TO
GET SEALER OFF OF METAL, INSTALL NEW DOOR AND FRAME, TAPE OFF
AROUND DOOR AND RESEAL, PUT UNIT OUT ON LOT

70149 4 OFF DOOR SIDE SWITCH NOT WORKING
FIND TRAILER ON SALES LOT AND CLOSE UP AND PULL IN, FOUND NO
POWER TO LIGHT, TRACED BACK AND FOUND LIGHT HAS 2 SWITCHES IN
LINE ONE AT LIGHT AND ONE ON MONITOR PANEL WITH BOTH SWITCHES ON
LIGHT WORKS NO NOTES IN TICKET ON WHY LIGHT WAS ODERED, WAS TOLD
TO CHANGE LIGHT SEE DM

70149 1 FOUR RECEPTICLES ON GFI SHOW OPEN NEUTRAL
FOUR RECEPTICALS ON GFIC SHOW OPEN NEUTRAL.
Removed the two recepticals by kitchen sink. Removed back of
both recepticals. Found the closest to window had a neutral wire
was not pushed down into groove to make contact. Pushed wire
into groove and checked receptical. Now receptical is good and
other three are good also.

70149 2 INVERTER IN FRONT BEDROOM HAS OPEN GROUND
INVERTER IN FRONT BEDROOM HAS OPEN GROUND.
No literature in packet for this option. Removed from wall to
check wiring. Only two 12 volt wires goin to it. This inverter

Claim : 70149

 WO # Job # Description JOB INFORMATION

 is a charge station for a cell phone. Only 5.3 volts. Remounted
 on wall. put a label in it to read "CELL PHONE ONLY".

70149 5 ROOF VENT CAP COMING OFF
 ROOF VENT CAP COMING OFF.
 Vent cap coming off because vent pipe is sticking up too much to
 allow cap to be mounted correctly. Removed mounting screw. Cut
 1" from end of vent pipe to allow cap to sit down on base.
 Reattached vent cap and sealed screw.

 Part No Job# Description PARTS Qty Price Total

 F100345503 3 WATER HEATER, 15" X 15" HINGED DO 1.00 23.24 23.24
 90M13170A 3 GEOCEL 2300 CLEAR SEALANT 1.00 7.48 7.48
 F100214327 4 LIGHT, PORCH LIGHT AT UTILITY CEN 1.00 4.06 4.06

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 3 MISC LABOUR CODE (EXTERNAL) 0.20 160.00 32.00
 Z990 4 MISC LABOUR CODE (EXTERNAL) 0.00 160.00 0.00
 Z990 4 MISC LABOUR CODE (EXTERNAL) 0.20 160.00 32.00
 Z990 4 MISC LABOUR CODE (EXTERNAL) 0.00 160.00 0.00
 Z990 1 MISC LABOUR CODE (EXTERNAL) 0.60 160.00 96.00
 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.40 160.00 64.00
 Z990 5 MISC LABOUR CODE (EXTERNAL) 0.50 160.00 80.00

 Excode Job# Description EXTRAS Qty Price Total

 FRT 3 UPS- JOBS 3 & 4 1.00 19.85 19.85

Parts Total: 34.78
 Labour Total: 304.00
 Sublet Total: 0.00
 Extras Total: 19.85

>>>> Claim Total: 358.63

Customer Signature: _____

Date: _____