

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	1469622
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CKRB0PF004460
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$160.00	SITE/WAREHOUSE	086 / 086A
OWNER INFORMATION		ITEM #	CKT26DJSE-86
		DEALER RO #	70149
		CLAIM START DATE	03/23/2023
		CLAIM END DATE	01/01/1900

Retail Date of Purchase

WARRANTY EXPIRATION DATE

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description			
	40-108-24-11-001334	110 Volt Interior Wiring - Electrical/110 Volt Interior/Repair/Electrical			
	Complaint, Cause, Correction				
	Original Note : bhoffman@americanrvcenter.com, 2023-03-23 16:03:22 :: FOUR RECEPTICLES ON GFI SHOW OPEN NEUTRAL FOUR RECEPTICALS ON GFIC SHOW OPEN NEUTRAL. Removed the two recepticals by kitchen sink. Removed back of both recepticals. Found the closest to window had a neutral wire was not pushed down into groove to make contact. Pushed wire into groove and checked receptical. Now receptical is good and other three are good also.				
	Model #	Dlr Sub Hrs	0.60	Sub Labor Amt	\$96.00
	Serial #	Appr Hrs	0.60	Appr Labor Amt	\$96.00
	Notes				
	Authorized as requested.				

Labor

Line# 2	Operation Code	Operational Description			
	40-196-24-11-001297	Interior 12 Volt Wiring - Electrical/12 Volt Interior/Repair/Electrical			
	Complaint, Cause, Correction				
	Original Note : bhoffman@americanrvcenter.com, 2023-03-23 16:06:33 :: INVERTER IN FRONT BEDROOM HAS OPEN GROUND INVERTER IN FRONT BEDROOM HAS OPEN GROUND. No literature in packet for this option. Removed from wall to check wiring. Only two 12 volt wires goin to it. This inverter is a charge station for a cell phone. Only 5.3 volts. Remounted on wall. put a label in it to read "CELL PHONE ONLY".				
	Model #	Dlr Sub Hrs	0.40	Sub Labor Amt	\$64.00
	Serial #	Appr Hrs	0.40	Appr Labor Amt	\$64.00
	Notes				
	Authorized as requested.				

Labor

Line# 3	Operation Code	Operational Description			
	70-167-01-00-001998	Water Heater Door Latch - Appliances/Water Heater (Suburban)/ Replace/No Tread Code			
	Complaint, Cause, Correction				
	Original Note : bhoffman@americanrvcenter.com, 2023-03-23 16:08:26 :: LATCH BROKEN ON WATER HEATER DOOR FOUND LATCH BROKEN NEEDS REPLACED REPLACE LATCH				
	Model #	NA	Dlr Sub Hrs	0.20	Sub Labor Amt \$32.00
	Serial #	NA	Appr Hrs	0.20	Appr Labor Amt \$32.00
	Notes				

Labor

Line# 4	Operation Code	Operational Description
---------	----------------	-------------------------

40-196-01-11-001306

LED Light - Electrical/12 Volt Interior/Replace/Electrical

Complaint, Cause, Correction

Original Note : bhoffman@americanrvcenter.com, 2023-03-23 16:10:06 :: OFF DOOR SIDE SWITCH NOT WORKING FOR LED LIGHT NEED TO REPLACE LIGHT SOMETIMES WORKS AND SOMETIMES IT DOESNT

Model #**Dlr Sub Hrs**

0.20

Sub Labor Amt \$32.00**Serial #****Appr Hrs**

0.20

Appr Labor Amt \$32.00**Notes****Labor**

Line# 5

Operation Code

20-63-01-00-000481

Operational Description

Vent - Exterior/Non-Power Roof Vent (Elixir & Hengs)/Replace/No Tread Code

Complaint, Cause, Correction

Original Note : bhoffman@americanrvcenter.com, 2023-03-23 16:13:58 :: ROOF VENT CAP COMING OFF
Vent cap coming off because vent pipe is sticking up too much to allow cap to be mounted correctly.
Removed mounting screw. Cut 1" from end of vent pipe to allow cap to sit down on base. Reattached vent cap and sealed screw.

Model #**Dlr Sub Hrs**

0.50

Sub Labor Amt \$80.00**Serial #****Appr Hrs**

0.50

Appr Labor Amt \$80.00**Notes****Submitted**

Labor Amt	\$304.00
Parts & Freight	\$0.00
Total	\$304.00

Approved

Labor Amt	\$304.00
Parts & Freight	\$0.00
Total	\$304.00

DEALER**DATE****SIGNATURE**

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER**DATE****SIGNATURE**

All repairs described have been inspected and are satisfactory.