

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	1540593
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CAUBXNX025891
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$160.00	SITE/WAREHOUSE	205 / 205
OWNER INFORMATION		ITEM #	ACAT293QBCKLE
		DEALER RO #	70665
		CLAIM START DATE	05/22/2023
		CLAIM END DATE	01/01/1900

Retail Date of Purchase

WARRANTY EXPIRATION DATE

Claim Line Details

Labor

Line# 1

Operation Code	70-187-01-11-002228	Operational Description
		Coleman AC Unit - complete (Read Notes!!!) - Appliances/Roof AC (Coleman-RVP)/Replace/Electrical
Complaint, Cause, Correction		
Original Note : bhoffman@americanrvcenter.com, 2023-05-22 12:16:55 :: BEN HOFFMAN Talked with ROBERT about the a/c A/C FAN MAKING LOT OF NOISE AC FAN MAKING A LOT OF NOISE. Removed AC shroud on roof. Base pan is bent bad. AC had to be dropped at factory. AC needs replaced. Removed inside plenum. Disconnected all wiring. Removed mounting bolts. Lifted damaged AC off of roof. Installed new AC on roof and aligned with hole in roof. Secured AC in place with mounting ring and bolts. Reconnected all wiring. Checked operation of AC. Putting out cold air. Remounted ceiling plenum and filters. New AC is Coleman Mod# 48204-066. Serial number 220437689.		
Model #	048204-066	Dlr Sub Hrs 1.50
Serial #	220041905	Appr Hrs 1.50
		Sub Labor Amt \$240.00
		Appr Labor Amt \$240.00
Notes		
AUTHORIZED AS REQUESTED INSTALL DAMAGE		

Labor

Line# 2

Operation Code	50-134-01-00-003645	Operational Description
		Outside Grill LP Hose with Valve - LP Gas/LP Gas System/Replace/No Tread Code
Complaint, Cause, Correction		
Original Note : bhoffman@americanrvcenter.com, 2023-05-22 12:22:02 :: LP HOSE FOR OUTSIDE STOVE IS TOO SHORT ITS 2IN SHORT GET ONE THAT FITS		
Model #		Dlr Sub Hrs 0.05
Serial #		Appr Hrs 0.05
		Sub Labor Amt \$8.00
		Appr Labor Amt \$8.00

Notes

Labor

Line# 3

Operation Code	01-30-95-000959	Operational Description
		Free Standing Dinette Table - Replace/Interior/Dinette
Complaint, Cause, Correction		
Original Note : bhoffman@americanrvcenter.com, 2023-05-22 12:22:52 :: DINETTE TABLE POSTS WOBBLE DINETTE TABLE POSTS WOBBLE Checked floor mounting sockets. One socket broken not allowing post to lock in. Removed black broken socket and replaced with an aluminum colored socket. Changed other floor socket to match replacement socket. Also factory posts will not lock into old or new sockets. Replaced both posts with silver posts to match floor sockets.		
Model #		Dlr Sub Hrs 0.50
Serial #		Appr Hrs 0.50
		Sub Labor Amt \$80.00
		Appr Labor Amt \$80.00

Notes
AUTHORIZED AS REQUESTED

Labor
Line# 4

Operation Code
01-70-147-001769

Operational Description
TV Coax Cable - Replace/Appliances/Television

Complaint, Cause, Correction

Original Note : bhoffman@americanrvcenter.com, 2023-05-22 12:23:58 :: TV WILL NOT PICK UP CHANNELS
TV WILL NOT PICK UP CHANNELS. Checked all cables on back of TV booster. All are in correct locations.
(THATS A FIRST). Removed TV antenna from its base on roof. Coax cable would not pull up and out of base
to check coax end. Had to cut base loose from roof. Checked antenna coax from booster to antenna.
Checks good. Checked TV with a test antenna. Picked up channels. Removed old antenna base. Cleaned
off old sealer. Installed new antenna base. Installed new antenna on base. Checked operation of new
antenna and TV. Now picks up channels. Sealed around base of antenna with Dicor. Remounted Booster
behind TV. Checked all other TV outlets.

Model #
Serial #

Dlr Sub Hrs 2.50
Appr Hrs 2.00

Sub Labor Amt \$400.00
Appr Labor Amt \$320.00

Notes
EXCESSIVE AMOUNT REQUESTED. ADJUSTED TO TYPICAL REPAIR TIME TO R/R ANTENNA BASE

Submitted

Labor Amt \$728.00
Parts & Freight \$0.00
Total \$728.00

Approved

Labor Amt \$648.00
Parts & Freight \$0.00
Total \$648.00

DEALER
SIGNATURE

DATE

I certify that I have performed these repairs consistent with Forest
River Policies.

CUSTOMER
SIGNATURE

DATE

All repairs described have been inspected and are satisfactory.