

e-Authorization

10/2/20
12:36:00 PM

Authorization number PA03509743 Reference no: 71428 Status: Approved Approved by papca Approved date 8/21/2023
 Billing Name Address Address VIN Retail sold on

34 Basden's American RV Basden's American RV 4YDTCGM21PL500604 4/13/2023
 600 E Baseline Rd
 Evansville, IN 47725

Job Root Job operation	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty	Base hours	Complaint / Cause / Correction
1	1210506B Slide Out Mechan	0.00	4.00	2.50		1	1.00	Complaint:THE CABLE ON THE SLIDE ROOM IS ABOUT TO BUST ON THE BOTTOM BACK Cause:CABLE MOUNT ON BOTTOM BACK OF SLIDEROOM MOUNTED TOO HIGH Correction:REMOVE TOP FACUAH FROM FROM SLIDEROOM,TO GET TO MOTOR AND CABLES, GET NEW CABLE KIT FROM PARTS, CUT BAD CABLE, REMOVE MOUNT FILL HOLES WITH SILACON, INSTALL MOUNT 5/8 IN LOWER, PULL NEW CABLE THROUGH WORKS AS PULLING OUT OLD CABLE, CUT TO FIT AND CONET UP, ADJUST CABLES, INSTALL FACUAH AND TRIM BOARDS, FILL NAIL HOLES, TEST SLIDROOM
2	2104316B Slide Out Box Fas	0.00	0.50	0.20		1	0.20	Complaint:THESLIDE SEAL RUBBER GASKETS ARE PEALING OFF Cause:GLUE has pulled loose Correction:Use new tape and super glue too reinstall seals KRV – REPAIR ONLY approved.
3	6100715A Drain Lines - Was	0.00	1.20	0.50		1	0.20	Complaint:THERE IS WATER UNDER THE SINK AND HAS DAMAGE UNDER THE KITCHEN SINK. DOES NOT KNOW IF IT IS STILL LEAKING Cause:T fitting above P trap has been leaking Correction:Bottom board of cabinet has water damage turn in PO
4	4103206B A/C - Coleman - F	0.00	2.00	1.50		1	1.00	CHECK for water leaks, found water leak trail on fittings at the P trap Tieten all fittings KRV – Labor time adjusted allowing for proper repair procedure to be performed. Complaint:LOOK AT A/C NOT COOLING AS GOOD AS IT SHOULD Cause:AC IS NOT PULLING 12 AMPS, ONLY PULLING 8.8 AMPS, LOW ON REFRIGERENT

For paper claims only, use one pre-authorization number per warranty claim for multiple copies of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the

e-Authorization

Job Root of operation	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty	Base hours	Complaint / Cause / Correction
5	3401216A Backsplash - Kitchen	0.00	0.30	0.30		1	0.10	Correction:RUN PERFORMANCE TEST AND FILL OUT WORK SHEET, 117.7 VAC, COMPRESSOR IS PULLING 8.8 AMPS, TEMPS OUT SIDE 67 DEGS, RETURN IS 55 DEG. AIR OUT IS 40 DEGS, TURN IN SHEET, KRV-VCB coleman approve to replace a/c and 1.50 labor
6	4201806B Awning - Main - H	0.00	2.00	0.50		1	1.00	Complaint:WE JUST INSTALLED AN AWNING ARM AND NOW IT IS LIMP AND WONT HOLD THE AWNING UP. FRONT ARM Cause:AWNING ARM adjustment bolt will not turn Correction:AWNING ARM adjustment bolt will not turn can not tighten up Turn in PO KRV- VCB approve to replace pitch arm only (do not replace awning arm)
				5.50				

3-Authorization number PA03509743

For paper claims ~~only~~ use one pre-authorization number per warranty claim for multiple copies of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the