



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 71495
Promised Date:
24 AUG 23

CUSTOMER WORK ORDER

WO #: 71495

Customer: 1000 - BASDEN'S AMERICAN
RV -
Tag: CLOSE IN AUG
Author: PH
Location: 0831 CHECK STATUS WITH
DKM

Stock #: 11175
Stock Desc: 2024 5W KEYSTONE
COUGAR HALF-TON 23MLE
Chassis #: 4YDFCGL21R2501873
Serial #: 4YDFCGL21R2501873
Mileage: 0
Licence:

Invoice #:
Date In: 18 AUG 23
Promised: 31 AUG 23
Date Sched:
Completed: 29 AUG 23
Warr. Date:

Job #PDINFW - Internal

COMPLAINT: PDI - NEW FIFTH WHEEL

CAUSE: PDINFW PDI NEW FIFTH WHEEL

CORRECTION: Moved unit into shop from sales lot. Filled LP tanks. Checked brakes and brake-away switch. Checked lug nuts and set tire pressure at 80psi. Checked auto leveling jacks. Checked powercord. Checked entrance door and all compartment doors. Checked awning. Checked all interior lights. Checked converter output. Checked all cabinets and drawers. Checked all windows and blinds. Checked all electrical outlets and GFCI outlets. Checked all USB outlets. Added water to fresh water tank. Flushed antifreeze from water lines and faucets. Checked all water lines and faucets for leaks. Performed LP drop test and set LP pressure at 11 in.wc. Checked operation of outside refrigerator and grille. Checked inside refrigerator, microwave, and range. Filled all holding tanks and checked monitor panel. Checked roof AC. Checked TV Antenna, main TV and all other TV outlets with test TV. Applied all company decals. Checked roof. Took pictures and recorded all serial numbers. Drained all holding tanks. Moved unit back to sales lot.

Labor

Code	Description	Mechanic	Total
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	DKM	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	DKM	N/C
Z991	PDI NEW FIFTH WHEEL (INTERNAL)	DKM	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
LPGI	LP - UNIT SALES	12.00	N/C	N/C

Subtotal for Job #PDINFW: 0.00

Job #1 - Warranty

COMPLAINT: BRAKE-AWAY SWITCH WILL NOT PULL

CAUSE: Brake-away switch will not pull

CORRECTION: Removed brake-away switch that would not pull causing cable to pull apart. Installed new switch and pull cable.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	DKM	32.00

Parts

Part #	Description	Qty	Price	Total
96-8382	Trailer Breakaway System Switch; Wi	1.00	19.17	19.17



Customer #: 1000
BASDEN'S AMERICAN RV,



Subtotal for Job #1: 51.17

Parts Total: 19.17
Labour Total: 32.00
Sublet Total: 0.00
Extras Total: 0.00

WORK ORDER TOTAL: 51.17

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 29 Aug 2023

W/O: 71495
Promised Date: 31 AUG 23



Customer #: 1000
BASDEN'S AMERICAN RV,

