



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 71505
Promised Date:
26 DEC 23



Customer #: 50350
FISCHER, DAVID



CUSTOMER WORK ORDER

WO #: 71505 (Appointment Date: 21 AUG 2023 - Time: 07:00am)

Customer: 50350 - FISCHER, DAVID -
8127745016

Tag:

Author: BH

Location: 1226 SEE IF PARTS ARE
HERE YET

Stock #:

Stock Desc: 2022 TT COACHMEN

CATALINA

Chassis #: 5ZT2CAZB8NX026806

Serial #: 5ZT2CAZB8NX026806

Mileage:

Licence:

Invoice #:

Date In: 21 AUG 23

Promised: 30 DEC 23

Date Sched:

Completed: 26 DEC 23

Warr. Date:

Job #2 - Warranty

COMPLAINT: OUTDOOR KITCHEN DOOR CATCHES WHEN TRYING
TO CLOSE

CAUSE: Door is hitting on all corners. Strut on rear of door is coming loose from door. Door is also pushed
towards the rear of the frame. Suggest getting new door and decals.
Door

CORRECTION: Remove old door. Put foam tape on new door. Remove old silicone on siding. Install new
door. Remove door and taped shims for proper gap around door. Put door back. Taped off and siliconed.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BB	64.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	96.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00

Parts

Part #	Description	Qty	Price	Total
F100297855	DOOR, BAGGAGE BK MT SILVER PS WHITE	1.00	696.84	696.84
F100278555	GRAPHIC, DC #7 RH MC 2022 203267	1.00	13.36	13.36
500627	CLEAR SIKASIL PLUS	1.00	16.59	16.59

Other Services

Code	Description	Qty	Price	Total
FRT	FREIGHT - JOBS 2,6,7	1.00	207.02	207.02

Subtotal for Job #2: 1,093.81

Job #3 - Internal

COMPLAINT: WHEN OPENING THE EXTERIOR ENTRY DOOR IT CATCHES AND YOU HAVE TO SLAM
IT TO SHUT IT

CAUSE: Had service advisor come outside to check door. Couldn't replicate complaint. Door opens without
catching and shuts easily.

CORRECTION: No correction

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C



Subtotal for Job #3: 0.00

Job #4 - Warranty

COMPLAINT: THERE IS A HOLE IN BEDROM SLIDE ROOM RUBBER MEMBRANE ON BACK FRONT SIDE OF THE FACIA

CAUSE: Small hole on the rubber membrane that wraps around slide room facia.

CORRECTION: Applied a piece of extreme tape over hole.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	48.00

Subtotal for Job #4: 48.00

Job #5 - Warranty

COMPLAINT: HANGER ROD SUPPORT IN FRONT CLOSET HAS COME LOOSE

CAUSE: Middle support came loose. Support is held mainly with staples and one screws.

CORRECTION: Applied liquid nails where the wood stiles meet. Installed screw to pull together. Let dry. Installed support to ceiling.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	32.00

Subtotal for Job #5: 32.00

Job #6 - Warranty

COMPLAINT: LEAK IN LARGE SLIDE ROOM AT EACH CORNER AT THE FLOOR. HAS DAMAGED THE WOOD ALONG THE FLOOR AN EACH SIDE

CAUSE: Ran slide room out. Took a ladder and inspected seals. The Wiper seal on the rear of the slide room was cut too short. The front side wiper seal has been glued to the inside seal and isn't sealing properly. Need to remove silicone and wiper seals and replace with new on both sides. ***there is also a piece of metal above slide room that needs sealed.***
Seals

CORRECTION: Removed both side seals and bulb seals. Installed new seals and put bulb seals back. Siliconed. And super glued tops together.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BB	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BB	320.00
Z990	MISC LABOUR CODE (EXTERNAL)	BB	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BB	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BB	0.00

Parts

Part #	Description	Qty	Price	Total
346810	Seal - Co-Extruded - Wiper - Single	16.00	2.93	46.88
F100285154	STILE, 18MM" X 1-1/2" X 8' CHILI TEA	16.00	0.52	8.32
F100285187	2.5" STILE	8.00	0.87	6.96

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-SEAL	1.00	19.53	19.53

Subtotal for Job #6: 401.69

W/O: 71505
Promised Date: 30 DEC 23



Customer #: 50350
FISCHER, DAVID





Job #7 - Warranty

COMPLAINT: WATER LEAK AND DAMAGE IN OUTSIDE KITCHEN.

CAUSE: Pulled unit into bay. Hookedup to water. Pressurized system. Ran water through sink. Check plumbing. Went inside and ran water through bathroom sink, toilet, and shower. After running water in shower I noticed water leaking into the bottom of the bathroom cabinet and also running through the wall and into the outdoor kitchen.

Wood

CORRECTION: Sealed shower surround and where the shower pan and wall meet. Let dry. Tested for leaks. No leaks present.

Remove drawers. Remove cover. Remove damaged wood stile on bottom. Cut new stile and drill pilot holes. Staple back 3/4" surport. Install new piece. Put drawers back and silicone bottom edge.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BB	800.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	0.00

Parts

Part #	Description	Qty	Price	Total
6631	STILE, LC 18MM" X 5-1/4" X 8' SQUARE	8.00	1.52	12.16
F100285188	3" CABINET STILE	16.00	0.91	14.56
F100130672	7/8" BATTEN VIPER TRUFFLE	10.00	1.71	17.10
F100130671	BATTEN, #195 GABLE LATTE, 7/8" X 8'	10.00	1.96	19.60

Other Services

Code	Description	Qty	Price	Total
FRT	FREIGHT - BATTEN	1.00	32.41	32.41

Subtotal for Job #7: 895.83

Parts Total: 852.37
 Labour Total: 1,360.00
 Sublet Total: 0.00
 Extras Total: 258.96
WORK ORDER TOTAL: 2,471.33

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 26 Dec 2023

