

# FOREST RIVER WARRANTY CLAIM FORM

<b>DEALER ACCOUNT #</b> 0005106 BASDEN RV CENTER INC DBA AMERICAN RV CENTER 600 E BASELINE ROAD EVANSVILLE, IN 47725 USA	<b>CLAIM STATUS</b> Authorized <b>CLAIM</b> 1690808 <b>CLAIM ORIGIN</b> WEB <b>ORIGINAL CLAIM ID</b> <b>VIN</b> 5ZT2CAUB6PX029262 <b>CHASSIS VIN</b> <b>MILEAGE</b> 0 <b>SITE/WAREHOUSE</b> 205 / 205 <b>ITEM #</b> ACAT293TQBSCKLE <b>DEALER RO #</b> 71649 <b>CLAIM START DATE</b> 09/28/2023 <b>CLAIM END DATE</b> 01/01/1900
<b>Labor rate:</b> \$160.00 <b>OWNER INFORMATION</b>	

Retail Date of Purchase

WARRANTY EXPIRATION DATE

## Claim Line Details

**Labor**  
Line# 1

<b>Operation Code</b>	<b>Operational Description</b>		
10-1-01-03-000056	Brake Magnet, per wheel - Frame & Chassis/Axles, Suspension/Replace/Service Brake System, Hydraulic & Electric		

**Complaint, Cause, Correction**  
 Original Note : bhoffman@americanrvcenter.com, 2023-09-28 10:03:19 :: RIGHT REAR BRAKE JUST SPINS RIGHT REARBRAKE JUST SPINS Removed tire and wheel. Removed brake drum from axle. Found that clip securing magnet to brake lever was missing allowing magnet come loose from lever and not apply brake on this wheel. Installed new clip. Remounted brake drum and tire and rim. Checked operation of brake on this wheel. OK.

<b>Model #</b>	NA	<b>Dlr Sub Hrs</b>	0.40	<b>Sub Labor Amt</b>	\$64.00
<b>Serial #</b>	NA	<b>Appr Hrs</b>	0.40	<b>Appr Labor Amt</b>	\$64.00

**Notes**

**Labor**  
Line# 2

<b>Operation Code</b>	<b>Operational Description</b>		
20-78-01-11-000805	Lippert Awning LED Light Strip - Exterior/Awnings (Lippert)/Replace/Electrical		

**Complaint, Cause, Correction**  
 Original Note : bhoffman@americanrvcenter.com, 2023-09-28 10:04:48 :: AWNING LIGHTS ARE INOP...POWER TO THE CONTROLLER (HARD WIRED TO THE LIGHT STRIP) AWNING LIGHTS NOT WORKING Moved unit into shop from sales lot. Cut wiring for awning lights loose. Removed awning light strip from awning rail. Installed new light strip in awning rail. Connected awning lights to power wires. Checked operation of awning light strip in all modes. Working OK. Secured wires in place behind track cover. Returned unit to sales lot.

<b>Model #</b>	V000739461	<b>Dlr Sub Hrs</b>	0.50	<b>Sub Labor Amt</b>	\$80.00
<b>Serial #</b>	V000739461	<b>Appr Hrs</b>	0.50	<b>Appr Labor Amt</b>	\$80.00

**Notes**

**Labor**  
Line# 3

<b>Operation Code</b>	<b>Operational Description</b>		
60-141-01-00-001575	Shower Faucet - Plumbing/Shower, Tub Surround/Replace/No Tread Code		

**Complaint, Cause, Correction**  
 Original Note : bhoffman@americanrvcenter.com, 2023-09-28 10:06:28 :: SHOWER FAUCET LEAKS ON COLD SIDE SHOWER FAUCET LEAKING AT COLD SIDE OF FAUCET. Found water dripping from faucet. Removed faucet assembly from shower wall. Found water dripping from coldside of the faucet. Removed water line fitting. Found cone washer was cut. Replaced cone washer and reconnected cold water line to back of faucet. Checked for leak. None found. Remounted faucet assembly to shower wall. Resealed with clear silicone around faucet housing.

Model #  
Serial #

Dlr Sub Hrs 0.40  
Appr Hrs 0.30

Sub Labor Amt \$64.00  
Appr Labor Amt \$48.00

**Notes**

EXCESSIVE AMOUNT REQUESTED  
CHANGED TO SIMILAR REPAIR TIME  
REPAIR NOT REPLACE

---

**Submitted**

Labor Amt \$208.00  
Parts & Freight \$0.00  
Total \$208.00

**Approved**

Labor Amt \$192.00  
Parts & Freight \$0.00  
Total \$192.00

---

DEALER

DATE

SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

---

CUSTOMER

DATE

SIGNATURE

All repairs described have been inspected and are satisfactory.