



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 71762

CUSTOMER WORK ORDER

WO #: 71762

Customer: 54059 - VANBIBBER, DANIEL

Tag: BH - PARTS ORDERED PER BH
9-27

Author: BH

Location: 1010 CHECKPARTS

Stock #:
Stock Desc: 2023 TK PALOMINO HRHS
8801
Chassis #:
Serial #: 4X4SHR703PN117591
Mileage:
Licence:

Invoice #:
Date In: 25 SEP 23
Promised:
Date Sched:
Completed: 30 SEP 23
Warr. Date:

Job #1 - Warranty

COMPLAINT: SOLAR PANEL CONNECTIONS THE RED ONE IS BROKEN

CAUSE: Solar plug roof mount

CORRECTION: Took pictures of solar plug roof mount. The positive side of the solar roof mount is broken. There is no damage to or on the roof. Put in po for new roof solar plug.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	32.00
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	0.00

Parts

Part #	Description	Qty	Price	Total
8563	SOLAR CABLE JUNCTION BOX W/2 SRA LEA	1.00	15.12	15.12

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-JUNCTION BOX	1.00	17.30	17.30

Subtotal for Job #1: 64.42

Job #2 - Warranty

COMPLAINT: THE SKYLIGHT OVER THE BATHROOM IS PEALING UP CHECK AND ADVISE

CAUSE: Roof Sealer not sticking to skylight

CORRECTION: Took pictures of sealer not sticking to skylight. Sealer needs pilled and new sealer applied, but need to scuff the the surface before applying new sealer.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	80.00
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	80.00

Subtotal for Job #2: 160.00

Job #3 - Warranty

COMPLAINT: FIND OUT WHY THE WATER HEATER IS NOT WORKING

CAUSE: Gas line to water heater

CORRECTION: Turned on the 12v and lp tanks. Checked water levels. Turned on the water pump then the water heater. Turned on the kitchen faucet and waited for the water heater control board to throw a code.



Customer #: 54059
VANBIBBER, DANIEL

And the code that showed up was E1, next Checked the lp line from lp tanks all the way to water heater. Removed the panel under the bathroom sink and found the lp hose was kinked. Went to the underbelly and pulled the lp hose downward to unkink the lp hose. After lp hose was unlinked then turned the kitchen faucet on causing the water heater control board to run properly. No codes showed up, water heater ran as should.

Labor Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	64.00
Subtotal for Job #3:			64.00

Parts Total: 15.12
Labour Total: 256.00
Sublet Total: 0.00
Extras Total: 17.30
WORK ORDER TOTAL: 288.42

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 02 Oct 2023

Customer #: 54059
VANBIBBER, DANIEL

