

e-Authozization

3-Authozization number PA03583424 Reference no: 72421 Status: Approved Approved by kiddz Approved date 12/11/2023

rvicing Name Address VIN Retail sold on

34	Basden's American RV	Basden's American RV 600 E Baseline Rd Evansville, IN 47725	4YDTCGM21PL500604	4/13/2023	
lu Root je operation of	Description	Sublet Sub hours	Approved hours	Actual hours	Qty Base Complaint / Cause / Correction
1	6103015A Kitchen Sink - Dre	0.00	2.00	2.00	1 0.20
Complaint:UNIT IS LEAKING UNDER THE KITCHEN SINK Cause:UNIT IS LEAKING UNDER KITCHEN SINK Correction:Kitchen sink is leaking on right side of double sink where sink strainer connects to sink. Sink strainer needs replaced. Disconnected drain pipes under kitchen sink. Removed sink strainer on rightside of sink. Cleaned mounting surface on sink. Installed new sink strainer. Connected all drain pipes. Filled sink with water and drained to check all drain pipe fittings for leaks. No leaks found. Filled sink again to check sink strainer for leaks. Filled sink with water. Water is leaking where sink strainer attaches to sink. Same as before replacing strainer. Disconnected drain pipes and removed sink strainer again. This time applied putty tape to sink strainer instead of rubber seal. Remounted sink strainer and reconnected drain pipes. Filled sink with water to check for leak. Let water stand in sink for 30 mins. No leak after 30 mins. Poured antifreeze in sink drain to rewinterize. Drained holding tank.					

3-Authozization number PA03583424

2.00

r paper claims only use one pre-authozization number per warranty claim for
ple a copy of this pre-authozization to a warranty claim form. Fill out the header information and the parts section on the claim
m. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the