



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 72427



CUSTOMER WORK ORDER

WO #: 72427

Customer: 1000 - BASDEN'S AMERICAN
RV -
Tag:
Author: BH
Location: 1230 CHECK PREAUTH

Stock #: 11300
Stock Desc: 2024 TT COACHMEN APEX
243FKS
Chassis #: 5ZT2CXNBXRS047006
Serial #: 5ZT2CXNBXRS047006
Mileage: 0
Licence:

Invoice #:
Date In: 28 NOV 23
Promised:
Date Sched:
Completed: 28 DEC 23
Warr. Date:

Job #PDINTT - Internal

COMPLAINT: PDI - NEW TRAVEL TRAILER

CAUSE: PDINTT. PDI - NEW TRAVEL TRAILER

CORRECTION: Moved unit into shop from sales lot. Removed LP tanks and filled. Installed new battery box. Checked all exterior lights and brakes. Checked lug nuts and set tire pressure at 65 psi. Checked roof and awning. Operated stab jacks. Checked power cord. Checked all interior lights. Checked converter output. Checked both entrance doors and all compartment doors. Checked all drawers and cabinet doors. Took pictures and recorded all serial numbers. Checked all windows and blinds. Checked all electrical outlets and GFCI outlets. Checked all USB outlets. Operated both Air Conditioners. Checked TV ANTENNA and main TV and all other TV locations. Checked inside and outside Refrigerators. Outside grille is missing hose to connect to LP. Added water to fresh water tank and flushed antifreeze from water lines and faucets. Checked all water lines and faucets for leaks. Opened by-pass on water heater and filled. Purged all air from system. Performed LP drop test and set LP pressure at 10 in.wc. Filled all holding tanks and checked monitor panel. Applied all company decals. Checked all appliances. Checked water heater on LP and Electric. Replaced missing LP hose for outside grille. Moved unit back to sales lot.

Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C
Z991	MISC LABOUR CODE (INTERNAL)	DKM	N/C

Parts

Part #	Description	Qty	Price	Total
13034	55362 STD BATTERY BOX	1.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
LPGI	LP - UNIT SALES	8.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #WINTER - Internal

COMPLAINT: WINTERIZE UNIT AND DRAIN HOLDING TANKS.

INCLUDES 2 GALLONS OF ANTI-FREEZE

UNITS WITH WASHING MACHINE OR ICEMAKER
WILL BE EXTRA

DE-WINTERIZATION IS NOT INCLUDED

NUMBER OF GALLONS USED _____

Customer #: 1000
BASDEN'S AMERICAN RV,



CAUSE: WINTER WINTERIZE UNIT AND DRAIN HOLDING TANKS. ***INCLUDES. 2 GALLONS OF ANTIFREEZE ***

CORRECTION: By-passed water heater and blew out water lines and faucets. Added antifreeze to all water lines and faucets including outside shower. Poured antifreeze in all drain traps. Drained all holding tanks including water heater.

Labor			
Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	DKM	N/C

Parts			
Part #	Description	Qty	Price
24181	-50 RV ANTI-FREEZE GALLON	2.00	N/C
			Total N/C

Other Services			
Code	Description	Qty	Price
SS	SHOP SUPPLIES	1.00	N/C
			Total N/C

Subtotal for Job #WINTER: 0.00

Job #1 - Warranty

COMPLAINT: LEFT OF STOVE WOOD DAMAGED

CAUSE: LEFT OF STOVE WOOD DAMAGED

CORRECTION: Filled holes with wood putty and used colored marker to match color.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	16.00

Subtotal for Job #1: 16.00

Job #2 - Warranty

COMPLAINT: STAIN ON COUCH

CAUSE: STAIN ON COUCH

CORRECTION: Checked stain. Looks like thread sealer compound. Used mineral spirits to remove stain.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	16.00

Subtotal for Job #2: 16.00

Job #3 - Warranty

COMPLAINT: LIVING TO BATHDOOR RIGHT SIDE NOT STRAIGHT WITH DOOR FRAME

CAUSE: LIVING. TO BATH DOOR RIGHT SIDE NOT STRAIGHT WITH DOOR FRAME.

CORRECTION: Bottom hinge is not mounted in correct position. Removed screws from door frame mounting. Repositioned bottom hinge on door frame and remounted in correct position.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	32.00

Subtotal for Job #3: 32.00

Job #4 - Warranty

COMPLAINT: CABINET DOOR NEXT TO ENTRY DOOR DAMAGED

CAUSE: CABINET NEXT TO ENTRY DOOR IS DAMAGED

CORRECTION: Covered damaged area with matching putty.

W/O: 72427

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	32.00
Subtotal for Job #4:			32.00

Job #5 - Warranty

LP HOSE MISSING FOR OUTSIDE GRILL

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	8.00

Parts				
Part #	Description	Qty	Price	Total
06-4731	MER14TCQDMP-72P 72" HP HOSE 1/4" ID, QD X 1/4" QD MALE	1.00	56.63	56.63
Subtotal for Job #5:				64.63

Parts Total: 56.63
Labour Total: 104.00
Sublet Total: 0.00
Extras Total: 0.00
WORK ORDER TOTAL: 160.63

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 28 Dec 2023

Customer #: 1000
BASDEN'S AMERICAN RV,

