

# FOREST RIVER WARRANTY CLAIM FORM

<b>DEALER ACCOUNT #</b>	0005106	<b>CLAIM STATUS</b>	Authorized
<b>BASDEN RV CENTER INC</b>		<b>CLAIM</b>	1784123
<b>DBA AMERICAN RV CENTER</b>		<b>CLAIM ORIGIN</b>	WEB
<b>600 E BASELINE ROAD</b>		<b>ORIGINAL CLAIM ID</b>	
<b>EVANSVILLE, IN 47725</b>		<b>VIN</b>	5ZT2CARBXR030510
<b>USA</b>		<b>CHASSIS VIN</b>	
		<b>MILEAGE</b>	0
<b>Labor rate:</b>	\$160.00	<b>SITE/WAREHOUSE</b>	205 / 205
<b>OWNER INFORMATION</b>		<b>ITEM #</b>	ACAT263BHSCCKLE
		<b>DEALER RO #</b>	72638
		<b>CLAIM START DATE</b>	01/09/2024
		<b>CLAIM END DATE</b>	01/01/1900

Retail Date of Purchase \_\_\_\_\_ WARRANTY EXPIRATION DATE \_\_\_\_\_

## Claim Line Details

### Labor

<b>Line# 1</b>	<b>Operation Code</b>	<b>Operational Description</b>		
	30-101-02-00-001076	Hinged Passage Door - Interior/Interior Doors/Adjust/No Tread Code		
	<b>Complaint, Cause, Correction</b>			
	Original Note : bhoffman@americanrvcenter.com, 2024-01-09 08:13:38 :: THE BEDROOM DOOR WILL NOT LATCH CLOSED BEDROOM DOOR WILL NOT LATCH CLOSED Factory mounting of latch plate is too low. Removed latch plate from door frame. Cleared out material behind latch plate. Remounted latch plate higher on door frame. Door now latches closed.			
<b>Model#</b>	<b>Dlr Sub Hrs</b>	0.20	<b>Sub Labor Amt</b>	\$32.00
<b>Serial#</b>	<b>Appr Hrs</b>	0.20	<b>Appr Labor Amt</b>	\$32.00
	<b>Notes</b>			

### Labor

<b>Line# 2</b>	<b>Operation Code</b>	<b>Operational Description</b>		
	70-147-24-00-001769	TV Coax Cable - Appliances/Television/Repair/No Tread Code		
	<b>Complaint, Cause, Correction</b>			
	Original Note : bhoffman@americanrvcenter.com, 2024-01-09 08:14:54 :: THE ARE NO TV CHANNELS AT ANY LOCATION There are no TV channels at any location Ran antenna scan. No channels found at any location. Removed TV booster from wall checked all cable locations. Bedroom TV coax was in correct location on booster. Antenna and outside TV were switched. Put cables on correct locations on booster. Ran antenna scan again. Removed TV Antenna from it's base on roof. Removed coax cable from antenna. Found that center coax had insulation covering it. Cut off cable connector and installed new coax connector. Ran channel scan again. This time channels were found. Remounted antenna to base mount. Remounted booster to wall.			
<b>Model#</b>	<b>Dlr Sub Hrs</b>	0.20	<b>Sub Labor Amt</b>	\$32.00
<b>Serial#</b>	<b>Appr Hrs</b>	0.20	<b>Appr Labor Amt</b>	\$32.00
	<b>Notes</b>			

<b>Submitted</b>	<b>Labor Amt</b>	\$64.00	<b>Approved</b>	<b>Labor Amt</b>	\$64.00
	<b>Parts &amp; Freight</b>	\$0.00		<b>Parts &amp; Freight</b>	\$0.00
	<b>Total</b>	\$64.00		<b>Total</b>	\$64.00

DEALER \_\_\_\_\_ DATE \_\_\_\_\_  
SIGNATURE \_\_\_\_\_

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER \_\_\_\_\_ DATE \_\_\_\_\_  
SIGNATURE \_\_\_\_\_

All repairs described have been inspected and are satisfactory.