

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	1823139
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CAUB4RX030834
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$170.00	SITE/WAREHOUSE	205 / 205
OWNER INFORMATION		ITEM #	ACAT293QBCKLE
		DEALER RO #	72799
		CLAIM START DATE	02/19/2024
		CLAIM END DATE	01/01/1900
Retail Date of Purchase		WARRANTY EXPIRATION DATE	

Claim Line Details

Labor				
Line# 1	Operation Code	Operational Description		
	60-136-01-00-001500	Fitting - Plumbing/Fresh Water Supply/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2024-02-19 12:36:34 :: WATER HEATER LEAKS AT TOP FITTING WATER HEATER LEAKS AT TOP FITTING Drained water heater down so that top fitting could be removed. Removed top water line and fitting from water heater. Cleaned all Factory sealer from threads on fitting and pipe nipple to water heater. Applied Teflon trape t both threaded fittings. Remounted on back of water heater. Filled water heater again and pressured. Checked for leaks at both threaded fittings. No leaks at this time.			
	Model#	Dlr Sub Hrs	0.60	Sub Labor Amt \$102.00
	Serial#	Appr Hrs	0.40	Appr Labor Amt \$68.00
	Notes			
	EXCESSIVE AMOUNT REQUETSED. CHANGED TO 2X FLAT RATE.			
Labor				
Line# 2	Operation Code	Operational Description		
	60-143-01-00-001627	Spray Port with Quick Connect - Plumbing/Exterior Shower/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2024-02-19 12:37:10 :: OUTSIDE SPRAY PORT LEAKS REAR OUTSIDE SPRAY PORT LEAKS Water dripping from bottom of unit below water connections on curbside rear of trailer. Removed rear inside lower bunk mattress and board for access to back of water fittings. Found spray port leaking where fitting is attached to fitting. This is a cemented fitting. Removed outside spray port and found water dripping from it where housing and fitting are cemented together. Cleaned old putty tape from mounting area and applied new putty taps around opening. Connected spray port to water line and leak checked. Not leaking. Remounted new spray port and trimmed off putty tape around port housing.			
	Model#	Dlr Sub Hrs	0.35	Sub Labor Amt \$59.50
	Serial#	Appr Hrs	0.35	Appr Labor Amt \$59.50
	Notes			
	AUTHORIZED AS REQUESTED			
Labor				
Line# 3	Operation Code	Operational Description		
	30-101-02-00-001076	Hinged Passage Door - Interior/Interior Doors/Adjust/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2024-02-19 12:37:59 :: THE BEDROOM DOOR WILL NOT LATCH CLOSED. THIS WAS NOTED ON DELIVERY BEDROOM DOOR WILL NOT LATCH CLOSED. NOTED AT DELIVERY Cleared out material behind latch plate. Remounted latch plate to allow door to latch closed.			
	Model#	Dlr Sub Hrs	0.30	Sub Labor Amt \$51.00
	Serial#	Appr Hrs	0.20	Appr Labor Amt \$34.00
	Notes			
	EXCESSIVE AMOUNT REQUETSED. CHANGED TO FLAT RATE.			

Submitted	Labor Amt	\$212.50
	Parts & Freight	\$0.00
	Total	\$212.50

Approved	Labor Amt	\$161.50
	Parts & Freight	\$0.00
	Total	\$161.50

DEALER	DATE
---------------	-------------

SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER	DATE
-----------------	-------------

SIGNATURE

All repairs described have been inspected and are satisfactory.