

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 72924
MANUFACTURER'S CLAIM #:

Manufacturer: 1013 - KEYSTONE RV CO
Customer: 54431 - JAMES COOK
Address: 202 PLUM ST
CARMi, IL
62821

Phone:

Stock Number: 2023 BULLET BL287QBS23

VIN:

HIN:

SER#: 4YDTBLN29PT431168

Mileage:

Work Order Comp: 29 FEB 24

Auth. No:

Dealer #: 1194

Warr. Date:

Work Order Date: 23 FEB 24

Inv #: 401275

WO # Job # Description JOB INFORMATION

72924 3 the lock for the right side passenger cargo area needs replaced
THE LOCK FOR THE RIGHT SIDE PASSENGER CARGO AREA NEEDS REPLACED
Checked lock on front passenger side compartment door. Lubed
lock and tried to work lock. Could not get key into lock. Tab
that covers key slot is bent keeping key from going into lock.
Lock needs replaced. Removed damaged lock. Install a new lock
with the same Key number. Checked operation with new lock. Now
locking and unlocking ok.

72924 1 The deadbolt on the door will not work. GET KEYS
THE DEADBOLT ON RTHE DOOR WILL NOT WORK GET KEYS.
Moved unit into shop from service lot. Checked operation of
deadbolt. Deadbolt plunger is below latch plate and hitting door
frame. Marked deadbolt plunger and removed latch plate. Cut out
door frame to match plunger. Cleared out material behind door
frame so that deadbolt will lock all the way. Remounted latch
plate on door frame. Checked operation of deadbolt. Also
adjusted steps so that entrance door will close without hitting
steps.

72924 2 the black tank flush leaks inside where the slide out is
THE BLACK TANK FLUSH LEAKS INSIDE WHERE THE SLIDE OUT IS
Connected hose to black tank flusher in front water compartment.
Water is leaking at connection. Removed water hose. Found that
rubber seal at flusher is missing. Installed new hose washer.
Reconnected flusher hose and turned on water. Checked for leaks

Claim : 72924

 WO # Job # Description JOB INFORMATION

under bathroom sink where flusher back flow preventer is located.
 No leaks at this point or outside where hose connects to
 flusher. The problem was the missing flat rubber washer at the
 hose connection.

 Part No Job# Description PARTS Qty Price Total

 G391CAMLOCK 3 GLOBAL CAM LOCKS 1.00 4.01 4.01

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 3 MISC LABOUR CODE (EXTERNAL) 0.20 160.00 32.00
 Z990 1 MISC LABOUR CODE (EXTERNAL) 0.30 160.00 48.00
 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.20 160.00 32.00

 Excode Job# Description EXTRAS Qty Price Total

 SS 1 SHOP SUPPLIES 1.00 0.00 0.00

Parts Total: 4.01
 Labour Total: 112.00
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 116.01

Customer Signature: _____

Date: _____