



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 72924
Promised Date:
20 FEB 24

CUSTOMER WORK ORDER

WO #: 72924 (Appointment Date: 23 FEB 2024 - Time: 08:30am)

Customer: 54431 - COOK, JAMES -

Tag:

Author: PH

Location: 0228 BH TO CLOSE

Stock #:

Stock Desc: 2023 TT KEYSTONE

BULLET BL287QBS23

Chassis #:

Serial #: 4YDTBLN29PT431168

Mileage:

Licence:

Invoice #:

Date In: 23 FEB 24

Promised: 29 FEB 24

Date Sched:

Completed: 29 FEB 24

Warr. Date:

Job #1 - Warranty

COMPLAINT: The deadbolt on the door will not work. GET KEYS

CAUSE: THE DEADBOLT ON RTHE DOOR WILL NOT WORK GET KEYS.

CORRECTION: Moved unit into shop from service lot. Checked operation of deadbolt. Deadbolt plunger is below latch plate and hitting door frame. Marked deadbolt plunger and removed latch plate. Cut out door frame to match plunger. Cleared out material behind door frame so that deadbolt will lock all the way. Remounted latch plate on door frame. Checked operation of deadbolt. Also adjusted steps so that entrance door will close without hitting steps.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	48.00

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	0.00	0.00

Subtotal for Job #1: 48.00

Job #2 - Warranty

COMPLAINT: the black tank flush leaks inside where the slide out is

CAUSE: THE BLACK TANK FLUSH LEAKS INSIDE WHERE THE SLIDE OUT IS

CORRECTION: Connected hose to black tank flusher in front water compartment. Water is leaking at connection. Removed water hose. Found that rubber seal at flusher is missing. Installed new hose washer. Reconnected flusher hose and turned on water. Checked for leaks under bathroom sink where flusher back flow preventer is located. No leaks at this point or outside where hose connects to flusher. The problem was the missing flat rubber washer at the hose connection.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	32.00

Subtotal for Job #2: 32.00

Job #3 - Warranty

COMPLAINT: the lock for the right side passenger cargo area needs replaced

CAUSE: THE LOCK FOR THE RIGHT SIDE PASSENGER CARGO AREA NEEDS REPLACED

CORRECTION: Checked losk on front passenger side compartment door. Lubed lock and tried to work lock. Could not get key into lock. Tab that coverskey slot is bent keeping key from going into lock. Lock



Customer #: 54431
COOK, JAMES

needs replaced. Removed damaged lock. Install a new lock with the same Key number. Checked operation with new lock. Now locking and unlocking ok.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	DKM	32.00

Parts

Part #	Description	Qty	Price	Total
4422	GLOBAL CAM LOCKS	1.00	4.01	4.01

Subtotal for Job #3: 36.01

Parts Total: 4.01
Labour Total: 112.00
Sublet Total: 0.00
Extras Total: 0.00

WORK ORDER TOTAL: 116.01

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 29 Feb 2024

W/O: 72924
Promised Date: 29 FEB 24



Customer #: 54431
COOK, JAMES

