

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	1843852
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CARB8RX030716
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$170.00	SITE/WAREHOUSE	205 / 205
OWNER INFORMATION		ITEM #	ACAT263BHSCCKLE
MICHAEL ELLISON		DEALER RO #	73001
8200 OAK GROVE RD		CLAIM START DATE	03/09/2024
Newburgh, IN 47630		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	03/08/2024	WARRANTY EXPIRATION DATE	03/08/2025

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description
	40-108-24-11-001334	110 Volt Interior Wiring - Electrical/110 Volt Interior/Repair/Electrical
	Complaint, Cause, Correction	
	Original Note : bhoffman@americanrvcenter.com, 2024-03-09 13:53:58 :: UNIT HAS HOT SKIN AND GFI WILL NOT TRIP TESTED AND UNIT HAD 28 VOLTS ON FRAME TO BUILDING WE TOOK APART THE GFI AND TESTED AND TESTED THE NUETRALS IN THE BREAKER BOX AND FOUND THERE WAS VOLTAGE FROM THE NUETRAL TO THE GROUNDS BUT WOULD NOT LIGHT A TEST LIGHT FROM GROUND TO HOT SO WE CHECKED THE PLUG COMING INTO THE TRAILER AND FOUND THE GROUND WAS NOT CONNECTED.	
Model#	Dlr Sub Hrs	Sub Labor Amt
	2.50	\$425.00
Serial#	Appr Hrs	Appr Labor Amt
	2.50	\$425.00
	Notes	
	AUTHORIZED AS REQUESTED.	

Labor

Line# 2	Operation Code	Operational Description
	50-134-01-00-003673	Rubber LP Supply Line - LP Gas/LP Gas System/Replace/No Tread Code
	Complaint, Cause, Correction	
	Original Note : bhoffman@americanrvcenter.com, 2024-03-09 13:55:11 :: THE WATER HEATER WILL NOT LIGHT WATER HEATER WILL NOT LIGHT Water heater is trying to ignite, but will not light after a doz. trys. Checked for gas flow at water heater. No gas at water heater. Checked LP hose at all visible spots. Line is not pinched. Cut access hole in underbelly below water heater where LP hose attaches to LP block. Lp hose is pinched between frame and floor. Cut off LP hose on both sides of pinched area. 3-6-2024: Turned in parts request for a new LP hose, 6 ft .long. Received new LP hose. Installed new hose and checked for leaks. No leaks. Resealed underbelly access hole.	
Model#	Dlr Sub Hrs	Sub Labor Amt
	1.30	\$221.00
Serial#	Appr Hrs	Appr Labor Amt
	1.30	\$221.00
	Notes	
	AUTHORIZED AS REQUESTED.	

Labor

Line# 3	Operation Code	Operational Description
	30-102-12-00-001096	Interior Trim or Moldings, each - Interior/Panels, Ceilings, & Interior Moldings/ Resecure or Tighten/No Tread Code
	Complaint, Cause, Correction	
	Original Note : bhoffman@americanrvcenter.com, 2024-03-09 13:56:50 :: BEDROOM CLOSET TRIM HAS STAPLE HOLES BEDROOM CLOSET HAS HOLES IN TRIM (NOTED ON DELIVERY) All trim around closet shelves have holes that need to be filled. Filled all staple holes on corner trim and wall panels with matching putty. (5 shelves).	
Model#	Dlr Sub Hrs	Sub Labor Amt
	0.10	\$17.00

Serial#

Appr Hrs

0.10

Appr Labor Amt \$17.00

Notes

Submitted

Labor Amt	\$663.00
Parts & Freight	\$0.00
Total	\$663.00

Approved

Labor Amt	\$663.00
Parts & Freight	\$0.00
Total	\$663.00

DEALER _____ DATE _____
SIGNATURE _____
I certify that I have performed these repairs consistent with Forest
River Policies.

CUSTOMER _____ DATE _____
SIGNATURE _____
All repairs described have been inspected and are satisfactory.