

Pre-Authorization

Pre-Authorization number PA03654725 Reference no: 73290 Status: Approved Approved by bessm Approved date 4/25/2024
Servicing Name Address VIN Retail sold on
Dealer

1194 Basden's American RV Basden's American RV 4YDFM0U26R4701090 4/19/2024
600 E Baseline Rd
Evansville, IN 47725

Nu mbe r of	Root operation	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty	Base hours	Complaint / Cause / Correction
1	6101308B	Fresh Water Pres	0.00	2.50	1.50		1	0.30	Complaint:THE WATER LINE FOR THE ICE MAKER IS PINCHED FLAT UNDER THE SLIDE OUT Cause:ICE MAKER WATER LINE UNDER SLIDEOUT IS PINCHED FLAT Correction:When refrigerator slideout is closed, the ice maker water line is pinched flat. Cut all wire ties holding hose to spring. Moved hose around several times and replaced wire ties to support hose. Closed slideout and checked hose again. Still pinching hose flat. Cut wire ties and reposition hose again. Closed slideout to check hose. Hose OK now. KRV – Labor time adjusted allowing for proper repair procedure to be performed.
2	3201816A	Decorative Wood	0.00	0.20	0.20		1	0.10	Complaint:THE WALL PANEL IS LOOSE IN THE REAR BEDROOM. Cause:WALL PANEL LOOSE IN REAR BEDROOM. Correction:Panel is not attached on bottom half next to seam. Pulled off seam tape and restaped panel to wall studs. Reattached seam tape. Filled all staple holes with matching putty.
3	3200414F	Door - Interior Fol	0.00	0.20	0.20		1	0.10	Complaint:THE DOOR TO THE REAR BATHROOM WILL NOT SLIDE. Cause:DOOR TO REAR BATHROOM WILL NOT SLIDE Correction:Replaced roller onto door track.
4	6101414A	Fresh Water Pres	0.00	1.50			1	0.10	Complaint:THE WASHER IS NOT CONNECTED TO WATER Cause:washer hookups Correction:had to take off door ,took off side panel in closet to get to plug and undo vent, pulled bottom cover off of dryer and take out 3 screws, lifted dryer off of washer and set on bed, installed cold and hot hoses and tightened, ran water through washer and checked for leaks, no leaks, installed 4 covers in back of washer to cover holes and also installed washer parts in tray for

For paper claims only use one pre-authorization number per warranty claim for

Staple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the amount authorized on the pre-authorization form and return to Keystone RV Company

Pre-Authorization

Nu mbe r of	Root operation	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty	Base hours	Complaint / Cause / Correction
									detergent, next put dryer back in place and plugged in and installed dryer vent, secured dryer to washer and put on bottom cover, ran dryer to make sure no leaks on exhaust tube, next installed cover in closet and installed door,all good.
									KRV – Unit built in accordance with current manufacturing specifications.
5	5100214B	Battery Cable Enc	0.00	0.30	0.30		1	0.20	Complaint:WIRING BESIDE BATTERY DISCONNECT PULLED OUT OF TERMINAL Cause:WIRING BESIDE BATTERY DISCONNECT PULLED OUT OF TERMINAL Correction:Removed terminal box cover. Removed broken ring terminal from stud connector. Installed new ring terminal on loose wire. Reinstalled wire terminal on stud connector. Replaced terminal box cover.
Pre-Authorization number PA03654725					2.20				

For paper claims only use one pre-authorization number per warranty claim for

Staple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the amount authorized on the pre-authorization form and return to Keystone RV Company