

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 73816
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 37053 - JEFFERY VIRGIN
Address: 2120 WAGGONER AVE EVANSVILLE, IN

47714

Phone: 812-598-5083

Stock Number: 10630 - 2023 CATALINA 343BHTSLE 5ZT2CAZB4PX028622

VIN: 5ZT2CAZB4PX028622 HIN: SER#: 5ZT2CAZB4PX028622

Mileage: 0

Work Order Comp: 14 JUN 24

Auth. No:

Dealer #:

Warr. Date: 11 MAY 24

Work Order Date: 31 MAY 24

Inv #: 405759

WO # Job # Description JOB INFORMATION

73816 5 EXHAUST FAN COVER BLEW OFF IN TRAVEL.
Hood range vent cover missing
Took pictures. Put in po for a new camco range vent. Removed the
old vent to match up.

73816 8 FIND OUT WHAT IS STICKING OUT FROM UNDER THE BACK CORNER OF #2
SLIDE LARGE SLIDE
Slideroom ski vs screw
Jacked up the slideroom and inspected for what was causing damage
to the slideroom ski. Found a screw that had chewed on the ski.
Unscrewed all the screws holding on the ski. Drilled the the
slideroom floor then extracted the screw. Put the new ski on the
slideroom corner with screws. Filled the hole with wood putty.
Trimmed the ski with silicone.

73816 3 STRAIGHT OUT FROM THE FRIDGE THERE ARE STAPLES COMING OUT FROM
UNDER THE LINO
Loose staples
Removed a floor vent the slid a straight edge under the hit it
with a hammer. Found a total of 7 staples.

73816 6 CUSTOMER ADVISES THAT THE STEPS PUT THE DOOR IN BIND ON THE HINGE
SIDE.
Moved the stairs in towards the entry door
Set the camper level then opened the entry door and folded the
steps down. Closed and opened the entry door . Put the steps back

Claim : 73816

 WO # Job # Description JOB INFORMATION

 up and checked again. Removed all the screws holding in the steps
 then moved the steps against the door frame then put the screws
 back in.

73816 7 EXTERIOR ENTRY HANDLE WASNT TIGHTENED UP
 Loose screws
 Inspected the grab handle, noticed the its wasn't tightened to
 the exterior wall. Removed the screw covers then tightened the
 screws. Now grab handle feels firmly mounted to the exterior
 wall.

73816 9 SEAL ON (INSIDE) OF SLIDE #2 SLIDE IS COMING OFF BACK TOP CORNER
 Bulb seal wasn't in place
 Inspected the bulb seal and found that the bulb seal came off the
 flap seal. Put the bulb seal back on the flap seal and drove a
 screw at the top of the bulb seal to hold it in place.

 Part No Job# Description PARTS Qty Price Total

 130123 5 V211-55 BLK VENTLINE RANGE VENT 0.00 6.85 0.00
 506342 5 Range - Hood - Vent - 1 5/8" Deep 1.00 6.27 6.27
 F100380780 8 J&B SLIDE SKI, 53", CURRENT 2022, 1.00 9.98 9.98

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 5 MISC LABOUR CODE (EXTERNAL) 0.00 170.00 0.00
 Z990 5 MISC LABOUR CODE (EXTERNAL) 0.00 170.00 0.00
 Z990 5 MISC LABOUR CODE (EXTERNAL) 0.30 170.00 51.00
 Z990 8 MISC LABOUR CODE (EXTERNAL) 0.00 170.00 0.00
 Z990 8 MISC LABOUR CODE (EXTERNAL) 1.25 170.00 212.50
 Z990 8 MISC LABOUR CODE (EXTERNAL) 0.25 170.00 42.50
 Z990 8 MISC LABOUR CODE (EXTERNAL) 0.00 170.00 0.00
 Z990 3 MISC LABOUR CODE (EXTERNAL) 0.24 170.00 40.80
 Z990 6 MISC LABOUR CODE (EXTERNAL) 0.16 170.00 27.20
 Z990 6 MISC LABOUR CODE (EXTERNAL) 0.04 170.00 6.80
 Z990 7 MISC LABOUR CODE (EXTERNAL) 0.26 170.00 44.20
 Z990 7 MISC LABOUR CODE (EXTERNAL) 0.20 170.00 34.00
 Z990 9 MISC LABOUR CODE (EXTERNAL) 0.20 170.00 34.00

Parts Total: 16.25
 Labour Total: 493.00
 Sublet Total: 0.00
 Extras Total: 0.00

>>>>> Claim Total: 509.25

Customer Signature: _____

Date: _____