

Pre-Authorization

Pre-Authorization number PA03710422		Reference no: 74324	Status: Approved	Approved by blaci	Approved date 8/23/2024
Servicing Dealer	Name	Address	VIN	Retail sold on	

1194	Basden's American RV	Basden's American RV 600 E Baseline Rd Evansville, IN 47725	4YDFM0S22P4700146	3/26/2024
------	----------------------	---	-------------------	-----------

Nu mbe r of	Root operation	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty	Base hours	Complaint / Cause / Correction
1	4103106A	A/C - Coleman - F	0.00	1.50	1.00		1	0.50	Complaint:THE MAIN A/C IN THE REAR OF THE UNIT IS BLOWING HOT KRV - sent to RVP 8/22/24 RA Cause:test rear ac unit Correction:amp draw as low on compressor and is not cooling replace ac unit KRV-Approved to replace thermostat VCB
2	4208706B	Awning - Electric I	0.00	1.00	0.70		1	0.70	Complaint:THE MAIN AWNING BLOWS THE FUSE WHEN GOING OUT Cause:AWNING BLOW FUSE Correction:removed motor and replaced with new and the fuse did not break anymore. KRV-Approved VCB
3	3200116F	Door - Interior Hin	0.00	0.10			1	0.10	Complaint:THE FRONT ENTRY DOOR YOU HAVE TO SLAM IT TO CLOSE TO GET IT TO LATCH Cause:entry door wont latch Correction:entry door will not latch needs adjustment KRV – Excluded from Limited Warranty: Adjustments to all doors, drawers, locks, latches, awnings, and window treatments beyond 90 days after retail sale
4	2302314B	Compartment Doc	0.00	0.10	0.10		1	0.20	Complaint:THE STORAGE DOOR ON THE FRONT DOOR SIDE THE CUSTOMER LETS THE DOOR SLAM SHUT AND NOW IT DOES NOT LOCK HE HAS TO PUSH THE DOOR CLOSED REAR LATCH Cause:front compartment door not latching in rear Correction:door is in need of adjustment rear slam latch wont latch

For paper claims only use one pre-authorization number per warranty claim for

Staple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the amount authorized on the pre-authorization form and return to Keystone RV Company

Pre-Authorization

Nu mbe r of	Root operation	Description	Sublet	Sub hours	Approved hours	Actual hours	Qty	Base hours	Complaint / Cause / Correction
5	3202806A	Step - Interior Sta	0.00	0.20	0.20		1	0.30	KRV-Approved to repair latch Complaint:THE TOP OF THE STEP SQUEEK Cause:top step squeeks and is not tight Correction:step needs shims and screws to tighten step
6	2400714B	Information Label	0.00	0.75	0.40		2	0.20	Complaint:THE PULL HANDLES FOR THE BLACK AND GREY ARE BACKWARDS Cause:black ad grey tank pull valve labels are backwards Correction:removed handles and switch lines and put handles back in proper place
7	2202114A	Grab Handle - Re	0.00	0.10	0.10		1	0.20	Complaint:SCREWS ARE MISSING ON THE STEP HANDLE FOR THE ENTRY DOOR Cause:entry door steps handle is missing screw on right side of handle Correction:needs to have screw mounted in place
8	7145242A	24-452 Suburban	0.00	0.50			1	0.50	Complaint:24-452 STOVE LIGHT RECALL Cause:remove light button and replace with hole plug Correction:removed wires and capped off then removed button and replaced with hole plug then capped off wires going to lights
Pre-Authorization number PA03710422					2.50				KRV-Recall needs to go on a PA by itself.

For paper claims only use one pre-authorization number per warranty claim for

Staple a copy of this pre-authorization to a warranty claim form. Fill out the header information and the parts section on the claim form. The labor section does not need to be filled out on the claim form. Fill in the amount of hours used for the repair - up to the amount authorized on the pre-authorization form and return to Keystone RV Company