



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 74551



Customer #: 53781
STOVER, JIMMY



CUSTOMER WORK ORDER

WO #: 74551 (Appointment Date: 16 AUG 2024 - Time: 04:30pm)

Customer: 53781 - STOVER, JIMMY -
(419) 551-6646

Tag:

Author: PH

Location: 0823 CHECK WORK

Stock #:

Stock Desc: 2019 TT KEYSTONE
SPRINTER 26RB

Chassis #:

Serial #: 4YDT26R23K1531072

Mileage:

Licence:

Invoice #: 408445

Date In: 16 AUG 24

Promised:

Date Sched:

Completed: 22 AUG 24

Warr. Date:

Job #1 - External

COMPLAINT: SEVERAL OUTLETS THAT ARE NOT WORKING

CAUSE: ALL OF THE OUTLETS ARE WORKING AND HAVE 120 VOLTS GOING THROUGH THEM.

CORRECTION: NO CORRECTIONS.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C

Subtotal for Job #1: 0.00

Job #2 - External

COMPLAINT: REPLACE ANODE ROD

CAUSE: DRAINED WATER HEATER. FLUSHED OUT TANK WITH HOSE. INSTALLED NEW ANODE ROD

CORRECTION: .

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Parts

Part #	Description	Qty	Price	Total
09-0205	MAGNESIUM ANODE ROD - SUBURBAN	1.00	N/C	N/C

Subtotal for Job #2: 0.00

Job #3 - External

COMPLAINT: FURNANCE WAS NOT KEEPING UP LAST WINTER. TRAILER WOULD GET DOWN INTO THE 50'S. CHECK ALL VENTS FOR LEAKS AND AIR FLOW

CAUSE: TURNED ON FURNACE AND IT STARTED TO SMOKE REALLY BAD. TURNED OFF FURNACE. BURNER CHAMBER IS CLOGGED. NEED TO PULL FURNACE AND TAKE APART BURNER CHAMBER TO INSPECT. REMOVED FURNACE. REMOVED BOARD, FAN ASSEMBLY, GAS VALVE AND BURNER. MUD DAUBER NEST AND LADY BUGS WERE INSIDE BURNER TUBE AND BURNER CHAMBER. MUD WAS ALSO ALL INSIDE FAN SHROUD AND ON SMALL FAN BLADE. THERE IS ALSO



A FLUID THAT IS ALL OVER MOST OF THE FAN HOUSING AND INSIDE THE EXHAUST TUBE. CLEANED ALL AREAS WITH SOAPY WATER. CLEANED FAN BLADE. TOOK AIR COMPRESSOR AND BLEW OUT BURNER CHAMBER. CYCLED FURNACE SEVERAL TIMES TO BURN OFF FLUID. WAITING ON GASKET TO ARRIVE AND FINISH INSTALL. RECEIVED GASKET. REMOVED BURNER FROM GAS VALVE AND BURNER CHAMBER. REMOVED OLD GASKET. CLEANED AREA. INSTALLED NEW GASKET. INSTALLED BURNER TO BURNER CHAMBER AND SECURED TO GAS VALVE. ZIP TIED WIRES AS NEEDED. INSTALLED SHEET METAL HOUSING. INSTALLED FURNACE TO FLOOR. SECURED GAS LINE AND WIRES. INSTALLED EXHAUST PORT. SECURED PORT WITH NEW HARDWARE. TAPED OFF AND SEALED WITH SILICONE. REMOVED TAPE. INSTALLED REAR PANEL ON FURNACE AND TAPED OFF WITH ALUMINUM TAPE. TESTED FURNACE INSIDE THE UNIT. ALL DUCTS HAVE PROPER FLOW. CLEANED UP MESS. SECURED ACCESS PANEL.

CORRECTION: .

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Parts

Part #	Description	Qty	Price	Total
05-3923	525031 SUBURBAN GASKET	1.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
FRT	SHIPPING-FURNACE GASKET	1.00	N/C	N/C

Subtotal for Job #3: 0.00

Job #5 - External

COMPLAINT: HAS SEVERAL INTERIOR LIGHTS NOT WORKING

CAUSE: ALL OF THE INTERIOR LIGHTS ARE WORKING

CORRECTION: NO CORRECTION.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Subtotal for Job #5: 0.00

Job #6 - External

COMPLAINT: INSPECT CONDITION OF TIRES

CAUSE: TIRES ARE 6 YEARS OLD. TIRES ARE IN GOOD SHAPE AND HAVE PLENTY OF TREAD. WOULD RECOMMEND REPLACING SOON THOUGH.

CORRECTION: .

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Subtotal for Job #6: 0.00

Job #7 - External

COMPLAINT: CUSTOMER IS NOT ABLE TO GET CAMERA TO CONNECT.

CAUSE: CAMERA PAIRS UP BUT THE PICTURE IS VERY BLURRY AND DARK. MORE THAN LIKELY NEEDS A NEW CAMERA.



Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Subtotal for Job #7:			0.00

Job #8 - External

COMPLAINT: CUSTOMER ADVISES THAT ON A RECENT TRIP, THE AIR CONDITIONER DID NOT COOL VERY WELL. CUSTOMER DID SAY THAT IT WAS VERY HOT OUTSIDE DURING THEIR TRIP. HOWEVER, HE WOULD LIKE FOR US TO CLEAN THE A/C UNIT AND CHECK IT FOR PROPER OPERATION.

CAUSE: WENT ON THE ROOF AND REMOVED OUTSIDE COVER. SPRAYED DOWN COILS. REMOVED SCREWS AND PULLED BACK THE SHEET METAL TO ACCESS FRONT COILS. SPRAYED FRONT COILS. LET SIT AND RAN FAN. INSTALLED SHEET METAL AND COVER. RAN A/C. A/C IS COOLING WITHIN SPEC.

CORRECTION: .

Labor				
Code	Description		Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		ZMS	N/C
Parts				
Part #	Description	Qty	Price	Total
13-3013	3X CHEMISTRY A/C COIL CLEANER	1.00	N/C	N/C
Subtotal for Job #8:				0.00

Job #REGULATOR - Warranty

COMPLAINT: KEYSTONE SAFETY ADVISORY LP REGULATOR RECALL #21-414
SECTION:71 COMPONENT:414 OPERATION:7141442B

CAUSE: lp regulator recall

CORRECTION: removed lp cover and found that the regulator was one of the ones that are approved and do not need replacement

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JG	51.00
Subtotal for Job #REGULATOR:			51.00

Parts Total:	0.00
Labour Total:	51.00
Sublet Total:	0.00
Extras Total:	0.00
WORK ORDER TOTAL:	51.00

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 23 Aug 2024



Customer #: 53781
STOVER, JIMMY

