

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	2092288
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CAUB4RX030834
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$170.00	SITE/WAREHOUSE	205 / 205
OWNER INFORMATION		ITEM #	ACAT293QBCKLE
TAMIKA M LIEBHART		DEALER RO #	74969
5910 ASHBROOKE RD		CLAIM START DATE	10/15/2024
Evansville, IN 47710		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	03/01/2024	WARRANTY EXPIRATION DATE	03/01/2025

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	60-136-01-00-001480	City Water Connection - Plumbing/Fresh Water Supply/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2024-10-15 15:44:28 :: CITY WATER INLET NOT WORKING. NEEDS REPLACED UNDER WARRANTY. WE HAVE ALREADY FIXED THIS ONCE. Pulled unit into shop. Removed city water inlet. Went inside and removed bunk bed and wooden panel. These is a lot of hose that is pushing against itself. Need to install shorter hose. The original hose is 1/4 in i.d. removed that hose and made a new 1/2 inch hose with fittings. Installed new hose and tested . Water is flowing through system. Installed inlet and sealed with silicone. Installed bed panel and mattress.			
Model#	Dlr Sub Hrs	0.30	Sub Labor Amt	\$51.00
Serial#	Appr Hrs	0.30	Appr Labor Amt	\$51.00
	Notes			

Labor

Line# 2	Operation Code	Operational Description		
	30-95-24-00-000947	Dinette Cushions - Interior/Dinette/Repair/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2024-10-15 15:45:34 :: THE SCREWS HOLDING THE BACK CUSHION ON COUCH HAS A BROKEN SCREW. SEE IF WE CAN FIX The screw head has broken off. Secured another screw and washer next to where the original screw is located. Parked unit.			
	Model#	Dlr Sub Hrs	0.30	Sub Labor Amt \$51.00
	Serial#	Appr Hrs	0.30	Appr Labor Amt \$51.00
	Notes			
	AUTHORIZED AS REQUESTED			

Labor

Line# 3	Operation Code	Operational Description		
	SB-456-01-00-004506	51-1722 – ROOF MOUNT SOLAR INLET (AURORA & CATALINA) - INSPECTION AND PERFORM REMEDY - Technical Service Bulletin/Sealant/Replace/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2024-10-15 15:46:18 :: 51-1722 ROOF MOUNT SOLAR INLET Pulled unit into bay. Removed mounting screws. Removed solar inlet. No cracks anywhere on inlet. Installed putty tape. Removed excess dicor. Secured inlet and sealed with dicor. Parked unit.			
Model#	Dlr Sub Hrs	0.50	Sub Labor Amt	\$85.00
Serial#	Appr Hrs	0.50	Appr Labor Amt	\$85.00
	Notes			
	AUTHORIZED AS REQUESTED			

Submitted

Labor Amt
Parts & Freight
Total

\$187.00
\$0.00
\$187.00

Approved

Labor Amt
Parts & Freight
Total

\$187.00
\$0.00
\$187.00

DEALER

DATE

SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER

DATE

SIGNATURE

All repairs described have been inspected and are satisfactory.