



Warranty Authorization Form

Date: 12/16/2024

General Information

Basden RV Center, Inc. DBA/ American RV
600 E Baseline Rd
Evansville, IN 47725
Ph. (812) 867-5200
cbruce@americanrvcenter.com

Pre-Auth #: 81045 Unit: 7M5FP3624SB205842
Series: Paradigm Model: 2025PAR310RL
Notes:
Status: Approved with Modifications

Dealer Information

American RV
(812) 867-5200
cbruce@americanrvcenter.com

Basden RV Center, Inc. DBA/ American RV
600 E Baseline Rd
Evansville, IN 47725

Requestor: Ben Hoffman
Return Fax #:
Email: bhoffman@americanrvcenter.com

Operation Line 1

Flat Rate Code: 12028 ENTRANCE DOOR - ADJUST

Fault Code: MISALIGNED

Serial #:

Model #:

Notes:

Problem: THE ENTRY DOOR IS HARD TO OPEN AND CLOSE. THIS WAS NOTED ON DELIVERY

Time Requested: .3

Cause: ENTRY DOOR HARD TO OPEN AND CLOSE. (NOTED ON DELIVERY)

Time Allowed: .1

Remedy: Removed latch striker plate from door frame. Ground lip on door frame cutout down to allow more latch adjustment. Remounted latch plate and checked operation of door. Door closes ok with steps out, but harder to latch closed with steps folded in.

Sublet Repairs: 0.00

Part Return Req: No

Status: Approved with Modifications

Operation Line 2

Flat Rate Code: 10027 BRAKES HYDRAULIC - ELECTRIC-HYDRAULIC PUMP - REPLACE (Part return required in US)- DEXTER (Vendor auth required)

Fault Code: GOODWILL DEALER

Serial #: NA

Model #: NA

Notes:

Problem: CLEAN UP FLUID FROM SPILL

Time Requested: 2

Cause: CLEAN UP FLUID SPILL RFROM HYD. RESV.

Time Allowed: 1

Remedy: Hydraulic reservoir was fill too full at factory. With all jacks retracted hyd fluid comes out vvent hole on reservoir cap. Cleaned up all fluid that was visible. Will check in the morning to see if clean. Cleaned all hyd fluid from around pump and under on frame of unit. Moved unit back to sales lot. See pictures for amount of fluid removed from hyd. resev. to bring level down to full mark when all jacks are up.

Sublet Repairs: 0.00

Part Return Req: Per Auth

Status: Approved with Modifications