



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 75901
Promised Date:
28 FEB 25

CUSTOMER WORK ORDER

WO #: 75901

Customer: 1000 - BASDEN'S AMERICAN
RV -
Tag:
Author: PH
Location: 0214 CHECK STATUS WITH
JRK

Stock #: 11549
Stock Desc: 2025 TT COACHMEN
CATALINA 283RKSLE
Chassis #: 5ZT2CATB8SX034120
Serial #: 5ZT2CATB8SX034120
Mileage: 0
Licence:

Invoice #:
Date In: 04 FEB 25
Promised: 28 FEB 25
Date Sched:
Completed: 14 FEB 25
Warr. Date:

Job #PDINTT - Internal

PDI - NEW TRAVEL TRAILER

Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	JRK	N/C
Z991	MISC LABOUR CODE (INTERNAL)	JRK	N/C
Z991	MISC LABOUR CODE (INTERNAL)	JRK	N/C
Z991	MISC LABOUR CODE (INTERNAL)	JRK	N/C
Z991	MISC LABOUR CODE (INTERNAL)	JRK	N/C
Z991	MISC LABOUR CODE (INTERNAL)	JRK	N/C

Parts

Part #	Description	Qty	Price	Total
13034	55362 STD BATTERY BOX	1.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
LPGI	LP - UNIT SALES	8.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #1 - Warranty

COMPLAINT: MAGNET PULLED OFF OF WALL IN FOR FRONT COMPARTMENT

CAUSE: Magnetic catch pulled from mounted area...

CORRECTION: Filled in old mount holes and reinstalled, magnetic catch for compartment door.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	17.00

Subtotal for Job #1: 17.00

Job #2 - Warranty

COMPLAINT: CLOSET IN BEDROOM IS MISSING PANELS

CAUSE: Inside panel was missing from closet.

CORRECTION: Closet panel measures 42 in tall and 22 3/4 in wide. Measured and cut new panel. Removed clothing bar and mount from closet. Installed panel with staples. Installed trim with staples. And reinstalled clothing bar and mounts.

Labor



Customer #: 1000
BASDEN'S AMERICAN RV,

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	170.00

Subtotal for Job #2: 170.00

Job #3 - Warranty

COMPLAINT: JWRAP IS LOOSE

CAUSE: Loose JWrap where screw was pulled thru...

CORRECTION: Reinstalled screw and added another to keep the 2 pieces secured properly.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	34.00

Subtotal for Job #3: 34.00

Job #4 - Warranty

COMPLAINT: THE DICOR BEAD ACROSS THE BACK OF THE RUBBER MEMBRANE IS VERY THIN AND DOES NOT COVER EVERY THING THAT IT NEEDS TO.

CAUSE: Thin seal of dicor on back lip on roof...

CORRECTION: Used a full tube of white self leveling Dicor across the back lip area of roof.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	49.30
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	68.00

Subtotal for Job #4: 117.30

Job #WINTER - Internal

COMPLAINT: WINTERIZE UNIT AND DRAIN HOLDING TANKS.

INCLUDES 2 GALLONS OF ANTI-FREEZE

UNITS WITH WASHING MACHINE OR ICEMAKER
WILL BE EXTRA

DE-WINTERIZATION IS NOT INCLUDED

NUMBER OF GALLONS USED _____

CAUSE: Winterize unit...

CORRECTION: Winterized and filled out checksheet.

Labor			
Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	JRK	N/C

Parts				
Part #	Description	Qty	Price	Total
24181	-50 RV ANTI-FREEZE GALLON	2.00	N/C	N/C

Other Services				
Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C

Subtotal for Job #WINTER: 0.00

Job #5 - Warranty

COMPLAINT: THE TRIM AROUND THE BATHROOM DOOR IS OUT OF ALIGNMENT.

CAUSE: Bathroom plastic door frame up top has flaws...

CORRECTION: Removed piece of plastic door frame and found uneven silicone and pieces of trim pieces.



Measured and put part request in for new piece of frame. (NOTED to put white screw in the bottom of shower liner)

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	68.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

Parts

Part #	Description	Qty	Price	Total
F100570470	DOOR JAMB 3-3/4"	1.00	7.03	7.03

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-DOOR JAMB	1.00	35.72	35.72

Subtotal for Job #5: 110.75

Job #6 - Warranty

COMPLAINT: THE INTERIOR TRIM OVER THE TOP OF THE MAIN ENTRY DOOR IS NOT SECURED AND SEALED PROPERLY

CAUSE: Trim above door not installed properly...

CORRECTION: Repositioned screws to stretch out piece of fabric covered trim and silicone the small remaining gap.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	34.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

Subtotal for Job #6: 34.00

Job #7 - Warranty

COMPLAINT: THERE IS INSULATION STICKING OUT FROM AROUND THE INTAKE VENT FOR THE FURNACE.

CAUSE: Insulation coming from blow vent...

CORRECTION: Removed vent and cut back piece of insulation. Reinstalled vent.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	85.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

Subtotal for Job #7: 85.00

Job #8 - Warranty

COMPLAINT: THE ROOF MEMBRANE UNDER THE SKYLIGHT ABOVE THE SHOWER WAS NOT TRIMMED PROPERLY AT THE MANUFACTURER

CAUSE: Membrane wasn't trimmed properly around bathroom skylight...

CORRECTION: Removed inside skylight cover and trimmed back membrane flaps. Reinstalled skylight cover.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	34.00

W/O: 75901
Promised Date: 28 FEB 25



Customer #: 1000
BASDEN'S AMERICAN RV,



Subtotal for Job #8: 34.00

Parts Total: 7.03
Labour Total: 559.30
Sublet Total: 0.00
Extras Total: 35.72

WORK ORDER TOTAL: 602.05

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 14 Feb 2025

W/O: 75901
Promised Date: 28 FEB 25



Customer #: 1000
BASDEN'S AMERICAN RV,

