



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 75934
Promised Date:
08 FEB 25

CUSTOMER WORK ORDER

WO #: 75934

Customer: 26477 - SCHAEFER, WILLIAM
- (812) 453-5167

Tag:

Author: BH

Location: 0305 CHECK PREAUTH

Stock #: 11485

Stock Desc: 2025 TT KEYSTONE

COUGAR HALF-TON 25FKD

Chassis #: 4YDTCGM29SV502372

Serial #: 4YDTCGM29SV502372

Mileage: 0

Licence:

Invoice #:

Date In: 08 FEB 25

Promised: 28 FEB 25

Date Sched:

Completed: 28 FEB 25

Warr. Date: 28 FEB 25

Job #FPDINTT - Internal

COMPLAINT: FINAL PDI ON NEW TRAVEL TRAILERS

CAUSE: Final inspection on new travel trailer

CORRECTION: Checked the running lights, safety chains, brakes, 7way and the breakaway switch. Check and set tire psi to 80. Checked and set lug nut torque to 110ftlbs. Checked the entry steps and found the front entry steps was hitting the fire extinguisher and got a job line for the fix. Did an lp drop test and the paperwork. Dewinterized the camper to check for hot water at each faucet. Ran the furnace and water heater during the lp drop test. Tested the stove, oven and the ac, radio, tv signal, awning, awning lights

Labor

Code	Description	Mechanic	Total
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C

Parts

Part #	Description	Qty	Price	Total
DC-24	ADVANCE GROUP 24 DEEP CYCLE BATTERY	1.00	N/C	N/C
5516	A10-3050FHVP 30M-50F PIGTAIL	1.00	N/C	N/C

Subtotal for Job #FPDINTT: 0.00

Job #WINTER - Internal

COMPLAINT: WINTERIZE UNIT AND DRAIN HOLDING TANKS.

INCLUDES 2 GALLONS OF ANTI-FREEZE

UNITS WITH WASHING MACHINE OR ICEMAKER
WILL BE EXTRA

DE-WINTERIZATION IS NOT INCLUDED

NUMBER OF GALLONS USED _____

CAUSE: Winterizing 2 gallons

CORRECTION: Drained the black, grey and fresh tanks. Turned the valves at the water pump then added 2 gallons thru the kitchen faucet, bathroom faucet, toilet, shower and spray port. Depressed the city water connection.

Labor

Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	SAR	N/C
Z990	WINTERIZE UNIT	SAR	N/C



Customer #: 26477
SCHAEFER, WILLIAM



Parts				
Part #	Description	Qty	Price	Total
24181	-50 RV ANTI-FREEZE GALLON	2.00	N/C	N/C
Other Services				
Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
Subtotal for Job #WINTER:				0.00

Job #CAMERA - Internal

COMPLAINT: INSTALL WIRELESS CAMERA BRAND MOTION

CAUSE: New camera installation

CORRECTION: Unscrewed the false camera mount. Opened the new camera, then found the power wires. Plugged in the adapter to the camper and then to the camera. Plugged the 7way into the test box to power on the running lights and the camera. Plugged the screen in to the test box to verify proper function. Unplugged the screen and put it back in the box and placed in the doorside front compartment.

Labor				
Code	Description		Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		SAR	N/C
Z990	MISC LABOUR CODE (EXTERNAL)		SAR	N/C
Parts				
Part #	Description	Qty	Price	Total
8952	BRAND MOTION 7" CAMERA SYSTEM	1.00	N/C	N/C
Other Services				
Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	N/C	N/C
Subtotal for Job #CAMERA:				0.00

Job #ICSH - Internal

COMPLAINT: INSTALL CUSTOMER SUPPLIED HITCHWORK

CAUSE: Customer supplied the hitchwork

CORRECTION: Leveled the camper then checked the ball height and match the truck. Connected the truck to the camper. Bolted on the snap up brackets and connected the safety chains, breakaway cable, and 7-way.

Labor				
Code	Description		Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		SAR	N/C
Other Services				
Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
Subtotal for Job #ICSH:				0.00

Job #COVER-S - Internal

COMPLAINT: INSTALL SMALL SLIDE COVER 66" TO 96"

CAUSE: New slidetopper installation

CORRECTION: Received the new slide topper and checked for damage. Unpacked the slide topper and ran the slideroom out about 8 inches. Measured and mounted the brackets to the slideroom. Did put butyl tape on the backside of the brackets. Unscrewed the rear gutter spout and slid the slide topper to the gutter. Put the slide topper into the brackets and ran the slideroom in and out to align the slide topper fabric. Added screws in the gutter to hold the fabric in place. Mounted the stopper to the exterior wall and the stopper arm to the topper tube. Checked clearance by running the slideroom out and in. Screwed the gutter spout back on the gutter.





Labor				
Code	Description		Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		SAR	N/C

Parts				
Part #	Description	Qty	Price	Total
PUTTY	PUTTY TAPE - ROLL	1.00	N/C	N/C
10596	90" BLK VEL SLIDE TOPPER	1.00	N/C	N/C

Other Services				
Code	Description	Qty	Price	Total
FRT	FREIGHT	1.00	N/C	N/C
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #COVER-S: 0.00

Job #COVER-L - Internal

COMPLAINT: INSTALL LARGE SLIDE COVER 138" TO 192"

CAUSE: New slidetopper installation

CORRECTION: Received the new slide topper and checked for damage. Unpacked the slide topper and ran the slideroom out about 8 inches. Measured and mounted the brackets to the slideroom. Did put butyl tape on the backside of the brackets. Unscrewed the front gutter spout and slid the slide topper to the gutter. Put the slide topper into the brackets and ran the slideroom in and out to align the slide topper fabric. Added screws in the gutter to hold the fabric in place. Mounted the stopper to the exterior wall and the stopper arm to the topper tube. Checked clearance by running the slideroom out and in. Screwed the gutter spout back on the gutter.

Labor				
Code	Description		Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		SAR	N/C
Z990	MISC LABOUR CODE (EXTERNAL)		SAR	N/C

Parts				
Part #	Description	Qty	Price	Total
PUTTY	PUTTY TAPE - ROLL	1.00	N/C	N/C
10597	150" BLK VEL SLIDE TOPPER	1.00	N/C	N/C

Other Services				
Code	Description	Qty	Price	Total
FRT	FREIGHT	1.00	N/C	N/C
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #COVER-L: 0.00

Job #1 - Warranty

COMPLAINT: ENTRY STEPS HIT FIRE EXTINGUISHER WHEN LOWERING

CAUSE: Front entry steps was hitting the fire extinguisher when folding down the steps

CORRECTION: Took pictures of the steps hitting the fire extinguisher when folded down. Unscrewed the lag bolts form the step hinge mount and move the steps to the left about a 1/4 inch. Adjusted the step latch as well so the steps fit. Unscrewed the fire extinguisher and moved it 1/4inch to the right away from the steps. Moved the steps down to check for clearance. Now there is a 1/4 inch gap between the steps and the fire extinguisher.

Labor				
Code	Description		Mechanic	Total
Z990	MISCELLANEOUS REPAIR		SAR	34.00

Subtotal for Job #1: 34.00



W/O: 75934
Promised Date: 28 FEB 25

Parts Total:	0.00
Labour Total:	34.00
Sublet Total:	0.00
Extras Total:	0.00
WORK ORDER TOTAL:	34.00

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 04 Mar 2025



Customer #: 26477
SCHAEFFER, WILLIAM

