



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 76010
Promised Date:
20 FEB 25

CUSTOMER WORK ORDER

WO #: 76010

Customer: 1000 - BASDEN'S AMERICAN
RV -
Tag:
Author: PH
Location: 0515 CHECK TO SEE IF SR
HAS FIXED THIS YET

Stock #: 11556
Stock Desc: 2025 TT KEYSTONE
SPRINGDALE 240RB
Chassis #: 4YDTSGL23S7103014
Serial #: 4YDTSGL23S7103014
Mileage: 0
Licence:

Invoice #:
Date In: 21 FEB 25
Promised: 28 FEB 25
Date Sched:
Completed: 10 MAY 25
Warr. Date:

Job #PDINTT - Internal

Transferred to BAS*76028 on 24 FEB 25
Estimate amount was 0.00
PDI - NEW TRAVEL TRAILER

Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C
Z991	MISC LABOUR CODE (INTERNAL)	SAR	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
LPGI	LP - UNIT SALES	0.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #WINTER - Internal

Transferred to BAS*76028 on 24 FEB 25
Estimate amount was 0.00
WINTERIZE UNIT AND DRAIN HOLDING TANKS.
INCLUDES 2 GALLONS OF ANTI-FREEZE
UNITS WITH WASHING MACHINE OR ICEMAKER
WILL BE EXTRA
DE-WINTERIZATION IS NOT INCLUDED
NUMBER OF GALLONS USED _____

Labor

Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	SAR	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #WINTER: 0.00

Job #1 - Warranty

COMPLAINT: FRONT COMPARTMENT DOOR WONT LATCH

CAUSE: Compartment door on the off door side wasn't latched when delivered

CORRECTION: Pulled the camper into the shop and inspected why the latch on the compartment wouldn't stay latched. The screw holding the latch together was loose. Aligned the latch then tighten the screw and



Customer #: 1000
BASDEN'S AMERICAN RV,



made sure it latched.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	SAR	34.00

Subtotal for Job #1: 34.00

Job #2 - Warranty

COMPLAINT: rear awning arm not closing properly

CAUSE: Rear awning arm is not alined

CORRECTION: Noticed the rear awning arm not closed as the front arm. Ran the awning out and align the awning arm. With the arm closing a little better now there is holes in the white and blue metal siding from the original insulation. Put in parts order for new rear awning arm ,white siding and blue siding. Received the new metal for the right rear corner. Unscrewed the corner trim and the screws along the entry door. Unscrewed the j wrap then pulled down the silver metal then the blue and the white metal. After replacing the white metal then was utting the blue metal and noticed it was wrong size. Got with Matt about this problem. Put the old metal back up til the correct size comes in.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	BB	340.00
Z990	MISCELLANEOUS REPAIR	SAR	340.00
Z990	MISCELLANEOUS REPAIR	SAR	340.00

Parts

Part #	Description	Qty	Price	Total
10644	Siding - 024 - 16" x _____ Order	6.00	3.30	19.80
750865	Siding - 030 - 9 1/4" x 146 3/4" - 1	1.00	42.04	42.04

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-METAL	1.00	369.54	369.54

Subtotal for Job #2: 1,451.38

Job #3 - Warranty

COMPLAINT: ROOF MEMBRANE HAS STAPLES POKING UP

CAUSE: Staples poking up on the membrane

CORRECTION: While inspecting the new camper found the membrane has high spots possibly from staples.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR		0.00
Z990	MISCELLANEOUS REPAIR	SAR	0.00

Subtotal for Job #3: 0.00

Parts Total: 61.84
Labour Total: 1,054.00
Sublet Total: 0.00
Extras Total: 369.54
WORK ORDER TOTAL: 1,485.38

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.



Customer Signature : _____

Date: 10 May 2025

W/O: 76010
Promised Date: 28 FEB 25



Customer #: 1000
BASDENS AMERICAN RV,

