



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 76022
Promised Date:
98 FEB 25

CUSTOMER WORK ORDER

WO #: 76022

Customer: 55577 - ROBERTS, SUSAN -
812-686-0210

Tag:

Author: PH

Location: DELIVERY 0308

Stock #: 11444

Stock Desc: 2025 TT COACHMEN

CATALINA SUMMIT SERIES 261BH

Chassis #: 5ZT2CARB3SU044286

Serial #: 5ZT2CARB3SU044286

Mileage:

Licence:

Invoice #:

Date In: 24 FEB 25

Promised: 28 FEB 25

Date Sched:

Completed: 19 MAR 25

Warr. Date: 08 MAR 25

Job #FPDINTT - Internal

COMPLAINT: FINAL PDI ON NEW TRAVEL TRAILERS

CAUSE: Final pdi

CORRECTION: Checked the roof membrane and sealer. Touched up any spots as necessary. Got a new battery and put in the battery box and connected the cables. Powered on the 12v fridge to cool. Jacked up the camper and checked the brakes, running lights and breakaway switch. Checked and set the lug nuts to 110ftlbs. Checked and set the tires to 65psi as noted. Dewinterized the camper by turning the valves at the water heater and water pump. Started the lp drop test st the stove adjusted as necessary. Put the anode rod in the water heater and ran it on gas and electric to get hot. Checked each faucet for hot water. Turned off the water heater. Check the tv signal,microwave, outlets. Put the testtv in the living area and had signal but not in the bedroom, got a job line for this problem. Ran the awning out and in with awning lights.

Labor

Code	Description	Mechanic	Total
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C

Parts

Part #	Description	Qty	Price	Total
DC-24	ADVANCE GROUP 24 DEEP CYCLE BATTERY	1.00	N/C	N/C

Subtotal for Job #FPDINTT: 0.00

Job #JACK - Internal

COMPLAINT: INSTALL ELECTRIC TONGUE JACK

CAUSE: Tongue jack swap

CORRECTION: Received the new electric tongue jack and unboxed. Unbolted the manual jack from the tongue and bolted on the electric jack. Wired the jack to the battery and tested.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C

Parts

Part #	Description	Qty	Price	Total
3291	3500# STROMBERG ELEC JACK -BULK	1.00	N/C	N/C



Customer #: 55577
ROBERTS, SUSAN





Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #JACK: 0.00

Job #ICSH - Internal

COMPLAINT: INSTALL CUSTOMER SUPPLIED HITCHWORK

CAUSE: Set up customer hitch work

CORRECTION: I first leveled unit and set the ball to the correct hight and found the customer did not have the sway ball plate and the snap up brackets were not with the truck or hitch I then got all the correct parts and drilled holes for the ball to mount on the frame then hooked up hitch and made sure it was level i could only get it to set to a half an inch to low because al the bolts had lock thread on them and the pivot polt was locked in place I got it as hight as I could but it is recommended to get and equalizer hitch

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JG	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #ICSH: 0.00

Job #WINTER - Internal

COMPLAINT: WINTERIZE UNIT AND DRAIN HOLDING TANKS.

INCLUDES 2 GALLONS OF ANTI-FREEZE

UNITS WITH WASHING MACHINE OR ICEMAKER
WILL BE EXTRA

DE-WINTERIZATION IS NOT INCLUDED

NUMBER OF GALLONS USED _____

CAUSE: Winterizing 2 gallons

CORRECTION: Drained the black, grey and fresh tank. Drained the water heater. Turned the valves at the water heater and water pump. Added 2 gallons of antifreeze thru the kitchen faucet, bathroom faucet, toilet, shower. Depressed city water connection and low points.

Labor

Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	SAR	N/C

Parts

Part #	Description	Qty	Price	Total
24181	-50 RV ANTI-FREEZE GALLON	2.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #WINTER: 0.00

Job #1 - Warranty

COMPLAINT: THERE IS NO SIGNAL TO THE TELEVISION IN THE BEDROOM

CAUSE: Coaxial cable for the antenna was attached to the wrong input of the tv booster

CORRECTION: During the final pdi was testing the tv signal but had no signal to the bedroom. Unscrewed the booster from the wall to checked signal. Chased the coaxial cable to find the antenna cable was in the wrong location. Put the cables in the correct spots on the booster and now have signal.

Labor

Code	Description	Mechanic	Total
------	-------------	----------	-------



Z990

MISC LABOUR CODE (EXTERNAL)

SAR

111.00

Subtotal for Job #1:

111.00

Parts Total: 0.00

Labour Total: 111.00

Sublet Total: 0.00

Extras Total: 0.00

WORK ORDER TOTAL:

111.00

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 19 Mar 2025

W/O: 76022
Promised Date: 28 FEB 25



Customer #: 55577
ROBERTS, SUSAN

