

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 76025
MANUFACTURER'S CLAIM #:

Manufacturer: 52215 - ALLIANCE RV, LLC
Customer: 24523 - KEVIN W. PARDON
Address: 8461 HIGH SCHOOL RD POSEYVILLE, IN

47633

Phone: (812) 457-1745

Stock Number: 11513 - 2025 AVENUE 32RLS 7M5FA3524SA009926

VIN: 7M5FA3524SA009926 HIN:

SER#: 7M5FA3524SA009926

Mileage: 0

Work Order Comp: 15 MAR 25

Auth. No:

Dealer #:

Warr. Date: 21 FEB 25

Work Order Date: 24 FEB 25

Inv #: 415014

WO #	Job #	Description	JOB INFORMATION
------	-------	-------------	-----------------

76025	1	CUSTOMER GOT UNIT TO THEIR HOUSE AND ATTEMPTED TO TURN FURNACE ON. THE FURNACE WOULD LIGHT, BUT IT WOULD NOT STAY LIT. CUSTOMER ADVISED THAT THE FURNACE SOUNDED LIKE A HARLEY DAVIDSON WHEN IT WAS RUNNING.	
-------	---	--	--

. When i switched to the door side tank the furnace puffed and went out then relit instantly. Then u it ran for a bit and i noticed it was short cycling. would shut off. Reset furnace and turned on tank on off door side. And furnace lit I hooked up manometer and Thenould start out at 12. Then to 10.5 while lit.

it would drop to 8 volts and the burner it had good pressure. I noticed it would drop to 11 the back to 12 every 20 seconds or so. it would drop to 8 volts and the burner it had good pressure. I noticed it would drop to 11 the back to 12 every 20 seconds or so. I traced down and found the t stat was dropping power to the furnace t stat is the issue.

Found out air excell had a run of bad t stats. Installed new t stat.

76025	2	CUSTOMER ADVISES THAT NEITHER OF THE FRONT CLOSET DOORS STAYED IN PLACE WHILE UNIT WAS IN TOW.	
-------	---	--	--

The screws pulled out door

I installed inserts in door and then reinstalled screws .

76025	4	THE DRAWER ABOVE THE FIRE PLACE IS KINDA WONKY CHECK AND ADVISE Wood shavings	
-------	---	---	--

I cleaned the wood shavings from both glide tracks the drawer

Claim : 76025

 WO # Job # Description JOB INFORMATION

 is little better. I found if I open and close the drawer using
 2 hands one on each side it closes best.

76025 5 ENTRY DOOR DOES NOT LATCH VERY WELL HAE TO SLAM THE DOOR
 Latches was crooked and loose.
 Adjusted and tightened latch.

 Part No Job# Description PARTS Qty Price Total

 717821 1 COLEMAN T-STAT BLACK Wall Thermos 1.00 74.99 74.99
 717821 1 COLEMAN T-STAT BLACK Wall Thermos 0.00 74.99 0.00

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 1 MISC LABOUR CODE (EXTERNAL) 0.50 185.00 92.50
 Z990 1 MISC LABOUR CODE (EXTERNAL) 0.50 185.00 92.50
 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.00 185.00 0.00
 Z990 2 MISC LABOUR CODE (EXTERNAL) 0.20 185.00 37.00
 Z990 4 MISC LABOUR CODE (EXTERNAL) 0.10 185.00 18.50
 Z990 5 MISC LABOUR CODE (EXTERNAL) 0.00 185.00 0.00
 Z990 5 MISC LABOUR CODE (EXTERNAL) 0.10 185.00 18.50

 Excode Job# Description EXTRAS Qty Price Total

 SS 1 SHOP SUPPLIES 1.00 0.00 0.00

Parts Total: 74.99
 Labour Total: 259.00
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 333.99

Customer Signature: _____

Date: _____