



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 76072
Promised Date:
00 MAR 25



CUSTOMER WORK ORDER

WO #: 76072

Customer: 46875 - CHUBBY CHOW
FACTORY LLC - 812-455-2400

Tag:

Author: BJW

Location: 0711 CHECK STATUS WITH
GAH

Stock #: 11525

Stock Desc: 2026 C COACHMEN

FREELANDER 27QB

Chassis #: 1FDWE3FN7SDD30130

Serial #: 1FDWE3FN7SDD30130

Mileage: 0

Licence:

Invoice #:

Date In: 01 MAR 25

Promised: 29 MAR 25

Date Sched:

Completed: 07 JUL 25

Warr. Date: 07 MAY 25

Job #PDINMHC - Internal

Transferred to BAS*76360 on 31 MAR 25

Estimate amount was 0.00

PDI - NEW MOTORHOME "C"

Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	JG	N/C
Z991	MISC LABOUR CODE (INTERNAL)	JG	N/C
Z991	MISC LABOUR CODE (INTERNAL)	JG	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
LPGI	LP - UNIT SALES	0.00	N/C	N/C

Subtotal for Job #PDINMHC: 0.00

Job #FPDINMH - Internal

Transferred to BAS*76685 on 06 MAY 25

Estimate amount was 0.00

FINAL PDI ON NEW MOTORHOME CLASS C

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	N/C

Subtotal for Job #FPDINMH: 0.00

Job #MAXX - Internal

COMPLAINT: Transferred to BAS*76360 on 31 MAR 25

Estimate amount was 0.00

ROOF VENT COVER - INSTALLED EACH 2 VENTS

CAUSE: Install maxx air vent cover

CORRECTION: I first got all screws and bolts and mounting brackets then when mounting the brackets i had to cut out the dicor to make the brackets set level then mounted brackets and mounted cover to brackets and made sure the vent opened and closed properly on both vent lids

Labor

Code	Description	Mechanic	Total
Z990	INSTALL MAXX AIR VENT	JG	N/C

Customer #: 46875
CHUBBY CHOW FACTORY
LLC,





Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
PARTS	UNINVENTORIED PARTS	0.00	N/C	N/C

Subtotal for Job #MAXX: 0.00

Job #WINTER - Internal

WINTERIZE UNIT AND DRAIN HOLDING TANKS.
 INCLUDES 2 GALLONS OF ANTI-FREEZE
 UNITS WITH WASHING MACHINE OR ICEMAKER
 WILL BE EXTRA
 DE-WINTERIZATION IS NOT INCLUDED
 NUMBER OF GALLONS USED _____

Labor

Code	Description	Mechanic	Total
Z990	WINTERIZE UNIT	GAH	N/C

Parts

Part #	Description	Qty	Price	Total
24181	-50 RV ANTI-FREEZE GALLON	2.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #WINTER: 0.00

Job #1 - Warranty

COMPLAINT: LP LEAK

CAUSE: Lp leak after doing lp drop test

CORRECTION: First I tried to spray down all outdoor lines and conections then did regulator and grill quick port then tried to do an lp drop test at a different location and still had a leak i then spraied line going into the range top inside and also spraied the line going into furnace then spraied line going into water heater and found that there was a leak in then tightened the line and did lp drop test and found that that was the leak and there was no longer any leaks

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JG	122.10
Z990	MISC LABOUR CODE (EXTERNAL)	JG	7.40

Subtotal for Job #1: 129.50

Job #2 - Warranty

COMPLAINT: HEATING PAD FELL OFF

CAUSE: Heating pad fell off

CORRECTION: I removed fallen heating pad and cleaned tank for new one to be wired in and stuck onto the tank then made sure it was working properly

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	70.30
Z990	MISC LABOUR CODE (EXTERNAL)	JG	22.20

Parts

Part #	Description	Qty	Price	Total
F100689025	HEATER, HOLDING TANK 50 GAL MAX, RV	1.00	69.71	69.71





Other Services

Code	Description	Qty	Price	Total
FRT	UPS-HEATER	1.00	15.54	15.54
Subtotal for Job #2:				177.75

Job #3 - Warranty

COMPLAINT: SCREEN DOOR NEEDS ADJUSTED

CAUSE: Screen entry door needs adjusted

CORRECTION: The screen door handle was loose and needed to be tightened and the catch plate needed to be pushed down to make the door catch the door latch

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JG	37.00
Subtotal for Job #3:			37.00

Job #4 - Warranty

COMPLAINT: BATHROOM SHOWER LEAKING AT THE SHOWER MISER

CAUSE: Shower miser leaks

CORRECTION: I took access pannel off wall behind shower miser then found that the conections were never properly sealed so I then had to remove and put seal tape around all of the fitting that didn't have any then made sure there was no more leaks

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	55.50
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	0.00
Subtotal for Job #4:			55.50

Job #5 - Warranty

COMPLAINT: BATHROOM TOWEL HOLDER PULLED OUT OF WALL

CAUSE: Bathroom towel holder fel out of wall

CORRECTION: I first removed the rest of holder and put screw wall anchors in holes and screwed back to the wall and made sure it was secure

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JG	37.00
Subtotal for Job #5:			37.00

Job #6 - Internal

COMPLAINT: TV NOT FINDING CHANNELS

CAUSE: Can't find channels on tv

CORRECTION: I could not find channels and I made sure there were no messed up wires and that everything was connected properly i then took unit outside and could find 4 channels

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JG	N/C





Subtotal for Job #6: 0.00

Job #7 - Warranty

COMPLAINT: BATHROOM SHOWER WALL CRACKED UNDER THE FAUCET

CAUSE: Bathroom shower wall cracked

CORRECTION: Removed shower wall faucet from wall then removed wall and put new wall in place and put the faucet back into place

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	35.15
Z990	MISC LABOUR CODE (EXTERNAL)	JG	57.35
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	185.00
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	185.00
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	0.00

Parts

Part #	Description	Qty	Price	Total
F100584251	SURROUND, SHOWER SENECA BENT WALL 24	1.00	159.68	159.68

Other Services

Code	Description	Qty	Price	Total
FRT	UPS FREIGHT & CRATE - SURROUND	1.00	130.15	130.15

Subtotal for Job #7: 752.33

Job #8 - Warranty

COMPLAINT: WATER HEATER IS MOUNTED WRONG

CAUSE: Water heater is mounted crooked. There is a gap. On the inside left and the hinge side of the door is being pushed out. This is being caused by the water lines on the back of the water heater. The lines are too long and they are pushing the back side of the water heater to the rear of the unit.

CORRECTION: I unhooked the water lines at the back of the water heater. This allowed me to straighten the water heater and mount it properly. After remounting the water heater from the outside, I was able to address the the water line problem. I was able to shorten the hot water line and make it work. Is the cold water line, I had to move the valve to the vertical position. There was not enough room on the water line to keep it in the horizontal position. After moving the valve, I was able to get the rest of the cold water line to fit as it should.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	55.50
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	166.50

Subtotal for Job #8: 222.00

Job #9 - Warranty

COMPLAINT: WHITE INSERT ON REAR WALL POPING OUT OF TRACK

CAUSE: Insert trim shrank and pulled out.

CORRECTION: I stretched the insert trim back over to the corner and screwed it down in the corner.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	55.50





Subtotal for Job #9: 55.50

Job #10 - Warranty

COMPLAINT: BACK UP CAMPER GROMIT PULLED OUT OF WALL

CAUSE: The camera grommet would not fit in the wall.

CORRECTION: I found that the wall was too thick for the camera wire grommet. The hole was the right size. I was able to cut the inside lip off of the wire grommet and push it into the wall. After I got it to fit, I sealed up the inside of the hole with silicone and the silicone will also keep the grommet from coming out.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	37.00
Subtotal for Job #10:			37.00

Job #11 - Warranty

WATER HEATER CONTROL PAD IS BROKEN

Labor				
Code	Description		Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		GAH	55.50
Parts				
Part #	Description	Qty	Price	Total
11194	Wired Controller (for RV Water Heate	1.00	50.59	50.59
Other Services				
Code	Description	Qty	Price	Total
FRT	FREIGHT	1.00	15.58	15.58
Subtotal for Job #11:				121.67

Job #12 - Warranty

MINI BLIND BENT

Labor				
Code	Description		Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		GAH	18.50
Z990	MISC LABOUR CODE (EXTERNAL)		GAH	18.50
Parts				
Part #	Description	Qty	Price	Total
F10012810	BLIND, 20X26 WHITE W/VAL + HLD BRKTS	1.00	3.94	3.94
Other Services				
Code	Description	Qty	Price	Total
FRT	FREIGHT	1.00	15.58	15.58
Subtotal for Job #12:				56.52

Job #13 - Warranty

COMPLAINT: THE ROOF AND THE BACK WALL ARE NOT EVEN AND NEEDS TO BE TRIMMED DOWN

CAUSE: The back wall extends vertically over the roof base. This is lifting the roofing up. The back wall needs to be trimmed down, and the roof material needs to be pulled back and down.

CORRECTION: Need to remove the trim on the top of the back wall. Trim the roof and pull the material down to lay flat on the roof. Then put the trim back on the back wall and seal it up.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)		0.00
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	370.00



Subtotal for Job #13: 370.00

Job #14 - Warranty

COMPLAINT: DEAD BOLT WONT NOT LOCK

CAUSE: Adjust door to get deadbolt to lock

CORRECTION: The door was not straight from top to bottom. I adjusted the door. Now the door is even with the door frame. The deadbolt would still not latch. I found that the deadbolt was barely hitting the door frame. If you pushed on the door very hard, the deadbolt would lock. I tapered and rounded over the corner of the deadbolt. Only around 1/16" on the corner. Now the deadbolt locks. I found that something was rubbing. After looking, I seen that the striker pin needed to be spaced out a bit. I added 1 washer behind the pin and now the door opens, closes, and locks as it should.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	37.00

Subtotal for Job #14: 37.00

Job #15 - Warranty

COMPLAINT: BLACK TANK SUPPORT PIPE IS BROKEN

CAUSE: Black tank pipe strap is missing the bolt that holds it together.

CORRECTION: I found a carriage bolt that fits the strap. I found a nylon lock nut and washer. I installed the bolt, washer, and lock nut in the pipe strap clamp.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	37.00

Subtotal for Job #15: 37.00

Job #16 - Internal

COMPLAINT: GREG BROKE BEDROOM WALL PANEL OF SHOWER

CAUSE: Need to replace the wall panel. Panel is damaged by the light switch.

CORRECTION: I put the wall back together so that the rental department could use it. Waiting on parts.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BB	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	N/C

Parts

Part #	Description	Qty	Price	Total
F100403479	LAUAN, 1/8" X 48" X 96" VERTICAL GRA	1.00	N/C	N/C

Other Services

Code	Description	Qty	Price	Total
FRT	FREIGHT	1.00	N/C	N/C

Subtotal for Job #16: 0.00

Job #17 - Warranty

COMPLAINT: SHOWER PAN SUPPORT IS LOOSE

CAUSE: Shower pan fetch very soft. I checked it from the bottom side and found that the support was not touching the shower base.

W/O: 76072
Promised Date: 29 MAR 25



Customer #: 46875
CHUBBY CHOW FACTORY
LLC,



W/O: 76072
Promised Date: 29 MAR 25

CORRECTION: When I was removing the shower wall to replace it, I pulled up the shower pan and found that the support leg did not touch the floor with the platform in the right place. I removed the leg and cut a new one to hold up the platform. I moved the platform into the right position and screwed it down. Now, the platform is secured and will not move out of place. I reinstalled the shower pan. Now the unit is ready for the new shower wall.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	GAH	185.00

Subtotal for Job #17: 185.00

Parts Total: 283.92
Labour Total: 1,850.00
Sublet Total: 0.00
Extras Total: 176.85

WORK ORDER TOTAL: 2,310.77

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 07 Jul 2025

Customer #: 46875
CHUBBY CHOW FACTORY
LLC,

