



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 76274
Promised Date:
NE ADD 25

CUSTOMER WORK ORDER

WO #: 76274

Customer: 55656 - BUTT, SR, TROY -
812-319-5483

Tag:

Author: BH

Location: DELIVERY 0405

Stock #: PA2610

Stock Desc: 2018 TT FOREST RIVER
HEMISPHERE 282RK

Chassis #: 4X4TSBD22JU082610

Serial #: 4X4TSBD22JU082610

Mileage: 0

Licence:

Invoice #:

Date In: 21 MAR 25

Promised: 05 APR 25

Date Sched:

Completed: 10 APR 25

Warr. Date: 28 MAR 25

Job #1 - Internal

COMPLAINT: Transferred to BAS*76401 on 05 APR 25

Estimate amount was 0.00

FIND OUT WHY THE SLIDE JUST CLICKS AND IS NOT MOVING

CAUSE: Slide room won't move

CORRECTION: The hardware around the slide skis is coming out. The slide room also needs to be lubricated. Applied double sided tape to the slide skis with 3m adhesive primer. Installed larger screws to hold hardware around the slide skis. Sealed with silicone. Applied slide lubricant to slide room hardware.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Subtotal for Job #1: 0.00

Job #17V756 - Warranty

COMPLAINT: 17V756, 2017-610 KIDDE FIRE EXT;CONTACT KIDDE@ WWW.KIDDE.COM

CAUSE: DONE

CORRECTION: DONE

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	18.50

Subtotal for Job #17V756: 18.50

Job #PDIUCTT - Internal

COMPLAINT: Transferred to BAS*76401 on 05 APR 25

Estimate amount was 0.00

PDI USED CERTIFIED TRAVEL TRAILER

CAUSE: Pdi

CORRECTION: Pulled unit into shop. Plugged into shore power. Checked all appliances checked water and plumbing system checked electrical system checked cabinets doors and drawers. Checked all lights. Set tire pressure. Torqued lugs checked brakes. Filled l.p and ran l.p drop test. Checked roof. Checked antenna. Programmed tv remote.

Labor



Customer #: 55656
BUTT, SR, TROY



W/O : 76274
Promised Date: 05 APR 25

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
LPGI	LP - UNIT SALES	0.00	N/C	N/C

Subtotal for Job #PDIUCTT: 0.00

Job #FPDIUCTT - Internal

COMPLAINT: Transferred to BAS*76401 on 05 APR 25
Estimate amount was 0.00
FINAL PDI USED CERTIFIED TRAVEL TRAILER

CAUSE: Final

CORRECTION: Checked appliances plumbing and electrical systems. Installed new batteries. Ran l.p drop test. Torqued lugs checked tire pressure.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Subtotal for Job #FPDIUCTT: 0.00

Job #EQUALIZER1000 - Internal

COMPLAINT: Transferred to BAS*76401 on 05 APR 25
Estimate amount was 0.00
INSTALL 1000# EQUALIZER HITCH

CAUSE: Installed brackets on frame. Placed the rest of the hitch inside unit.
Hitch setup and adjusted

CORRECTION: .

Leveled the camper then checked the ball height and matched the truck ball height. Connected the truck to the camper. Checked the height. Connected the 7-way, safety chains, breakaway cable and latched the coupler. Chetthe running lights.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #EQUALIZER1000: 0.00

Job #DELUXE - Internal

Transferred to BAS*76401 on 05 APR 25
Estimate amount was 0.00
DELUXE STARTER KIT



Customer #: 55656
BUTT, SR, TROY



Subtotal for Job #DELUXE: 0.00

W/O: 76274
Promised Date: 05 APR 25



Customer #: 55656
BUTT, SR, TROY



Job #BCWT - Internal

COMPLAINT: Transferred to BAS*76401 on 05 APR 25
Estimate amount was 0.00
HARD WIRED BRAKE CONTROL AND WIRING - TRUCK/SUV

CAUSE: Brake controller install

CORRECTION: Gathered brake controller and harness from the parts department. Located the plug under the dash then plugged in then adapter harness. Wired in a diode to the brake controller then mounted to the dash. Plugged in the brake controller and used the test box to test all functions.

Labor

Code	Description	Mechanic	Total
BCWT	BRAKE CONTROL & WIRING - PICKUP	SAR	N/C
BCWT	BRAKE CONTROL & WIRING - PICKUP	SAR	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #BCWT: 0.00

Job #2 - Internal

COMPLAINT: Transferred to BAS*76401 on 05 APR 25
Estimate amount was 0.00
30AM POWER INLET IS BROKEN AND BURNT INSIDE

CAUSE: Power inlet needs replaced.

CORRECTION: Removed the mounting screws. Cut wires. Stripped back wire insulation. Secured wires to the inlet. Secured the inlet to the wall.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Subtotal for Job #2: 0.00

Job #3 - Internal

COMPLAINT: Transferred to BAS*76401 on 05 APR 25
Estimate amount was 0.00
WIRING ISSUE

CAUSE: Plugged unit into a fork truck to open slide room. There is no 12 volt power going through the unit. Checked battery connection. I noticed a wire hanging under the frame.

CORRECTION: Replaced wire terminal and connected wire to 12 volt breaker under the frame. Hooked up a battery and ran the slide room out. Plugged unit into shore power. Checked the breaker panel and fuses. 12 volt power is good through the unit.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C

Subtotal for Job #3: 0.00

Job #4 - Internal

COMPLAINT: Transferred to BAS*76401 on 05 APR 25
Estimate amount was 0.00
THE TANK SENSORS ARE NOT READING CORRECTLY.





CAUSE: During the pdi I noticed the black and both grey tanks were reading full. Hooked up drain hose and opened the gate valves and nothing came out of either of the tanks.

CORRECTION: Received new gen from parts. Filled each tank with new gen and water. Drained tanks after letting sit. Drained tanks. Tanks are all still reading. Filled tanks with new gen again. Let sit and drained. Black tank reads empty. Both grey tanks are still reading full. Cut open underbelly and located sensors. Replaced sensor on front tank. Tank reads empty. Taped underbelly. Cut another hole in the underbelly and located sensor on back tank. Replaced 3 sensor and diode pack. Tank is now reading empty. Taped underbelly. Cleaned up mess.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Subtotal for Job #4:			0.00

Job #5 - Internal

COMPLAINT: Transferred to BAS*76401 on 05 APR 25

Estimate amount was 0.00

THE ROOF IS IN NEED OF DICOR

CAUSE: All of the dicir needs touched up.

CORRECTION: Moved a lift over to the unit. Applied dicor to all cracks and voids. Parked lift.

Labor			
Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	ZMS	N/C
Subtotal for Job #5:			0.00

Parts Total:	0.00
Labour Total:	18.50
Sublet Total:	0.00
Extras Total:	0.00
WORK ORDER TOTAL:	18.50

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 10 Apr 2025

