

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 76531
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 54780 - WENDY GILES
Address: 1923 HATHAWAY AVE EVANSVILLE, IN

47712

Phone: 812-664-9768

Stock Number: 11569 - 2025 CATALINA SUMMIT SERIES 211BH 5ZT2CAKB5SU045563

VIN: 5ZT2CAKB5SU045563 HIN: SER#: 5ZT2CAKB5SU045563

Mileage: 0

Work Order Comp: 09 MAY 25

Auth. No:

Dealer #:

Warr. Date: 15 APR 25

Work Order Date: 21 APR 25

Inv #: 417125

WO # Job # Description JOB INFORMATION

76531 5 THE PLACTIS RING AROUND THE POWER CORD IS BROKEN
Assess broken lock ring on 30A power cord...
Lock ring is split... replaced it with a new 30A power cord.

76531 7 LP COVER MISSING CAP ON BACK SIDE
Replace LP Container Cover...
Replaced LP Container Cover

76531 1 BOARD THAT GOES UNDER DINETTE DOES NOT SIT FLUSH
Assess board under dinnette that's not flush...
Made mark to board where it wasn't falling into place. Cut board
and put back into place.

76531 2 THE A/C DOES NOT GET VERY COLD
Assess ac cooling...
Turned AC on and let run... after 30mins of running with the temp
about 80 out I only had 76 coming from unit. Ran a Amp draw test
and had 2.37A draw from the breaker power. It had 2.3A coming
from the AC side on both the Black and White wires. Plulled
shroud. Showed no Amps orpower running to the Condenser Plug at
condensor. Removed the covers from the AC and disconnected the
Plug from the outside unit and hooked up the test box and AC Fan
runs properly but the Compressor does not engage. Showed no signs
of Freion leak at coils or lines. Double checked my work with
another tech, Greg, and service writer, Ben, and determined a new
AC is needed, which i submitted part request. Put the Converter

Claim : 76531

 WO # Job # Description JOB INFORMATION

Panel back together. Cleaned up my tools, parts and mess.

76531 3 THE VELCRO ON THE DINETTE CUSHION IS MISSING A PIECE
 Assess the missing velcro on back pad of dinnette...
 Seen where they velcro was not in place, found the velcro under
 bench seat and reattached it.

76531 4 BLACK TANK FLUSH FITTING LEAKS
 Assess black tank flush port leaks...
 The port didn't have a rubber gasket seal. Installed one.

76531 6 TRIM ABOVE BED IS LOOSE
 Assess loose trim...
 The lose trim is a rubber like corner, i attempted to heat it up
 to get it to mold down but it would not. I took the closest to
 match of seam tape and used it to adhere it down and not be
 folded outward.

Part No	Job#	Description	PARTS	Qty	Price	Total
VLPA10-3025ED	5	A10-3025ED 30A 25'	TWISTLOCK	1.00	69.25	69.25
CMC50502	7	BLACK - Propane Tank Cover;	For D	1.00	28.58	28.58

Lab Code	Job#	Description	LABOUR	Hrs	Rate	Total
Z990	5	MISC LABOUR CODE	(EXTERNAL)	0.00	185.00	0.00
Z990	7	MISC LABOUR CODE	(EXTERNAL)	0.10	185.00	18.50
Z990	1	MISC LABOUR CODE	(EXTERNAL)	0.20	185.00	37.00
Z990	2	MISC LABOUR CODE	(EXTERNAL)	2.00	185.00	370.00
Z990	2	MISC LABOUR CODE	(EXTERNAL)	0.00	185.00	0.00
Z990	2	MISC LABOUR CODE	(EXTERNAL)	0.00	185.00	0.00
Z990	2	MISC LABOUR CODE	(EXTERNAL)	0.00	185.00	0.00
Z990	2	MISC LABOUR CODE	(EXTERNAL)	0.00	185.00	0.00
Z990	2	MISC LABOUR CODE	(EXTERNAL)	0.00	185.00	0.00
Z990	3	MISC LABOUR CODE	(EXTERNAL)	0.05	185.00	9.25
Z990	4	MISC LABOUR CODE	(EXTERNAL)	0.10	185.00	18.50
Z990	6	MISC LABOUR CODE	(EXTERNAL)	0.20	185.00	37.00

Parts Total: 97.83
 Labour Total: 490.25
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 588.08

Customer Signature: _____

Date: _____