

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 76564
MANUFACTURER'S CLAIM #:

Manufacturer: 52215 - ALLIANCE RV, LLC
Customer: 3801 - MICHAEL FIFIELD
Address: 2357 REID ROAD OWENSBORO, KY

42303

Phone: 270-993-3819

Stock Number: 11586 - 2025 DELTA 262RB 7M5TD2924SC306309

VIN: 7M5TD2924SC306309 HIN: SER#: 7M5TD2924SC306309

Mileage: 0

Work Order Comp: 28 MAY 25

Auth. No:

Dealer #:

Warr. Date: 29 APR 25

Work Order Date: 23 APR 25

Inv #: 417903

WO #	Job #	Description	JOB INFORMATION
------	-------	-------------	-----------------

76564	4	STYLE IS DAMAGED ON THE DINETTE SEAT Style frame on the dinette is damaged from the folding table on the side of the kitchen counter and has a long scratch Took pictures of the dinette booth that has damage. Put in po for new frame style	
76564	6	DECAL ON THE OFF DOOR SIDE FRONT IS PEELING Black decal is peeling up Took pictures of the decal that is peeling put in po for a new decal.	
76564	1	THE BLACK TANK BREAKER IS INSTALLED BACKWARDS Black tank vacuum breaker During the pdi I connected the garden hose to the black tank flush connection. The garden hose was tight from pressure and couldn't hear water flowing. Went to the vacuum breaker and the valve wasn't up. Shut off the water to the black tank flush and disconnected the hose to relieve the pressure. Unscrewed the vacuum breaker and cut the bands on the pex lines. Pulled off the fittings and cut the opposite water short. Crimped the fittings to the correct water line and screwed on the vacuum breaker. Went back to the black tank flush connection and tightened the hose, turned on the water and could hear water flowing thru the vacuum breaker and into the black tank. Turned off the water and disconnected the hose from the black tank flush.	

Claim : 76564

 WO # Job # Description JOB INFORMATION

76564 2 THE SCREEN DOOR NEEDS ADJUSTED
 Screen door latch
 During the pdi checked the entry door and screen door to verify they close properly. The screen door didn't catch the latch. Took pictures of the problem. Unscrewed the latch and replaced with longer screws and 4 washers. Putnthe washers behind the latch and screwed in longer screws as the factory screws was to short. Shut the screen door and found that it closes and stays closed till it is opened as should.

76564 3 THE SLIDE ROOM TRACK IS HITTING THE SLIDE SEAL.
 Flap seal hits bell
 Took pictures of the slideroom bell hitting the flap seal. Used a razor blade to trim the flap seal till the slideroom bell cleared. Ran the slideroom in and out to verify the bell would not hit the flap seal.

 Part No Job# Description PARTS Qty Price Total

20163	4	Stile - 2.5 x 108 - LC Square - E		1.00	8.99	8.99
25226	6	Decal - DC 5A LH - (Delta 2024)		1.00	21.99	21.99

 Lab Code Job# Description LABOUR Hrs Rate Total

Z990	4	MISC LABOUR CODE (EXTERNAL)		0.30	185.00	55.50
Z990	4	MISC LABOUR CODE (EXTERNAL)		0.00	185.00	0.00
Z990	6	MISC LABOUR CODE (EXTERNAL)		0.50	185.00	92.50
Z990	6	MISC LABOUR CODE (EXTERNAL)		0.00	185.00	0.00
Z990	1	MISC LABOUR CODE (EXTERNAL)		0.00	185.00	0.00
Z990	1	MISC LABOUR CODE (EXTERNAL)		0.16	185.00	29.60
Z990	1	MISC LABOUR CODE (EXTERNAL)		0.02	185.00	3.70
Z990	2	MISC LABOUR CODE (EXTERNAL)		0.10	185.00	18.50
Z990	3	MISC LABOUR CODE (EXTERNAL)		0.20	185.00	37.00

 Excode Job# Description EXTRAS Qty Price Total

FRT	4	FRIGHT - 4 & 6		1.00	33.62	33.62
-----	---	----------------	--	------	-------	-------

Parts Total: 30.98
 Labour Total: 236.80
 Sublet Total: 0.00
 Extras Total: 33.62

>>>>> Claim Total: 301.40

Customer Signature: _____

Date: _____