



Warranty Authorization Form

Date: 5/28/2025

Basden RV Center, Inc. DBA/ American RV
600 E Baseline Rd
Evansville, IN 47725
Ph. (812) 867-5200
cbruce@americanrvcenter.com

General Information

Pre-Auth #: 91771 Unit: 7M5TD2924SC306309
Series: Delta Model: 2025DEL262RB
Notes:
Status: Approved

Dealer Information

American RV
(812) 867-5200
cbruce@americanrvcenter.com

Basden RV Center, Inc. DBA/ American RV
600 E Baseline Rd
Evansville, IN 47725

Requestor: Ben Hoffman
Return Fax #:
Email: bhoffman@americanrvcenter.com

Operation Line 1

Flat Rate Code: 22488 FRESH WATER - VACUUM BREAKER -
REPLACE (Part Return Required)

Fault Code: IMPROPERLY INSTALLED

Serial #:

Model #:

Notes:

Problem: THE BLACK TANK BREAKER IS INSTALLED BACKWARDS

Time Requested: .2

Cause: Black tank vacuum breaker

Time Allowed: .2

Remedy: During the pdi I connected the garden hose to the black tank flush connection. The garden hose was tight from pressure and couldn't hear water flowing. Went to the vacuum breaker and the valve wasn't up. Shut off the water to the black tank flush and disconnected the hose to relieve the pressure. Unscrewed the vacuum breaker and cut the bands on the pex lines. Pulled off the fittings and cut the opposite water short. Crimped the fittings to the correct water line and screwed on the vacuum breaker. Went back to the black tank flush connection and tightened the hose, turned on the water and could hear water flowing thru the vacuum breaker and into the black tank. Turned off the water and disconnected the hose from the black tank flush.

Sublet Repairs: 0.00

Part Return Req: Yes

Status: Approved

Operation Line 2

Flat Rate Code: 22308 ENTRANCE DOOR - SCREEN DOOR - REPAIR *Fault Code:* MISALIGNED
(photos of defect and door tag)

Serial #: *Model #:* *Notes:*

Problem: THE SCREEN DOOR NEEDS ADJUSTED

Time Requested: .1

Cause: Screen door latch

Time Allowed: .1

Remedy: During the pdi checked the entry door and screen door to verify they close properly. The screen door didn't catch the latch. Took pictures of the problem. Unscrewed the latch and replaced with longer screws and 4 washers. Put the washers behind the latch and screwed in longer screws as the factory screws were too short. Shut the screen door and found that it closes and stays closed till it is opened as should.

Sublet Repairs: 0.00

Part Return Req: No

Status: Approved

Operation Line 3

Flat Rate Code: 12075 SLIDEOUT - SEAL - REPAIR (Photos required) *Fault Code:* MISALIGNED

Serial #: *Model #:* *Notes:*

Problem: THE SLIDE ROOM TRACK IS HITTING THE SLIDE SEAL.

Time Requested: .2

Cause: Flap seal hits bell

Time Allowed: .2

Remedy: Took pictures of the slideroom bell hitting the flap seal. Used a razor blade to trim the flap seal till the slideroom bell cleared. Ran the slideroom in and out to verify the bell would not hit the flap seal.

Sublet Repairs: 0.00

Part Return Req: No

Status: Approved

Operation Line 4

Flat Rate Code: 14014 CABINET - BASE - STILE REPLACE *Fault Code:* MARRED / SCRATCHED
(Photos required)

Serial #: *Model #:* *Notes:*

Problem: STYLE IS DAMAGED ON THE DINETTE SEAT

Time Requested: .3

Cause: Style frame on the dinette is damaged from the folding table on the side of the kitchen counter and has a long scratch

Time Allowed: .3

Remedy: Took pictures of the dinette booth that has damage. Put in po for new frame style

Sublet Repairs: 0.00

Part Return Req: No

Status: Approved

Operation Line 5

Flat Rate Code: 12027 DECAL - SIDEWALL - REPLACE (photos required) *Fault Code:* LOOSE

Serial #:

Model #:

Notes:

Problem: DECAL ON THE OFF DOOR SIDE FRONT IS PEELING

Time Requested: .5

Cause: Black decal is peeling up

Time Allowed: .5

Remedy: Took pictures of the decal that is peeling put in po for a new decal.

Sublet Repairs: 0.00

Part Return Req: No

Status: Approved