

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	2323096
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CAUB0RN300461
USA		CHASSIS VIN	
		MILEAGE	0
Labor rate:	\$185.00	SITE/WAREHOUSE	300 / 300
OWNER INFORMATION		ITEM #	CAT293QBCKLE-300
RICHARD POHL		DEALER RO #	76894
120 W 975 S		CLAIM START DATE	06/05/2025
Haubstadt, IN 47639		CLAIM END DATE	01/01/1900
USA			
Retail Date of Purchase	08/15/2024	WARRANTY EXPIRATION DATE	08/15/2025

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	RC-720-09-00-004710	25V264, 2025-217 - INCORRECT OVER CURRENT PROTECTION - INSPECTION AND REMEDY - Recall/Wiring/Perform/No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2025-06-05 08:47:05 :: 25V264 THE FRONT EXTERIOR ACCENT LAMP WIRE (16AWG) MAY BE ON A 30 AMP BREAKER, WHEREAS IT SHOULD BE ON A 10 AMP OVER CURRENT DEVICE. THE AWNING MAY BE MISSING THE REQUIRED 15AMP OVER CURRENT PROTECTION. THE AUTO-LEVELING SYSTEM MAY BE WIRED TO CONSTANT HO ON A 30 AMP MINI-BREAKER. 3 recalls... 1, no Accent Lamps. 2, Self Leveling system needed a breaker added. 3, awning power wire needed a 15a inline fuse added.			
Model#		Dlr Sub Hrs	1.25	Sub Labor Amt \$231.25
Serial#		Appr Hrs	0.75	Appr Labor Amt \$138.75
	Notes			
	EXCESSIVE AMOUNT REQUESTED. CHANGED TO FLAT RATE			
	THE REQUESTED REPAIR CAN BE COMPLETED IN THE FLAT RATE TIME ALLOTTED			

Labor

Line# 2

Operation Code	Operational Description		
40-106-24-11-001253	Exterior 12 Volt Wiring - Electrical/12 Volt Exterior/Repair/Electrical		
Complaint, Cause, Correction			
Original Note : bhoffman@americanrvcenter.com, 2025-06-05 09:23:07 :: There was no Accent Lamps oin this unit. There is a Self Leveling System on this unit. This unit did not have removable Lag Screw so i cut a access hole in area where Wires from battery entered the underbelly. there was no conjoining breakers on this unit. recieved 30A breaker and copper Buss from Parts. removed Terminals from Battery. Removed wires from installed Breaker. Mounted 2nd breaker next to 1st Breaker and conjoined breakers with Buss Bar.Mounted Wires in explained areas from Recalls directions. Hooked Terminals back to Battery and turned on Battery Disconnect and tested operations... All are function correctly. Ziptied Wires in underbelly to secure them and closed cut out panel with underbelly Tape. There is a Awning on this unit. Removed inside panel in cabinet located behind the Control Center. Located the Yellow Awning Power Wire. Installed a 15A Inline Fuse on Awning Power Wire and hooked it back up to the Control Box. Tested Awning operations which worked properly. Secured the inner wires and reinstalled Panel inside Cabinet.			
Model#	Dlr Sub Hrs	0.75	Sub Labor Amt \$138.75
Serial#	Appr Hrs	0.50	Appr Labor Amt \$92.50
Notes			
EXCESSIVE AMOUNT REQUESTED. CHANGED TO SIMILAR REPAIR TIME FOR SIMILAR REPAIRS			
THE REQUESTED REPAIR CAN BE COMPLETED IN THE TIME ALLOTTED			

Submitted	Labor Amt	\$370.00
	Parts & Freight	\$0.00
	Total	\$370.00

Approved	Labor Amt	\$231.25
	Parts & Freight	\$0.00
	Total	\$231.25

DEALER	DATE
SIGNATURE	
I certify that I have performed these repairs consistent with Forest River Policies.	

CUSTOMER	DATE
SIGNATURE	
All repairs described have been inspected and are satisfactory.	