



600 E. Baseline Rd.  
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200  
FAX 812.868.1012

W/O: 76894  
Promised Date:  
20 JUN 25



Customer #: 55123  
POHL, RICHARD



### CUSTOMER WORK ORDER

WO #: 76894

Customer: 55123 - POHL, RICHARD -  
812-779-6831

Tag:

Author: BJW

Location: 0606 CHECK PREATUH

Stock #: 11413

Stock Desc: 2024 TT COACHMEN  
CATALINA 293QBCKLE

Chassis #: 5ZT2CAUB0RN300461

Serial #: 5ZT2CAUB0RN300461

Mileage:

Licence:

Invoice #:

Date In: 02 JUN 25

Promised: 30 JUN 25

Date Sched:

Completed: 05 JUN 25

Warr. Date: 16 AUG 24

#### Job #1 - Internal

COMPLAINT: CUSTOMER ADVISES WHEN USING THE FURNACE, IT HEATS THE UNIT VERY HOT BEFORE IT WILL SHUT OFF. CUSTOMER FEELS THAT IT IS GETTING THE UNIT MUCH HOTTER THAN WHAT IS REQUESTED ON THE THERMOSTAT.

CAUSE: Assess Furnace Turning on and off with desired temp at thermostat...

CORRECTION: Measured temp inside unit at 74 degrees with infrared gun. Turned LP on and set thermostat to 70 degrees and it didn't turn on, waited 10mins. Turned Thermostat up to 80 degrees and unit fired up and I let it run for about 10mins and turned Thermostat back down to 70 degrees and unit Turned off. Turned unit back up to 80 degrees at 9:54 and it fired right up and showed 115 degrees at floor vent and 79 degrees at return at Furnace. Took my 15min break and came back at 10:10 and the Furnace was off so it is working efficiently.

#### Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	N/C

Subtotal for Job #1: 0.00

#### Job #2 - Warranty

COMPLAINT: 25V264 THE FRONT EXTERIOR ACCENT LAMP WIRE (16AWG) MAY BE ON A 30 AMP BREAKER, WHEREAS IT SHOULD BE ON A 10 AMP OVER CURRENT DEVICE. THE AWNING MAY BE MISSING THE REQUIRED 15AMP OVER CURRENT PROTECTION. THE AUTO-LEVELING SYSTEM MAY BE WIRED TO CONSTANT HO ON A 30 AMP MINI-BREAKER.

CAUSE: 1, no Accent Lamps.

2, Self Leveling system needed a breaker added.

3, awning power wire needed a 15a inline fuse added.

CORRECTION: There was no Accent Lamps on this unit. There is a Self Leveling System on this unit. This unit did not have removable Lag Screw so I cut a access hole in area where Wires from battery entered the underbelly. there was no conjoining breakers on this unit. recieved 30A breaker and copper Buss from Parts. removed Terminals from Battery. Removed wires from installed Breaker. Mounted 2nd breaker next to 1st Breaker and conjoined breakers with Buss Bar. Mounted Wires in explained areas from Recalls directions. Hooked Terminals back to Battery and turned on Battery Disconnect and tested operations... All are function correctly. Ziptied Wires in underbelly to secure them and closed cut out panel with underbelly Tape. There is a Awning on this unit. Removed inside panel in cabinet located behind the Control Center. Located the Yellow Awning Power Wire. Installed a 15A Inline Fuse on Awning Power Wire and hooked it back up to the Control Box. Tested Awning operations which worked properly. Secured the inner wires and reinstalled Panel inside Cabinet.

#### Labor

Code	Description	Mechanic	Total
------	-------------	----------	-------



Z990 MISC LABOUR CODE (EXTERNAL)  
Z990 MISC LABOUR CODE (EXTERNAL)

JRK 138.75  
JRK 92.50

**Parts**

Part #	Description	Qty	Price	Total
19-3535	Fuse Holder; ATO/ ATC Blade Fuses; 5	1.00	8.96	8.96
19-1441	16-3030 30A CIRCUIT BREAKER	1.00	3.85	3.85
<b>Subtotal for Job #2:</b>				<b>244.06</b>

Parts Total: 12.81  
Labour Total: 231.25  
Sublet Total: 0.00  
Extras Total: 0.00  
**WORK ORDER TOTAL: 244.06**

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : \_\_\_\_\_

Date: 05 Jun 2025

W/O: 76894  
Promised Date: 30 JUN 25



Customer #: 55123  
POHL, RICHARD

