

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 75596
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 54983 - ELISA MORRISON
Address: 10346 WELLINGTON DR
EVANSVILLE, IN
47725
Phone:
Stock Number: 2023 GEORGETOWN GT5 34M5 4X4MGTK27PH036111
VIN: 4X4MGTK27PH036111 HIN: SER#: 1F66F5DN7N0A16198
Mileage: 3698 Work Order Comp: 27 JAN 25
Auth. No: Dealer #:
Warr. Date: Work Order Date: 02 DEC 24 Inv #: 413461

WO # Job # Description JOB INFORMATION

75596 5 FRIDGE NOT WORKING AT ALL
Possible blockage
Plugged in the shore cord, then turned the fridge to lp and
checked the back side for a flame. Took pictures of the flame.
Set the fridge to ac and put antifreeze bottles with thermometers
in side the fridge to cool overnight. Checked the amp draw on the
heating elements of 3.5 amps. Checked the fridge again after 24
hrs. The cooling unit was hot, but the freezer and fridge were
hot at 70 degrees. It's possible a blockage in the cooling unit.
Filled out the paperwork while testing the fridge. Received the
copper tape. Unscrewed the fridge control board cover then
covered the cover with copper tape as noted. Took pictures.
Screwed the cover back on to the fridge. Plugged in the shore
power and power on the fridge. Put bottles of antifreeze with
thermometers inside. Will let the fridge set for 24hrs. After 48
hrs thr fridge was not cold. Put in po sheet for a new fridge.

75596 2 FIX THE ROOF FROM THE ROOF INSPECTION
Cracks and voids
Cleaned the roof around roof caps, vents, skylight, solar panel,
roof edges, antenna, then applied dicor sealer as necessary to
fill the cracks and voids.

75596 4 MARKER LIGHT NOT WORKING ON THE FRONT. THIS IS A WHITE LED TUBE
THAT OUTLINES THE COACH. IT IS WORKING ON THE PASSENGER SIDE, BUT
NOT THE DRIVER SIDE

Claim : 75596

 WO # Job # Description JOB INFORMATION

Wires was disconnected
 Searched for the button that cause the lights to come on. Turned
 on the the lights then checked the wires. Found the black and
 yellow wires was unplugged. Plugged in those wires and the lights
 work.

75596 6 CUSTOMER ADVISES THAT ONE OF THE BLINDS IN THE BATHROOM HAS
 FALLEN DOWN.
 Screw had pulled out of the valance
 Took a picture of the blind then inspected why it was sitting
 wrong. Pulled down the rest of the blind to find that a screw
 wasn't in place. Put the screw and clip back in the valance and
 clipped in the blind. Pulled on the blind to make sure it still
 was functioning. Blind works as should.

 Part No Job# Description PARTS Qty Price Total

 AMZCOPPERTAPE 5 Copper Foil Tape (2inch X 66 FT) 1.00 17.81 17.81
 13-1287 2 NON SELF LEVELING DICOR 1.00 6.98 6.98
 13-1320 2 PW HAPS FREE SELF-LEVELING DICOR 7.00 7.71 53.97

 Lab Code Job# Description LABOUR Hrs Rate Total

 Z990 5 MISC LABOR CODE (EXTERNAL) 0.01 170.00 1.70
 Z990 5 MISC LABOR CODE (EXTERNAL) 0.30 170.00 51.00
 Z990 5 MISC LABOR CODE (EXTERNAL) 0.11 170.00 18.70
 Z990 5 MISC LABOR CODE (EXTERNAL) 0.00 170.00 0.00
 Z990 5 MISC LABOR CODE (EXTERNAL) 0.73 170.00 124.10
 Z990 5 MISC LABOR CODE (EXTERNAL) 0.24 170.00 40.80
 Z990 5 MISC LABOR CODE (EXTERNAL) 1.12 170.00 190.40
 Z990 5 MISC LABOR CODE (EXTERNAL) 0.00 170.00 0.00
 Z990 5 MISC LABOR CODE (EXTERNAL) 0.33 170.00 56.10
 Z990 5 MISC LABOR CODE (EXTERNAL) 0.10 170.00 17.00
 Z990 5 MISC LABOR CODE (EXTERNAL) 1.78 170.00 302.60
 Z990 5 MISC LABOR CODE (EXTERNAL) 0.28 170.00 47.60
 Z990 2 MISC LABOR CODE (EXTERNAL) 3.00 170.00 510.00
 Z990 4 MISC LABOR CODE (EXTERNAL) 0.20 170.00 34.00
 Z990 6 MISC LABOR CODE (EXTERNAL) 0.20 170.00 34.00

Parts Total: 78.76
 Labour Total: 1,428.00
 Sublet Total: 0.00
 Extras Total: 0.00

>>>> Claim Total: 1,506.76

Customer Signature: _____

Date: _____