



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 77190
Promised Date:
02 11 11 25

CUSTOMER WORK ORDER

WO #: 77190

Customer: 55978 - BLACKBURN,
DEBORAH - 812-550-0529
Tag:
Author: BH
Location: 0718 CHECK PREAUTH

Stock #: 11595
Stock Desc: 2025 TT KEYSTONE
COUGAR HALF-TON 29RLP
Chassis #: 4YDTCGN25SV506157
Serial #: 4YDTCGN25SV506157
Mileage:
Licence:

Invoice #:
Date In: 01 JUL 25
Promised: 03 JUL 25
Date Sched:
Completed: 18 JUL 25
Warr. Date: 03 JUL 25

Job #FPDINTT - Internal

FINAL PDI ON NEW TRAVEL TRAILERS

Labor

Code	Description	Mechanic	Total
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C
PDINTT	PDI - NEW TRAVEL TRAILER	SAR	N/C

Parts

Part #	Description	Qty	Price	Total
DC-24	ADVANCE GROUP 24 DEEP CYCLE BATTERY	1.00	N/C	N/C
11161	30AM-50AF ADAPTER CORD, 12IN, BULK	1.00	N/C	N/C
H424	H424 SAFETY LOCK PIN 5/16" x 2-9/16"	1.00	N/C	N/C

Subtotal for Job #FPDINTT: 0.00

Job #SWAP - Internal

SWAP CUSTOMER'S HITCHWORK

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C

Subtotal for Job #SWAP: 0.00

Job #1 - Internal

INSTALL CUSTOMER SUPPLIED TV AND WE SUPPLIE THE BRACKET

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C
Z990	MISC LABOUR CODE (EXTERNAL)	SAR	N/C

Parts

Part #	Description	Qty	Price	Total
F100146470	TV, BRACKET - 2 ARM SWING LCD BRACKE	1.00	N/C	N/C

Customer #: 55978
BLACKBURN, DEBORAH



Subtotal for Job #1: 0.00

Job #2 - Warranty

COMPLAINT: UNDER BELLY IS FULL OF WATER

CAUSE: Water line to the black tank flush had a kink that it was leaking at the kink and leaking into to the underbelly.

CORRECTION: When pulling the camper from the sales lot had noticed front underbelly was leaking water. Set the camper outside of the service bay. Lower the front of the camper and unscrewed some of the self tappers to drain out the water. Connected the garden hose to the winterizing port and checked for leaks. Disconnected the hose and connected to the city water connection and checked for leaks. Disconnected the hose and connected to the black tank flush connection. Turned on the water but didn't hear it flowing. Went inside the camper and checked the black tank flush and it was quiet. Got a job to fix the backwards vacuum breaker. After checking those connections never found a leak yet. After looking into the underbelly found the water line to the black tank flush was leaking at the kink. Cut the underbelly to get closer to the kinked water line. Cut out the kink in the water line and got a elbow fitting from the parts department to fix the problem. Crimped in the elbow fitting then turned on the water to the black tank flush to check for any more leaks. No leaks occurred. Put a backer in the underbelly to screw the underbelly together then covered with black roof tape.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	SAR	270.00
Z990	MISCELLANEOUS REPAIR	SAR	10.80
Z990	MISCELLANEOUS REPAIR	SAR	79.20
Z990	MISCELLANEOUS REPAIR	SAR	0.00

Parts

Part #	Description	Qty	Price	Total
4794145	1/2" PEX PLASTIC 90 DEGREE ELBOW	1.00	0.13	0.13
4351	QUICK ROOF EXTREME - BLACK FOR RV'S	1.00	31.21	31.21

Subtotal for Job #2: 391.34

Job #3 - Warranty

COMPLAINT: VACUM BREAKER IS BACKWARDS

CAUSE: Vacuum breaker

CORRECTION: When the hose, is connected to the black tank, could not hear the water flow, and the black tank was dry. Went to the vacuum breaker and couldn't hear any water flowing. Disconnected the vacuum breaker. Switched the fittings, that didn't help fix the issue. The vacuum breaker was bad because of being backwards, got a new vacuum breaker from the parts department. Put in a new vacuum breaker and tested the black tank flush again. Disconnected the vacuum breaker and blew air threw the lines and the water line coming from the black tank flush connection was clear.

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	SAR	0.00
Z990	MISCELLANEOUS REPAIR	SAR	54.00
Z990	MISCELLANEOUS REPAIR	SAR	0.00

Subtotal for Job #3: 54.00

Job #4 - Warranty

AREA NEAR THE BACK SPLASH IS TORN AND NEEDS TO BE FIXED

Labor

Code	Description	Mechanic	Total
Z990	MISCELLANEOUS REPAIR	BRM	36.00

Parts

W/O: 77190
Promised Date: 03 JUL 25



Customer #: 55978
BLACKBURN, DEBORAH



Part #	Description	Qty	Price	Total
654642	Seam - Tape - 1" - Fountain Bark	3.00	0.15	0.45

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-TAPE	1.00	14.23	14.23

Subtotal for Job #4: 50.68

Parts Total: 31.79
 Labour Total: 450.00
 Sublet Total: 0.00
 Extras Total: 14.23
WORK ORDER TOTAL: 496.02

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 18 Jul 2025

W/O: 77190
 Promised Date: 03 JUL 25



Customer #: 55978
 BLACKBURN, DEBORAH

