



Warranty Authorization Form

Date: 8/6/2025

Basden RV Center, Inc. DBA/ American RV
600 E Baseline Rd
Evansville, IN 47725
Ph. (812) 867-5200
cbruce@americanrvcenter.com

General Information

Pre-Auth #: 101134 Unit: 7M5TD3322SC305724
Series: Delta Model: 2025DEL294RK
Notes:
Status: Approved with Modifications

Dealer Information

American RV
(812) 867-5200
cbruce@americanrvcenter.com

Basden RV Center, Inc. DBA/ American RV
600 E Baseline Rd
Evansville, IN 47725

Requestor: Ben Hoffman
Return Fax #:
Email: bhoffman@americanrvcenter.com

Operation Line 1

Flat Rate Code: 22287 SHOWER PAN- REPAIR (Photo of full length shower pan and defect)

Fault Code: IMPROPERLY INSTALLED

Serial #:

Model #:

Notes:

Problem: THE SHOWER DRAIN IS LEAKING

Time Requested: 4

Cause: Shower drain pipe was not attached and leaking

Time Allowed: 2.5

Remedy: On doing my flushing the water lines found a leak coming from under the shower. And I found that the pipe was not attached. So I had to remove the shower surround and the shower tub to cut the pipe off. Add new pipe and connect it properly. let the glue set up over night. And the silicone around the shower curtain. Tested it this morning and no leaks. Works properly now

Sublet Repairs: 0.00

Part Return Req: No

Status: Approved with Modifications

Operation Line 2

Flat Rate Code: 18006 12 VOLT - GENERAL REPAIR

Fault Code: LOOSE

Serial #:

Model #:

Notes:

Problem: WHEN RUNNING WATER PUMP THE LIGHTS FLICKER

Time Requested: .2

Cause: Lights flicker when running the water pump

Time Allowed: .2

Remedy: I went straight to the ground wire on the water pump. Disconnect the ground wire and ran it straight to a ground by it self the lights did not flicker. So I checked the connector where it was at and put the wire back in the same connector and ran the water pump and lights did not flicker. So it was a bad connection. So they system works properly now.

Sublet Repairs: 0.00

Part Return Req: No

Status: Approved

Operation Line 3

Flat Rate Code: 22473 AWNING - GENERAL REPAIR (model/serial # required)(Photos required) Fault Code: IMPROPERLY INSTALLED

Serial #: NA

Model #: NA

Notes:

Problem: REAR AWNING ARM HEAD IS HITTING ARM AND NOT LETTING IT CLOSE

Time Requested: .3

Cause: Rear awning arm not closing properly

Time Allowed: .3

Remedy: Loosened the awning arm and shifted the arm just a bit so the awning would close properly. It now works properly

Sublet Repairs: 0.00

Part Return Req: No

Status: Approved