



Warranty Authorization Form

Date: 10/2/2025

Basden RV Center, Inc. DBA/ American RV
600 E Baseline Rd
Evansville, IN 47725
Ph. (812) 867-5200
cbruce@americanrvcenter.com

General Information

Pre-Auth #: 106347 Unit: 7M5FA2828TA011847
Series: Avenue Model: 2026AVE23ML
Notes:
Status: Approved with Modifications

Dealer Information

American RV
(812) 867-5200
cbruce@americanrvcenter.com

Basden RV Center, Inc. DBA/ American RV
600 E Baseline Rd
Evansville, IN 47725

Requestor: Ben Hoffman
Return Fax #:
Email: bhoffman@americanrvcenter.com

Operation Line 1

Flat Rate Code: 18005 12 VOLT - DIAG

Fault Code: MISWIRED

Serial #:

Model #:

Notes:

Problem: GREY TANK WON'T READ

Time Requested: 1.5

Cause: Filled the grey tank up and it wouldn't read. Draned the tank. Cut the underbelly and located the grey tank. Checked wires and connections. Went inside and removed the controll panel. Inspected all wires and connections. I found a grey wire that didnt have anything on it.

Time Allowed: 1.5

Sublet Repairs: 0.00

Remedy: Hooked up city water and started filling the grey tank. Hooked up the grey wire coming through the eall and secured it to the grey wire that comes off the board. The grey tank is reading. Installed controll panel. Taped up underbelly.

Part Return Req: No

Status: Approved

Operation Line 2

Flat Rate Code: 18028 SPEAKER - WIRING - REPAIR

Fault Code: MISWIRED

Serial #:

Model #:

Notes:

Problem: SPEAKER ON INSIDE IS INOP

Time Requested: .3

Cause: Speaker inop.

Time Allowed: .2

Sublet Repairs: 0.00

Remedy: Pulled the speaker and inspected the wires. Tested wires leading to speaker. Removed the radio and inspected the wires. One side is on channel A and the other is on B. Swapped wires to side A and the speaker is now working. Installed radio and speaker.

Part Return Req: No

Status: Approved with Modifications

Operation Line 3

Flat Rate Code: 20044 TOILET - REPAIR INSTALL (model and serial *Fault Code:* IMPROPERLY INSTALLED are required)

Serial #: NA

Model #: NA

Notes:

Problem: THE BLACK TANK FLUSH IS LEAKING

Time Requested: .75

Cause: the vaccum breaker for the tank flush is leaking.

Time Allowed: .75

Remedy: The fittings are tight. removed and replaced cone washers. turned on water hose and tested. no leaks present after replacing the cone washers

Sublet Repairs: 0.00

Part Return Req: No

Status: Approved