

BASDEN RV CENTER, INC dba AMERICAN RV
600 E. Baseline Rd.
Evansville, IN
US
47725
812-867-5200

WARRANTY CLAIM # 77718
MANUFACTURER'S CLAIM #:

Manufacturer: 10024 - FOREST RIVER TRAVEL TRAILER
Customer: 48240 - BRENT CARTER
Address: 10119 BAUMGART RD EVANSVILLE, IN

47725

Phone: 812-626-2014

Stock Number: 11653 - 2026 CHEROKEE GREY WOLF 29TE 4X4TCKE26TX167320

VIN: 4X4TCKE26TX167320 HIN: SER#: 4X4TCKE26TX167320

Mileage: 0

Work Order Comp: 10 SEP 25

Auth. No:

Dealer #:

Warr. Date: 29 AUG 25

Work Order Date: 02 SEP 25

Inv #: 422073

WO # Job # Description JOB INFORMATION

77718 8 ONE OF THE CURTAIN RODS AT THE WINDOW BY THE DINETTE BROKE.
Curtain rod broken
Inspection of the curtain rod found that is broken and put in a
parts request. Got the part and replaced the broken one. All good

77718 9 THE 30 AMP OUTLET DOES NOT STAY CLOSED
30 amp plug wont stay closed
Inspection of the plug. The factory set it right in the middle of
a rib. And then they tightened down the screws and bowed the
plastic and the receptacle door wouldn't stay shut. Even when i
cut out for the rib. So i got a new receptacle and cut clearance
spots for the rib.

77718 1 CUSTOMER ADVISES THAT THE SHOWER IS LEAKING BY THE TOILET SIDE
WHEN TAKING A SHOWER. IT DRAINS PRETTY GOOD WHEN THE SHOWER HEAD
IS AIMED TOWARDS THE DRAIN, BUT IS LEAKS WHEN IT HITS THE SIDE.
Shower leaking
Customer stated shower leaking when water hits the shower doors
by toilet. I found one small area that it might be coming from. I
put clear silicone in that spot. I couldn't get it to leaking

77718 2 CUSTOMER ADVISES THAT THE REAR ENTRY DOOR HAS TO BE SLAMMED HARD
TO CLOSE.
Back entry door hard to open
Adjusted the hinge and the striker and door closes properly now

Claim : 77718

```

*****
WO #      Job #   Description      JOB INFORMATION
*****
77718      3      CUSTOMER ADVISES THAT THE RANGE VENT IS MAKING A VERY LOUD NOISE
              Hood fan making noise
              After inspection of the hood fan. The fan blade was hitting on
              the screen. So i put a shims on the mounting bracket to give the
              fan blades more clearance. Fan works properly now.

77718      7      ONE OF THE CABINET DOORS ABOVE THE RANGE VENT IS NOT EVEN WITH
              THE OTHER ONE
              Cabinet doors not even
              Adjusted the doors. They are even now

```

```

*****
Part No      Job#   Description      PARTS      Qty      Price      Total
*****
RVDA285      8      A285 SIDE CURTAIN HOLD DOWN      1.00      5.41      5.41
VLPA10-30INBK 9      A10-30INBKVP 30A POWER INLET - BL 1.00      44.33      44.33

```

```

*****
Lab Code     Job#   Description      LABOUR      Hrs      Rate      Total
*****
Z990          8      MISC LABOUR CODE (EXTERNAL)      0.10      185.00      18.50
Z990          8      MISC LABOUR CODE (EXTERNAL)      0.00      185.00      0.00
Z990          9      MISC LABOUR CODE (EXTERNAL)      0.00      185.00      0.00
Z990          9      MISC LABOUR CODE (EXTERNAL)      0.00      185.00      0.00
Z990          9      MISC LABOUR CODE (EXTERNAL)      0.30      185.00      55.50
Z990          1      MISC LABOUR CODE (EXTERNAL)      0.00      185.00      0.00
Z990          1      MISC LABOUR CODE (EXTERNAL)      0.20      185.00      37.00
Z990          1      MISC LABOUR CODE (EXTERNAL)      0.00      185.00      0.00
Z990          2      MISC LABOUR CODE (EXTERNAL)      0.30      185.00      55.50
Z990          3      MISC LABOUR CODE (EXTERNAL)      0.10      185.00      18.50
Z990          7      MISC LABOUR CODE (EXTERNAL)      0.10      185.00      18.50

```

```

Parts Total:      49.74
Labour Total:     203.50
Sublet Total:      0.00
Extras Total:      0.00

```

>>>> Claim Total: 253.24

Customer Signature: _____

Date: _____