



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 77788
Promised Date:
26 SEP 25



Customer #: 56066
BELMONT, KATHLEEN



CUSTOMER WORK ORDER

WO #: 77788 (Appointment Date: 10 SEP 2025 - Time: 10:30am)

Customer: 56066 - BELMONT,
KATHLEEN -

Tag:

Author: BJW

Location: 0915 BH TO CLOSE

Stock #:

Stock Desc: 2026 TT FOREST RIVER
CAMPSIGHT

Chassis #:

Serial #: 5ZT2CRRB7TF081717

Mileage:

Licence:

Invoice #:

Date In: 10 SEP 25

Promised: 30 SEP 25

Date Sched:

Completed: 15 SEP 25

Warr. Date:

Job #1 - Warranty

COMPLAINT: HOSE UNDER THE BATHROOM SINK HAS COME LOOSE AND IS LEAKING

CAUSE: Loose water connection.

CORRECTION: Tightened all 5 connections under bathroom sink. Hooked up City water connection and touch tested all connections, everything is dry.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	12.95
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	81.40

Subtotal for Job #1: 94.35

Job #2 - Warranty

COMPLAINT: CUSTOMER WOULD LIKE US TO CHECK THE INSULATION UNDER BATHROOM SINK WHERE THE LEAK IS TO MAKE SURE ITS OK

CAUSE: .

CORRECTION: There are multiple areas that customer could be referencing by the black Tank flush inlet which i added alil more insulation but has to leave it open enough to inspect connection. They could be referencing the cutout behind drain and water lines. There is a small panel on the sink that i found a screw hole in the lower compartment floor, panel partially covers drain and lines... so this could be what they are referencing which is in part how they manufacturer it.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	90.65

Subtotal for Job #2: 90.65

Job #3 - Warranty

COMPLAINT: HAVE A LEAK DOWN THE INSIDE WALL WHEN FLUSHING THE BLACK TANK. THIS IS UNDER THE BATHROOM SINK ALSO.

CAUSE: Mount clamp was mounted over the threaded area needed to tighten seal.

CORRECTION: I awkwardly was able to remove the water lines from the vent check valve and could barely get a drill around the lines to remove screw on mount clamp, when i final was able to get to it the mount was tightened over the threaded area preventing the connection from sealing. I removed and repositioned the clamp. Pressure tested Valve while i had it out of unit, it seals up properly. Reinstalled in unit. Installed



valve in a lower position also.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00
Subtotal for Job #3:			0.00

Parts Total: 0.00
Labour Total: 185.00
Sublet Total: 0.00
Extras Total: 0.00
WORK ORDER TOTAL: 185.00

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 15 Sep 2025

W/O: 77788
Promised Date: 30 SEP 25



Customer #: 56066
BELMONT, KATHLEEN

