



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 77876
Promised Date:
21 OCT 25

CUSTOMER WORK ORDER

WO #: 77876

Customer: 1000 - BASDEN'S AMERICAN
RV -
Tag:
Author: PH
Location: 1020 BH TO CLOSE

Stock #: 11641
Stock Desc: 2026 TT FOREST RIVER
CHEROKEE WOLF PUP 16CM
Chassis #: 5ZT2CKEC6TY039081
Serial #: 5ZT2CKEC6TY039081
Mileage: 0
Licence:

Invoice #:
Date In: 23 SEP 25
Promised: 31 OCT 25
Date Sched:
Completed: 24 OCT 25
Warr. Date:

Job #PDINTT - Internal

Transferred to BAS*77977 on 06 OCT 25
Estimate amount was 0.00
PDI - NEW TRAVEL TRAILER

Labor

Code	Description	Mechanic	Total
Z991	MISC LABOUR CODE (INTERNAL)	JRK	N/C
Z991	MISC LABOUR CODE (INTERNAL)	JRK	N/C
Z991	MISC LABOUR CODE (INTERNAL)	JRK	N/C

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	0.00	N/C	N/C
LPGI	LP - UNIT SALES	0.00	N/C	N/C

Subtotal for Job #PDINTT: 0.00

Job #1 - Warranty

COMPLAINT: THE OUT DOOR WATER ARE IS WARRPED

CAUSE: Corners of water connection are warped and folding.

CORRECTION: Received new Water Connection hookup. Removed old one and disconnected the City and Fresh Tank fill hoses. Cleaned the majority of old sealant. Installed Puddy around edges of new Hookup. Hooked up city and fill connections to new Hookup. Installed with new screws and added 2 more screws to top corners and sealed around with Clear Sealant.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	55.50
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

Parts

Part #	Description	Qty	Price	Total
94223	CITY/GRAVITY DISH, PLASTIC CHECK VAL	1.00	19.36	19.36

Subtotal for Job #1: 74.86

Job #2 - Warranty

COMPLAINT: THE ENTRY DOOR SEAL IS NOT INSTALLED CORRECTLY

CAUSE: Seal incorrectly installed and pinched in frame when shut.

CORRECTION: Door seal was not correctly installed and is being pinched between the door and jam when



Customer #: 1000
BASDEN'S AMERICAN RV,



closed. Permanent mark is left on seal and needs replaced. 166 in of seal is needed to replace. Received new seal from parts and installed it. To install like manufacture i had to pull the door hinges.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	55.50
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

Parts

Part #	Description	Qty	Price	Total
219210	Seal - D Seal - EPDM - .57" x .44"	14.00	0.42	5.88
Subtotal for Job #2:				61.38

Job #3 - Warranty

COMPLAINT: THE OUTSIDE FRIDGE METAL TIN IS IN ROUGH SHAPE

CORRECTION: Unmounted and removed Outside Fridge from compartment and sprayed down Water marks on Metal with Mineral Spirits and scrubbed them down. Most the White surface grim came off but left tarnish in the metal itself.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	37.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	55.50
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

Parts

Part #	Description	Qty	Price	Total
12009	FLT BLACK SPRAY PAINT	2.00	6.49	12.98
Subtotal for Job #3:				105.48

Job #4 - Warranty

COMPLAINT: ENTRY DOOR IS RUBBING THE FRAME, NEEDS ADJUSTED

CAUSE: Entry door is rubbing frame.

CORRECTION: Pulled screw that holds the little gutter thing and used a block of wood and attempted to hammer over the area rubbing but there is no give to the area and solid on the backside so im assuming the door and frame would have to be removed to either cut back the metal or the wooded frame. Inside the door frame measuring 25 3/8 at bottom, 25 3/8 in the middle, and 25 1/4 at the top. Advised Ben on this.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	55.50
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

Subtotal for Job #4: 55.50

Job #5 - Warranty

COMPLAINT: THE TOUNGE JACK DOES NOT LEVEL THE CAMPER UNLESS THERE IS SOMETHING UNDER THE JACK

CAUSE: Unit has to have a block under it to be able to accurately level the unit.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00

Subtotal for Job #5: 0.00

Job #6 - Warranty

COMPLAINT: THE DECAL ON THE DOOR IS TORN

W/O: 77876
Promised Date: 31 OCT 25



Customer #: 1000
BASDEN'S AMERICAN RV,



CAUSE: Decal has small tear.

CORRECTION: Decal has small damages.

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	BB	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	JRK	0.00
Z990	MISC LABOUR CODE (EXTERNAL)	BB	55.50

Parts

Part #	Description	Qty	Price	Total
F100616132	DECAL, 2025/2026 CHEROKEE DOOR LEGEN	1.00	10.40	10.40

Other Services

Code	Description	Qty	Price	Total
FRT	UPS-DECAL	1.00	15.85	15.85

Subtotal for Job #6: 81.75

Parts Total: 48.62
Labour Total: 314.50
Sublet Total: 0.00
Extras Total: 15.85
WORK ORDER TOTAL: 378.97

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Customer Signature : _____

Date: 24 Oct 2025

W/O: 77876
Promised Date: 31 OCT 25



Customer #: 1000
BASDEN'S AMERICAN RV,

