

FOREST RIVER WARRANTY CLAIM FORM

DEALER ACCOUNT #	0005106	CLAIM STATUS	Authorized
BASDEN RV CENTER INC		CLAIM	2448546
DBA AMERICAN RV CENTER		CLAIM ORIGIN	WEB
600 E BASELINE ROAD		ORIGINAL CLAIM ID	
EVANSVILLE, IN 47725		VIN	5ZT2CABC7SK011502
USA		CHASSIS VIN	
		MILEAGE	0
		SITE/WAREHOUSE	203 / 203
Labor rate:	\$185.00	ITEM #	BCAT134RDX
OWNER INFORMATION		DEALER RO #	77894
KELLY J RODGERS		CLAIM START DATE	09/25/2025
122 E 800 S		CLAIM END DATE	01/01/1900
Fort Branch, IN 47648			
USA			
Retail Date of Purchase	07/19/2025	WARRANTY EXPIRATION DATE	07/19/2026

Claim Line Details

Labor

Line# 1	Operation Code	Operational Description		
	20-66-02-17-000672	Striker Plate or Door Lock - Exterior/Entry Doors/Adjust/Latch		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2025-09-25 16:37:43 :: ENTRY DOOR KEY WILL JUST SPIN AND WILL NOT UNLOCK DOOR CODE 370 Dead bolt not engaging. Went to door of camper put a 370 into dead bolt and it would spin. Took plate off back and saw screws were lose holding lock in place. Tightened down screws and put plate back on. Put key into door and the deadbolt locks and unlocks			
	Model#	Dlr Sub Hrs	0.20	Sub Labor Amt \$37.00
	Serial#	Appr Hrs	0.20	Appr Labor Amt \$37.00
	Notes			

Labor

Line# 2	Operation Code	Operational Description		
	20-58-24-00-000608	Metal - Aluminum Siding, each sheet - Exterior/Metal, Aluminum Siding/Repair/ No Tread Code		
	Complaint, Cause, Correction			
	Original Note : bhoffman@americanrvcenter.com, 2025-09-25 16:39:42 :: THE FRONT LOOKS LIKE IT WAS JUST BOWED AND COMING APARTS Front cap coming off Brought camper in went to roof to remove silcione around screws to get out. Pulled staples out of cap piece. Removed silicone and took out screw holding led strip in. Cut wires to led strip to pull out and remove screws formbottom cap. Repeated process on other side to completely remove led strip on both sides. Took heat gun to side of camper to loosen putty and pull front plate down removed old stables that are not in place. Added new stables across to secure metal down into place. Removed screws fro, bottom piece to put back in place. Added side rail screws back into place. Silcined both inside and outter side of side rails on both sides of camper. Added led light strip back after wiring back together. Sent both strips through and screwed into place on top. Silcined holes to seal. Tested led strip. Both work properly			
Model#	Dlr Sub Hrs	4.00	Sub Labor Amt	\$740.00
Serial#	Appr Hrs	4.00	Appr Labor Amt	\$740.00
	Notes			
	WAS THIS THE DIAMOND PLATE POPPING LOOSE?			
	it was the middle metal when it popped loose the diamond plate came loose			
	AUTHORIZED AS REQUESTED			

Submitted	Labor Amt	\$777.00	Approved	Labor Amt	\$777.00
	Parts & Freight	\$0.00		Parts & Freight	\$0.00
	Total	\$777.00		Total	\$777.00

DEALER

DATE

SIGNATURE

I certify that I have performed these repairs consistent with Forest River Policies.

CUSTOMER

DATE

SIGNATURE

All repairs described have been inspected and are satisfactory.