



600 E. Baseline Rd.
Evansville, IN 47725

www.AmericanRVCenter.com

812.867.5200
FAX 812.868.1012

W/O: 77894



Customer #: 43091
RODGERS, KELLY



CUSTOMER WORK ORDER

WO #: 77894 (Appointment Date: 25 SEP 2025 - Time: 03:00am)

Customer: 43091 - RODGERS, KELLY -
812-677-6025

Tag:

Author: BH

Location: 0926 CHECK STATUS WITH
CV

Stock #: 11614

Stock Desc: 2025 TT COACHMEN

CATALINA SUMMIT 134RDX

Chassis #: 5ZT2CABC7SK011502

Serial #: 5ZT2CABC7SK011502

Mileage:

Licence:

Invoice #:

Date In: 24 SEP 25

Promised:

Date Sched:

Completed: 26 SEP 25

Warr. Date: 19 JUL 25

Job #1 - Warranty

COMPLAINT: ENTRY DOOR KEY WILL JUST SPIN AND WILL NOT UNLOCK DOOR CODE 370

CAUSE: Dead bolt not engaging.

CORRECTION: Went to door of camper put a 370 into dead bolt and it would spin. Took plate off back and saw screws were loose holding lock in place. Tightened down screws and put plate back on. Put key into door and the deadbolt locks and unlocks

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	CCV	37.00

Other Services

Code	Description	Qty	Price	Total
SS	SHOP SUPPLIES	1.00	0.00	0.00

Subtotal for Job #1: 37.00

Job #2 - Warranty

COMPLAINT: THE FRONT LOOKS LIKE IT WAS JUST BOWED AND COMING APARTS

CAUSE: Front cap coming off

CORRECTION: Brought camper in went to roof to remove silicone around screws to get out. Pulled staples out of cap piece. Removed silicone and took out screw holding led strip in. Cut wires to led strip to pull out and remove screws from bottom cap. Repeated process on other side to completely remove led strip on both sides. Took heat gun to side of camper to loosen putty and pull front plate down removed old staples that are not in place. Added new staples across to secure metal down into place. Removed screws from bottom piece to put back in place. Added side rail screws back into place. Siliconed both inside and outer side of side rails on both sides of camper. Added led light strip back after wiring back together. Sent both strips through and screwed into place on top. Siliconed holes to seal. Tested led strip. Both work properly

Labor

Code	Description	Mechanic	Total
Z990	MISC LABOUR CODE (EXTERNAL)	CCV	277.50
Z990	MISC LABOUR CODE (EXTERNAL)	CCV	462.50

Parts

Part #	Description	Qty	Price	Total
F100359506	SILICONE, NEUTRAL CURE SILICONE 10.3	1.00	13.66	13.66
219088	SILICONE II BLACK	1.00	13.56	13.56



Subtotal for Job #2: 767.22

W/O: 77894

Parts Total: 27.22
Labour Total: 777.00
Sublet Total: 0.00
Extras Total: 0.00
WORK ORDER TOTAL: 804.22

Thank you for being a valued customer. We appreciate your business.

All labor is guaranteed for 90 days from invoice date. Guarantee is limited to work performed. Consequential damages are not covered. All guaranteed work must be completed in our service department.

Date: 26 Sep 2025

Customer Signature : _____



Customer #: 43091
RODGERS, KELLY

